STAMFORD

HC Alternators

Owner Manual

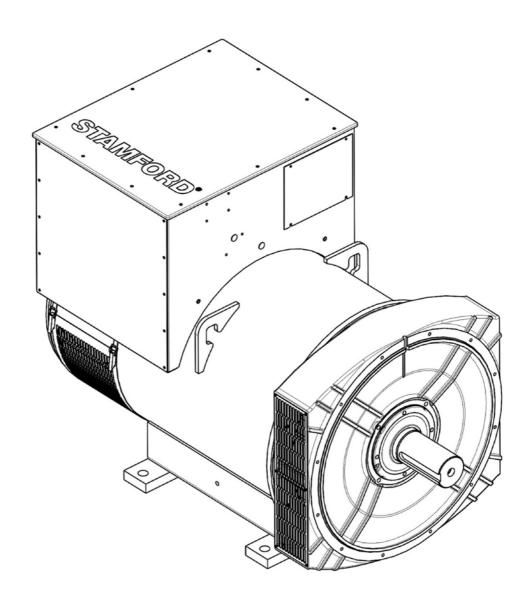


Table of Contents

1.	FOREWORD1. The Manual	1 1
2		
۷.	SAFETY PRECAUTIONS	3
	2.1 Safety Information and Notices used in this Manual	3
	2.2 General Guidance	3
	2.3 Skill Requirements of Personnel	3
	2.4 Risk Assessment	3
	2.5 Personal Protective Equipment (PPE)	4
	2.6 Noise	4
	2.7 Electrical Equipment	4
	2.8 Lock Out/Tag Out	4
	2.9 Strong Magnetic Field	5
	2.10 Lifting	5
	2.11 Alternator Operating Areas	6
	2.12 Hazard Warning Labels	6
3.	SAFETY DIRECTIVES AND STANDARDS	9
	, ,	10
	,	12
	· ·	13
	3.4 Additional Information for CSA Compliance	14
1	INTRODUCTION	15
4.		15
	· ·	
		15
		15
		15
	4.5 Product Authentication	16
5.	APPLICATION OF THE ALTERNATOR	17
٠.		17
		17
		17
		17
		18
		18
		18
		18
		19
		19
	·	19
		19
	y	19
		20
	· · · · · · · · · · · · · · · · · · ·	21
	5.9.1 Sealed Bearings	21

	5.9.2 Re-greasable Bearings	2′
	5.9.3 Bearing Life	2
	5.9.4 Health Monitoring of the Bearings	2
	5.9.5 Bearing 'Service Life' Expectancy	2
	5.9.6 Standby Applications	2′
_	INIOTALL ATION INTO THE OFNEDATOR OFT	
6.	INSTALLATION INTO THE GENERATOR SET	23
	6.1 Alternator Dimensions	23
	6.2 Lifting the Alternator	23
	6.3 Storage	23
	6.3.1 After Storage	23
	6.3.2 Storage Instruction	24
	6.4 Generator Set Coupling	24
	6.5 Single Bearing	26
	6.6 Two Bearing	27
	6.7 Pre-Running Checks	27
	6.8 Direction of Rotation	27
	6.9 Phase Rotation	28
	6.10 Voltage and Frequency	28
	6.11 AVR Settings	28
	6.12 Electrical Connections	28
		29
	6.13 Grid Connection: Voltage Surges and Micro-Interruptions	29
	6.14 Varying Load	
	6.15 Synchronization	30
	6.15.1 Parallel or Synchronizing Alternators	30
7.	SERVICE AND MAINTENANCE	33
	7.1 Recommended Service Schedule	33
	7.2 Bearings	36
	7.2.1 Introduction	36
	7.2.2 Safety	36
	7.2.3 Re-Grease Bearings	37
	7.3 Controls	38
	7.3.1 Introduction	38
	7.3.2 Safety	38
	7.3.3 Connection Test Requirements	38
	7.3.4 Inspect and Test	38
	7.4 Cooling System	39
	7.4.1 Introduction	39
	7.4.2 Safety	4(
	7.4.3 Cooling System Test Requirements	4
	7.4.4 Inspect and Clean	41
	7.5 Coupling	41
	7.5.1 Introduction	4
	7.5.2 Safety	42
	7.5.3 Coupling Test Requirements	42
	7.5.4 Inspect Mounting Points	42
	7.6 Rectifier System	43
	•	
	7.6.1 Introduction	4.
	7.6.1 Introduction	43 43

	7.6.3 Test and Replace Rectifier System Component Requirements	44 44
	7.6.5 Test and Replace Diodes	44
	7.7 Temperature Sensors	45
	7.7.1 Introduction	45
	7.7.2 Safety	46
	7.7.3 Test RTD Temperature Sensors	46
	7.7.4 Test PTC Temperature Sensors	47
	7.8 Windings	47
	7.8.1 High Voltage Test	47
	7.8.2 Introduction	47
	7.8.3 Safety	48
	7.8.4 Requirements	48
	7.8.5 Test the Electrical Resistance of Windings	48
	7.8.6 Test the Insulation Resistance of Windings	49
	7.8.7 Dry the Insulation	50
8.	PARTS IDENTIFICATION	53
	8.1 HC4 Single Bearing Alternator	53
	8.2 HC4 Two Bearing Alternator	54
	8.3 HC5 Single Bearing Alternator	55
	8.4 HC5 Two Bearing Alternator	56
	8.5 HC6 Single Bearing Alternator	57
	8.6 HC6 Two Bearing Alternator	58
	8.7 HC Parts and Fasteners	59
a	TECHNICAL DATA	61
Э.	9.1 HC Winding Resistances	61
	9.1 FIG Winding Resistances	01
10.	. SERVICE PARTS	63
	10.1 Parts Orders	63
	10.2 Customer Service	63
	10.3 Recommended Service Parts	63
	10.4 Klüber Asonic GHY72 Grease	64
11.	. END OF LIFE DISPOSAL	65
- • •	11.1 Recyclable material	65
	11.2 Items requiring specialist treatment	65
	11.3 Waste material	65

Table of Contents 07-2019

This page is intentionally blank.

1 Foreword

1.1 The Manual

This manual contains guidance and instructions for the installation and operation of the alternator. This manual does not include instructions for servicing and maintaining the alternator. Contact CGT Customer Service for details.

Before operating the alternator, read this manual and make sure that all personnel who work on the equipment have access to the manual and all additional documentation supplied with it. Misuse and failure to follow the instructions, and the use of non-approved parts, may invalidate the product warranty and lead to potential accidents.

This manual is an essential part of the alternator. Make sure that the manual is available to all users throughout the life of the alternator.

The manual is written for skilled electrical and mechanical technicians and engineers, who have prior knowledge and experience of generating equipment of this type. If in doubt, please seek expert advice or contact your local Cummins Generator Technologies subsidiary.

NOTICE

Information in this manual was correct when published. It may be superseded due to our policy of continuous improvement. Please visit www.stamford-avk.com for latest documentation.

1. Foreword 07-2019

This page is intentionally blank.

2 Safety Precautions

2.1 Safety Information and Notices used in this Manual

Danger, Warning and Caution panels are used in this manual to describe the sources of hazards, their consequences and how to avoid injury. Notice panels emphasize important or critical instructions.

▲ DANGER

Danger indicates a hazardous situation which, if not avoided, WILL result in death or serious injury.

⚠ WARNING

Warning indicates a hazardous situation which, if not avoided, COULD result in death or serious injury.

⚠ CAUTION

Caution indicates a hazardous situation which, if not avoided, COULD result in minor or moderate injury.

NOTICE

Notice refers to a method or practice which can result in product damage, or to draw attention to additional information or explanations.

2.2 General Guidance

NOTICE

These safety precautions are for general guidance and supplement your own safety procedures and all applicable laws and standards.

2.3 Skill Requirements of Personnel

Service and maintenance procedures must only be carried out by experienced and qualified engineers, who are familiar with the procedures and the equipment.

2.4 Risk Assessment

A risk assessment has been performed on this product by Cummins, however a separate risk assessment must be performed by the user/operating company to establish all personnel-related risks. All affected users must be trained on the identified risks. Access to the Power Plant/Generator Set during operation must be restricted to persons who have been trained on these risks.

2. Safety Precautions 07-2019

2.5 Personal Protective Equipment (PPE)

All persons operating, servicing, maintaining or working in or with a power plant or a generator set must wear appropriate Personal Protective Equipment (PPE)

Recommended PPE includes:

- · Ear and Eye Protection
- · Head and face protection
- · Safety footwear
- · Overalls that protect the lower arms and legs

Ensure that all persons are fully aware of the emergency procedures in case of accidents.

2.6 Noise

⚠ WARNING

Noise

Noise from a running alternator can cause serious injury by permanent hearing damage. To prevent injury, wear appropriate personal protection equipment (PPE).

Maximum A-weighted noise emissions may reach 109 dB(A). Contact the supplier for application-specific details.

2.7 Electrical Equipment

DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns.

To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

All electrical equipment can be dangerous if not operated correctly. Always install, service and maintain the alternator in accordance with this manual. Work that requires access to electrical conductors must comply with all applicable local and national electrical safety procedures for the voltages involved and any site specific rules. Always use genuine branded replacement parts.

2.8 Lock Out/Tag Out

⚠ WARNING

Reconnected Energy Source

Accidental reconnection of energy sources during service and maintenance work can cause serious injury or death by electric shock, burns, crushing, severing or trapping.

To prevent injury and before starting service and maintenance work, use appropriate lock out/tag out safety procedures to keep the generator set isolated from energy sources. Do not defeat or bypass the lock out/tag out safety procedures.

07-2019 2. Safety Precautions

2.9 Strong Magnetic Field

⚠ WARNING

Strong Magnetic Field

The strong magnetic field from a permanent magnet generator (PMG) or excitation boost system (EBS), can cause serious injury or death by interference with implanted medical devices.

To prevent injury, do not work near a PMG or EBS if you have an implanted medical device.

2.10 Lifting

DANGER

Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping.

To prevent injury and before lifting:

- Check the capacity, condition and attachment of lifting equipment (crane, hoists and jacks, including attachments to anchor, fix or support the equipment).
- Check the capacity, condition and attachment of accessories for lifting (hooks, slings, shackles and eye bolts for attaching loads to lifting equipment).
- Check the capacity, condition and attachment of lifting fixtures on the load.
- Check the mass, integrity and stability (e.g. unbalanced or shifting center of gravity) of the load.

⚠ WARNING

Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping.

To prevent injury and before lifting the alternator:

- Do not lift the complete generator set by the alternator lifting fixtures.
- · Keep the alternator horizontal when lifting.
- Fit drive end and non-drive end transit fittings to single bearing alternators to keep the main rotor in the frame.

Do not remove the lifting label attached to one of the lifting points.

2. Safety Precautions 07-2019

2.11 Alternator Operating Areas

⚠ WARNING

Ejected Debris

Debris ejected during catastrophic failure can cause serious injury or death by impact, severing or stabbing.

To prevent injury:

- Keep away from the air inlet and air outlet when the alternator is running.
- · Do not put operator controls near the air inlet and air outlet.
- Do not cause overheating by running the alternator outside rating plate parameters.
- · Do not overload the alternator.
- · Do not run an alternator with excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

Always wear suitable PPE when working in the hatched areas shown in the diagram or directly in-line with any air inlet/outlet.

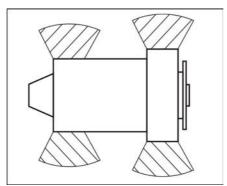


FIGURE 1. HATCHED AREAS

Make sure this consideration is captured in your risk assessment.

2.12 Hazard Warning Labels

⚠ WARNING

Safety Cover Removed

A hazard exposed when a safety cover is removed can cause serious injury or death. To prevent injury:

- Fit the safety labels at the locations shown on the back of the label sheet supplied.
- Observe the safety labels.
- · Refer to the service manual before removing covers.

The generator set manufacturer is responsible for fitting the self-adhesive hazard warning labels supplied with the alternator.

Replace labels that are missing, damaged or painted over.

07-2019 2. Safety Precautions



FIGURE 2. HAZARD WARNING LABELS

2. Safety Precautions 07-2019

This page is intentionally blank.

3 Safety Directives and Standards

STAMFORD Alternators meet applicable European safety directives, and national and international standards relevant to alternators. The alternator must be operated within the limits specified in the relevant standards and within the parameters on the alternator rating plate.

Marine alternators meet the requirements of all the major marine classification societies.

This manual includes declaration template examples. Alternators are supplied with a declaration certificate that displays the product description and unique serial number.

3.1 Low Voltage Directive: Declaration of Conformity

EU DECLARATION OF CONFORMITY Generator Technologies

This synchronous A.C. generator is designed for incorporation into an electricity generating-set and fulfils all the relevant provisions of the following EU Directive(s) when installed in accordance with the installation instructions contained in the product documentation:

2014/35/EU Low Voltage Directive

2014/30/EU The Electromagnetic Compatibility (EMC) Directive

2011/65/EU Restriction on Hazardous Substances in Electrical and Electronic

Equipment (RoHS) Directive

2015/863 Delegated Directive amending Annex II of 2011/65/EU and that the standards and/or technical specifications referenced below have been applied:

EN 61000-6-2:2005 Electromagnetic compatibility (EMC). Generic standards – Part 6-2:

Immunity for industrial environments

EN 61000-6-4:2007+A1:2011 Electromagnetic compatibility (EMC). Generic standards - Part 6-4:

Emission standard for industrial environments

EN ISO 12100:2010 Safety of machinery - General principles for design - Risk

assessment and risk reduction

EN 60034-1:2010 Rotating electrical machines - Part 1: Rating and performance
BS ISO 8528-3:2005 Reciprocating internal combustion engine driven alternating current

generating sets - Part 3: Alternating current generators for generating

sets

BS 5000-3:2006 Rotating electrical machines of particular types or for particular

applications - Part 3: Generators to be driven by reciprocating internal

Serial Number

combustion engines - Requirements for resistance to vibration Technical documentation for the assessment of electrical and

electronic products with the respect to the restriction of hazardous

substances

This declaration has been issued under the sole responsibility of the manufacturer. The object of this Declaration is in conformity with the relevant Union harmonization Legislation.

The name and address of authorised representative, authorised to compile the relevant technical documentation, is the Company Secretary, Cummins Generator Technologies Romania, B-dul Decebal Nr. 116A 200746 Craiova Dolj, Romania.

Signed

Name, Title and Address: Kevan J Simon

Global Technical Director

Cummins Generator Technologies Romania

B-dul Decebal Nr.116A 200746, Craiova Dolj, ROMANIA

Date: 6th March 2019

EN 50581:2012

Description

Sheet 1 450-16383-G

Registered in England under Registration No. 441273., Cummins Generator Technologies Ltd. Registered Office: Fountain Court, Lynch Wood, Peterborough, UK, PE2 6FZ

FIGURE 3. DECLARATION OF CONFORMITY - SHEET 1

EU DECLARATION OF CONFORMITY



The A.C. Generator utilizes hazardous material exemptions as detailed in Annex III of EU Directive 2011/65/EU

Products carrying the following descriptions are considered to be out of scope of RoHS Directive 2011/65/EU, intended to be installed in Large Scale Fixed Installations and for installation into a pre-defined and dedicated location, installed and de-installed by professionals:

LVI80*

LVSI80*

DSG 99*

DSG 114*

DSG 125*

DSG 144*

Where "*" represents any combination of letters and characters completing the specific description of the product

Sheet 2 450-16383-G

Registered in England under Registration No. 441273., Cummins Generator Technologies Ltd. Registered Office: Fountain Court, Lynch Wood, Peterborough, UK, PE2 6FZ

FIGURE 4. DECLARATION OF CONFORMITY - SHEET 2

3.2 Machinery Directive: Declaration of Incorporation

2006/42/EC MACHINERY DIRECTIVE DECLARATION OF INCORPORATION OF PARTLY COMPLETED MACHINERY



Function: Synchronous A.C. generator designed for incorporation into an electricity generating-set.

The partly completed machinery supplied with this declaration:

- Is designed and constructed solely as a non-functional component to be incorporated into a machine requiring completion.
- Is designed to comply with the provisions of the following EU Directives so far as their level of build will allow:

2014/30/EU The Electromagnetic Compataibility (EMC) Directive

2014/35/EU Low Voltage Directive

2011/65/EU Restriction on Hazardous Substances in Electrical and Electronic

Equipment (RoHS) Directive

2015/863 Delegated Directive amending Annex II of 2011/65/EU

- Must not be put into sevice within the European Community ("EC") until the final machinery into which it is to be incorporated has been declared in conformity with the Machinery Directive and all other applicable EC Directives.
- Is designed and constructed to comply with the essential health and safety requirements of the Machinery Directive 2006/42/EC listed on sheet 2 of this Declaration.

The relevant technical documentation is compiled in accordance with the provisions of part B of Annex VII of the Machinery Directive. All relevant information about the partly completed machinery will be provided, in writing, on a reasoned request by the appropriate national authority to its authorized representative. The name and address of authorised representative, authorised to compile the relevant technical documentation, is the Company Secretary, Cummins Generator Technologies Romania, B-dul Decebal Nr. 116A 200746 Craiova Dolj, Romania

The undersigned representing the manufacturer:

Description

Signed:

Name, Title and Address: Kevan J Simon

Global Technical Director

Cummins Generator Technologies Romania

B-dul Decebal Nr.116A 200746, Craiova Dolj, ROMANIA

A SECTION OF THE PARTY OF

Date: 6th March 2019

Serial Number

Sheet 1 450-16388-G

Registered in England under Registration No. 441273., Cummins Generator Technologies Ltd. Registered Office: Fountain Court, Lynch Wood, Peterborough, UK, PE2 6FZ

FIGURE 5. DECLARATION OF INCORPORATION - SHEET 1

2006/42/EC MACHINERY DIRECTIVE DECLARATION OF INCORPORATION OF PARTLY COMPLETED MACHINERY



ESSENTIAL HEALTH AND SAFETY REQUIREMENTS RELATING TO THE DESIGN AND CONSTRUCTION OF PARTLY COMPLETED MACHINERY

1.1 General Remarks

- 1.1.2 : Principles of safety integration
- 1.1.3: Materials and products
- 1.1.5: Design of machinery to facilitate its handling

1.3 Protection Against Mechanical Hazards

- 1.3.1: Risk of loss of stability
- 1.3.2 : Risk of break-up during operation
- . 1.3.3 : Risks due to falling or ejected objects
- 1.3.4: Risks due to surfaces, edges or angles
- 1.3.7: Risks related to moving parts
- 1.3.8.1 : Moving transmission parts

1.4 Guarding*

- 1.4.1 : Guards General requirements*
- 1.4.2.1 : Fixed guards*

1.5 Other Hazards

- 1.5.2 : Static electricity
- 1.5.3: Energy supply other than electric
- 1.5.4: Errors of fitting
- . 1.5.6 : Fire
- 1.5.13: Emmisions of hazardous materials and substances

1.7 Information

- . 1.7.1: Information and warnings on the machinery
- 1.7.4: Instructions

LEGEND

- Essential Health and Safety Requirements not shown are not considered applicable for this Partly Completed Machinery or must be fulfilled by the assembler of the Machinery.
- Essential Health and Safety
 Requirements shown are considered
 applicable for this Partly Completed
 Machinery and have been fulfilled by the
 manufacturer to the extent possible,
 subject to the build requirements of the
 Machinery assembler, the information
 contained in the assembly instructions
 and Cummins bulletins.
- 3 . * Customers may request Partly Completed Machinery without some or all guarding attached. In these cases section 1.4 Guarding does not apply and the Essential Health and Safety Requirements for guarding must be fulfilled by the assembler of the Machinery

The A.C. Generator utilizes hazardous material exemptions as detailed in Annex III of EU Directive 2011/65/EU.

Products carrying the following descriptions are considered to be out of scope of RoHS Directive 2011/65/EU, intended to be installed in Large Scale Fixed Installations and for installation into a pre-defined and dedicated location, installed and de-installed by professionals:

LVI80*

LVSI80*

DSG 99*

DSG 114*

DSG 125*

DSG 144*

Where "*" represents any combination of letters and characters completing the specific description of the product.

Sheet 2

450-16388-G

Registered in England under Registration No. 441273., Cummins Generator Technologies Ltd. Registered Office: Fountain Court, Lynch Wood, Peterborough, UK, PE2 6FZ

FIGURE 6. DECLARATION OF INCORPORATION - SHEET 2

3.3 Additional Information for EMC Compliance

STAMFORD alternators are designed to meet EMC emissions and immunity standards for industrial environments. Additional equipment may be required when the alternator is installed in residential, commercial and light industrial environments.

The installation 'earth/ground' arrangements require the connection of the alternator frame to the site protective earth conductor using a minimum lead length.

Installation, maintenance and servicing must be carried out by adequately trained personnel fully aware of the requirements of the relevant EC directives.

NOTICE

Cummins Generator Technologies is not liable for EMC compliance if unauthorized parts, not of STAMFORD brand, are used for maintenance and servicing.

3.4 Additional Information for CSA Compliance

To comply with Canadian Standards Association (CSA) regulations, all external wiring and components must be rated at the alternator rated voltage shown on the rating plate label.

Introduction 4

4.1 **General Description**

HC alternators are of brushless rotating field design, available up to 690 V, 50 Hz (1000 RPM, 6 pole and 1500 RPM, 4 pole) or 60 Hz (1200 RPM, 6 pole and 1800 RPM, 4 pole), and built to meet BS5000 Part 3 and international standards.

HC alternators are available self-excited, where excitation power is from the main output windings, or separately-excited, where a permanent magnet generator (PMG) supplies excitation power.

4.2 **Alternator Name**

Example: C 2 HC HC 3 4 = without PMG) HCK = dedicated, not HC6) marine) = NDE, 2 = DE & NDE) Number of bearings Ш HC4, HC5, HC6) Alternator model Σ Number of poles HC = standard, Excitation (3 = with PMG, Alternator type Application (I = industrial, I length Frame size ပ (4, 5, 6)ď Core

TABLE 1. HC ALTERNATOR NAMING FORMAT

Serial Number Location 4.3

A unique serial number is stamped into the upper section of the frame.

Rating Plate 4.4

The fixed rating plate label states the intended operating parameters of the alternator.

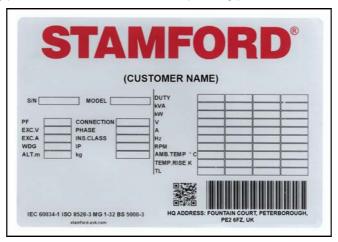


FIGURE 7. GLOBAL STAMFORD AC ALTERNATOR RATING PLATE

Š,

4. Introduction 07-2019

4.5 Product Authentication

The STAMFORD high security, anti-counterfeit hologram is located on the Tracking Label. Check that the dots are visible around the STAMFORD logo when viewing the hologram from different angles and the word "GENUINE" appears behind the logo. Use a flashlight to see these security features in low ambient light. Check that the alternator is genuine by entering the unique 7 character hologram code at www.stamford-avk.com/verify.



FIGURE 8. TRACKING LABEL



FIGURE 9. DOTS VISIBLE IN LEFT, RIGHT, UPPER AND LOWER VIEWS OF 3D HOLOGRAM

16

5 Application of the Alternator

It is the customer's responsibility to make sure that the selected alternator is suitable for the final application.

5.1 Environment

The alternators are protected to IP23 as standard. IP23 is not adequate protection for use outdoors without additional measures.

TABLE 2. ENVIRONMENTAL SPECIFICATION

Ambient Temperature	-15 °C to 40 °C (5 °F to 104 °F)	
Relative Humidity	< 70%	
Altitude	< 1000 m (3280 ft)	

The alternator has been designed for the environment shown in the table. The alternator can operate outside these conditions if it is rated accordingly; the nameplate gives details. If the operating environment is changed after purchase, refer to the factory for a revised alternator rating.

5.2 Air Flow

TABLE 3. MINIMUM AIR FLOW AND MAXIMUM PRESSURE DIFFERENCE

	Minimum Air flo	Maximum intake to	
Alternator Model and Frequency	50 Hz	60 Hz	outlet pressure difference in mm (in) water gauge
HC4	0.8 (1700)	0.99 (2100)	6 (0.25)
HC5	1.04 (2202)	1.31 (2780)	6 (0.25)
HCK5	1.23 (2615)	1.59 (3366)	6 (0.25)
HC6	1.62 (3420)	1.96 (4156)	6 (0.25)

Make sure that the air inlets and outlets are not blocked while the alternator is running.

5.3 Airborne Contaminants

Contaminants such as salt, oil, exhaust fumes, chemicals, dust, and sand will reduce the effectiveness of the insulation and the life of the windings. Consider using air filters and an enclosure to protect the alternator.

5.4 Air Filters

Air filters trap airborne particulates above 5 microns. The filters must be cleaned or replaced regularly, depending on site conditions. Check the filters frequently to establish an appropriate service interval.

Alternators with factory-fitted filters are rated to account for the reduced flow rate of cooling air. If filters are retrofitted, the alternator rating must be reduced by 5%.

Air filters do not remove water. Keep the filters dry with additional protection. Wet filters further restrict airflow, causing the alternator to overheat and leading to premature failure of the insulation.

5.5 Humid Conditions

The water carrying capacity of air depends on temperature. If the air temperature falls below its saturation point, dew may form on the windings, reducing the electrical resistance of the insulation. In humid conditions, additional protection may be required even if the alternator is fitted inside an enclosure. Anti-condensation heaters are supplied on request.

5.6 Anti-Condensation Heaters

▲ DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

Power to the anti-condensation heater is supplied from a separate source. Anti-condensation heaters raise the air temperature around the windings to deter condensation forming in humid conditions when the alternator is not operating. Best practice is to energize the heaters automatically when the alternator is off.

5.7 Enclosures

Fit an enclosure to protect the alternator from adverse environmental conditions. Make sure that air entering the alternator is of adequate flowrate, free from moisture and contaminants, and below the maximum ambient temperature on the rating plate.

Make sure there is sufficient access around the alternator for safe maintenance.

5.8 Vibration

The alternators are designed to withstand the vibration levels encountered on generator sets built to meet the requirements of ISO 8528-9 and BS 5000-3. (Where ISO 8528 is taken to be broad band measurements and BS5000 refers to the predominant frequency of any vibrations on the generator set).

NOTICE

Exceeding either of the above specifications will have a detrimental effect on the life of the bearings and other components, and may invalidate the alternator warranty.

NOTICE

The terminal box is designed to support the fitted busbars or terminals, transformers, load cables and auxiliary terminal box. Additional mass could cause excessive vibration and lead to failure of the terminal box enclosure and mounting. Refer to the Installation Manual to connect the load cables to the terminal box. Refer to CGT before fixing any additional mass to the terminal box.

5.8.1 **Definition of BS5000–3**

Alternators shall be capable of continuously withstanding linear vibration levels with amplitudes of 0.25 mm between 5 Hz and 8 Hz, and velocities of 9.0 mm/s RMS between 8 Hz and 200 Hz, when measured at any point directly on the carcass or main frame of the machine. These limits refer only to the predominant frequency of vibration of any complex waveform.

5.8.2 Definition of ISO 8528-9

ISO 8528-9 refers to a broad band of frequencies; the broad band is taken to be between 10 Hertz and 1000 Hertz. The table below is an extract from ISO 8528-9 (Table C.1, value 1). This simplified table lists the vibration limits by kVA and speed for acceptable operation of standard generator set designs.

5.8.3 Vibration Frequencies

The main vibration frequencies produced by the alternator are as follows:

- 6-pole 1000 RPM 16% Hz
- 6-pole 1200 RPM 20 Hz
- 4-pole 1500 RPM 25 Hz
- 4-pole 1800 RPM 30 Hz

Vibrations induced in the alternator by the engine are complex. It is the responsibility of the generator set designer to ensure that the alignment and stiffness of the bedplate and mountings do not allow vibration to exceed BS5000 part 3 and ISO 8528 part 9 limits.

5.8.4 Linear Vibration Limits

TABLE 4. HC ALTERNATOR LINEAR VIBRATION LEVEL MEASUREMENTS

Engine Speed RPM (min ⁻¹)	Power Output (kVA)	Vibration Displacement RMS (mm)	Vibration Velocity RMS (mm/s)	Vibration Acceleration RMS (mm/s²)
1300 ≤ RPM ≤ 2000	250 < S	0.32	20	13
720 ≤ RPM < 1300	250 < S ≤ 1250	0.32	20	13
Note: The broadband is taken as 10 Hz - 1000 Hz.				

5.8.5 Linear Vibration Monitoring

We recommend using vibration analyzing equipment to measure vibration at all of the 12 positions shown below. Check that vibration of the generator set is below the limits stated in the standards. If vibration is above the limits, the generator set builder should investigate the root causes and eliminate them. Best practice is for the generator set builder to take initial readings as a reference and for the user to periodically monitor vibration, according to the recommended service schedule, to detect a deteriorating trend.

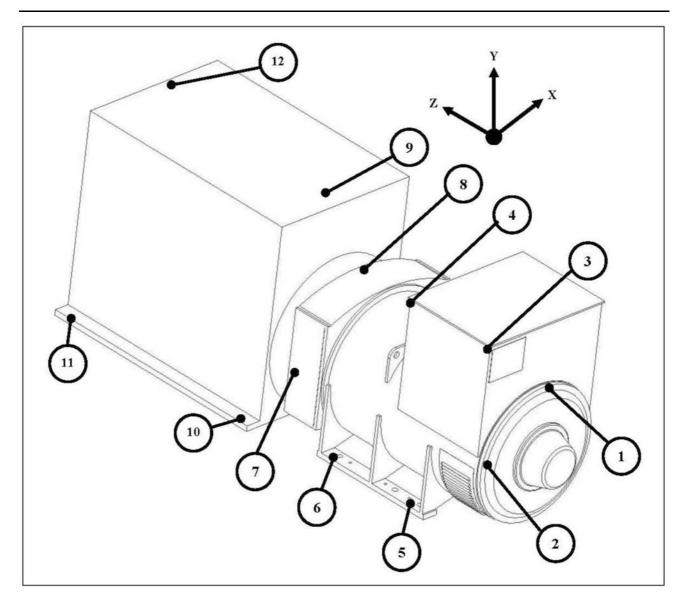


FIGURE 10. VIBRATION MEASUREMENT LOCATIONS

5.8.6 Excessive Vibration

⚠ WARNING

Ejected Debris

Debris ejected during catastrophic failure can cause serious injury or death by impact, severing or stabbing.

To prevent injury:

- · Keep away from the air inlet and air outlet when the alternator is running.
- · Do not put operator controls near the air inlet and air outlet.
- Do not cause overheating by running the alternator outside rating plate parameters.
- Do not overload the alternator.
- Do not run an alternator with excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

If the measured vibration of the generator set is not within the limits:

- 1. Consult with the generator set manufacturer to reduce vibration to an acceptable level.
- Contact Cummins Generator Technologies to assess the impact on bearing and alternator life expectancy.

5.9 Bearings

5.9.1 Sealed Bearings

Inspect sealed-for-life bearings periodically, according to the recommended service schedule in this manual. Check for signs of wear, fretting or other detrimental features. Damage to seals, grease leakage or discoloration of the bearing races indicate that the bearing may need to be replaced.

5.9.2 Re-greasable Bearings

Each bearing housing is connected by a grease pipe to an external grease nipple. A label gives the grease type and quantity, and frequency for re-greasing. The recommended grease is a high specification synthetic compound that must not be mixed with grease of a different specification. Refer to the Service and Maintenance chapter for detailed instructions.

5.9.3 Bearing Life

Factors that reduce bearing life or lead to bearing failure include:

- · Adverse operating conditions and environment
- · Stress caused by misalignment of the generator set
- Vibration from the engine that exceeds the limits in BS 5000-3 and ISO 8528-9
- Long periods (including transportation) when the alternator is stationary and subjected to vibration can cause false brinelling wear (flats on the balls and grooves on the races)
- Humid or wet conditions that cause corrosion and deterioration of the grease by emulsification.

5.9.4 Health Monitoring of the Bearings

We recommend that the user checks the bearing condition using vibration monitoring equipment. Best practice is to take initial readings as a reference and periodically monitor the bearings to detect a deteriorating trend. It will then be possible to plan a bearing change at an appropriate generator set or engine service interval.

5.9.5 Bearing 'Service Life' Expectancy

Bearing manufacturers recognize that the service life of bearings depends on factors that are outside their control. Rather than quote a service life, practicable replacement intervals are based on the L10 life of the bearing, the type of grease, and the recommendations of the bearing and grease manufacturers.

For general purpose applications: If the correct maintenance is carried out, vibration levels do not exceed the levels stated in ISO 8528-9 and BS5000-3, and the ambient temperature does not exceed 50 °C, plan to replace the bearings within 30,000 hours of operation.

If in doubt regarding any aspect of bearing life of a STAMFORD alternator, contact the nearest authorized supplier of the alternator or contact Cummins Generator Technologies.

5.9.6 Standby Applications

Run alternators in standby applications at no load for a minimum of 10 minutes every week. For alternators fitted with regreasable bearings, re-grease the bearings every 6 months, regardless of the number of accumulated running hours.

This page is intentionally blank.

6 Installation into the Generator Set

6.1 Alternator Dimensions

Dimensions are included in the data sheet specific to the alternator model. Refer to the rating plate to identify the alternator model.

NOTICE

Data sheets are available from www.stamford-avk.com

6.2 Lifting the Alternator

⚠ WARNING

Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping.

To prevent injury and before lifting the alternator:

- Do not lift the complete generator set by the alternator lifting fixtures.
- · Keep the alternator horizontal when lifting.
- Fit drive end and non-drive end transit fittings to single bearing alternators to keep the main rotor in the frame.

Lift the alternator by hooks or shackles attached to the lifting points (lugs or eyes) provided. A label attached to a lifting point shows the correct lifting arrangement. Use chains of sufficient length, and a spreader bar if necessary, to make sure that the chains are vertical when lifting. Make sure that the capacity of the lifting equipment is sufficient for the alternator mass shown on the label.

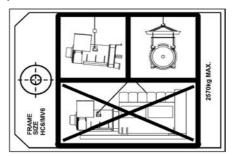


FIGURE 11. LIFTING LABEL

6.3 Storage

If the alternator will not be used immediately, it must be stored in a clean, dry, vibration-free environment. We recommend the use of anti-condensation heaters, when available.

If the alternator can be rotated, turn the rotor a minimum of 6 revolutions every month during storage.

6.3.1 After Storage

After a period of storage, carry out the pre-running checks to determine the condition of the windings. If the windings are damp or the insulation resistance is low, follow one of the drying out procedures (see Chapter 7 on page 33).

Before putting the alternator into service, refer to the following table.

TABLE 5. BEARING STORAGE

Bearing Type	Not Rotated during Storage	Rotated during Storage
Sealed Bearing(s)	If stored less than 12 months, put the alternator into service. If stored more than 12 months, replace the bearing(s) then put the alternator into service.	If stored less than 24 months, put the alternator into service. If stored more than 24 months, replace the bearing(s) then put the alternator into service.
Re-greasable Bearing(s)	If stored less than 12 months, put the alternator into service. If stored more than 12 months, replace the bearing(s) then put the alternator into service.	If stored less than 6 months, put the alternator into service. If stored between 6 and 24 months, re-grease the bearing(s) during the first run then put the alternator into service. If stored more than 24 months, replace the bearing(s) then put the alternator into service.

6.3.2 Storage Instruction

When an alternator is stationary, in storage or otherwise, it may be subjected to environmental factors, such as vibration, humidity, temperature and airborne contaminant particles, that could degrade the bearing arrangements.

Contact CGT for advice in advance if the alternator will be stationary for long periods.

6.4 Generator Set Coupling

MARNING

Moving Mechanical Parts

Moving mechanical parts during generator set coupling can cause serious injury by crushing, severing or trapping.

To prevent injury, keep arms, hands and fingers away from mating surfaces when coupling the generator set.

Efficient operation and long component life depend on minimizing mechanical stresses on and damage to the alternator. When coupled in a generator set, misalignment and vibration interactions with the prime mover engine can cause mechanical stress. In addition, rotating the alternator rotor using a lever against the vanes of the cooling fan will damage the fan. The fan is not designed to withstand such forces.

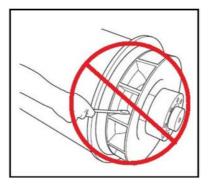


FIGURE 12. DO NOT ROTATE THE ALTERNATOR ROTOR WITH A LEVER

Generator sets need a substantial flat continuous bedplate to suit the installation site floor loading with engine and alternator mounting pads to make a firm base for accurate alignment. The height of all mounting pads must be within 0.25 mm for skid mounting, 3 mm for non-adjustable anti-vibration mounts (AVM) or 10 mm for adjustable height AVMs. Use shims to achieve level. The rotational axes of alternator rotor and engine output shaft must be coaxial (radial alignment) and perpendicular to the same plane (angular alignment). The axial alignment of the alternator and engine coupling must be within 0.5 mm, to allow for thermal expansion without unwanted axial force on the bearings at operating temperature.

Vibration can occur by flexing of the coupling. The alternator is designed for a maximum bending moment not exceeding 140 kgm (1000 lbs ft) for frame sizes 4 and 5, and not exceeding 275 kgm (2000 lbs ft) for frame size 6. Check the maximum bending moment of the engine flange with the engine manufacturer.

Close-coupling of alternator and engine can increase the rigidity of the generator set. Both single and two bearing alternators can be close-coupled. The generator set builder must supply guarding for open-coupled applications.

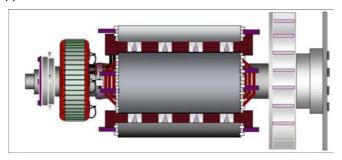


FIGURE 13. SINGLE BEARING ALTERNATOR ROTOR SHOWING COUPLING DISCS BOLTED TO DRIVE END COUPLING HUB AT RIGHT

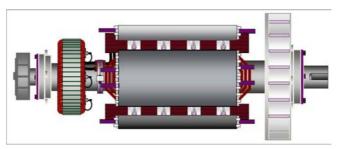


FIGURE 14. TWO BEARING ALTERNATOR ROTOR SHOWING SHAFT WITH KEYWAY FOR FLEXIBLE COUPLING AT RIGHT

To prevent rust during transit and storage, the alternator frame spigot, rotor coupling plates and shaft extension have been treated with a rust preventative coating. Remove this before coupling the generator set.

6.5 Single Bearing

MARNING

Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping.

To prevent injury and before lifting the alternator:

- Do not lift the complete generator set by the alternator lifting fixtures.
- · Keep the alternator horizontal when lifting.
- Fit drive end and non-drive end transit fittings to single bearing alternators to keep the main rotor in the frame.
- 1. Remove the drive end transit bracket that keeps the rotor in place during transport.
- Remove the air outlet covers from the drive end of the alternator to access the coupling and adaptor bolts.
- 3. Make sure the coupling discs are concentric with the adaptor.
- 4. Fit two alignment dowels into flywheel bolt holes 180 degrees apart to help align the disc and the flywheel.
- Lift and offer the alternator to the engine, barring the engine over by hand to align discs and flywheel.
- 6. Engage the alignment dowels into coupling disc bolt holes and push the alternator towards the engine until the coupling discs are against the flywheel face.

NOTICE

Do not pull the alternator to the engine using bolts through the flexible discs.

- 7. Fit the adaptor bolts, using heavy gauge washers under the heads. Tighten the adapter bolts evenly around the adapter.
- 8. Check the torque of each bolt in a clockwise direction around the bolt circle to ensure all the bolts are tight. Refer to the engine manufacturer's manual for correct tightening torque.
- 9. Remove the alignment dowels. Fit the coupling bolts, using heavy gauge washers under the heads.
- Tighten the bolts to fix the coupling disc to the flywheel in the sequence shown in <u>Figure 15 on page 27</u>.
- 11. Check the torque of each bolt in a clockwise direction around the bolt circle to ensure all the bolts are tight.
- 12. Remove the rotor support bracket, if supplied.
- Replace all covers.

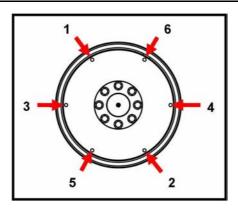


FIGURE 15. FIXING SEQUENCE

6.6 Two Bearing

A flexible coupling, designed to suit the specific engine/alternator combination, is recommended to minimise torsional vibration effects.

If a close coupling adaptor is used the alignment of machined faces must be checked by offering the alternator up to the engine. Shim the alternator feet if necessary.

6.7 Pre-Running Checks

Before starting the generator set, test the insulation resistance of windings and check that all connections are tight and in the correct location. Make sure the alternator air path is clear of obstructions. Replace all covers.

6.8 Direction of Rotation

The fan is designed for clockwise rotation, as viewed from the drive end of the alternator (unless otherwise specified when ordered). If the alternator must run counter-clockwise, please seek advice from Cummins Generator Technologies.

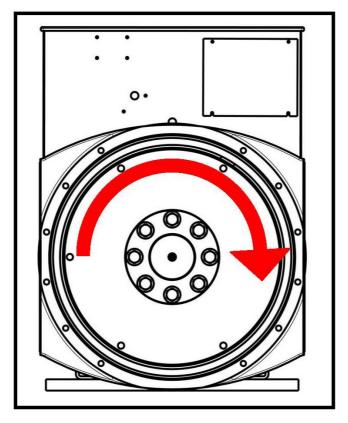


FIGURE 16. DIRECTION OF ROTATION

6.9 Phase Rotation

Main stator output is connected for a phase sequence of U V W when the alternator runs clockwise, as viewed from the drive end. If the phase rotation must be reversed, the customer must re-connect the output cables in the terminal box. Ask Cummins Generator Technologies for a circuit diagram of 'reverse phase connections'.

6.10 Voltage and Frequency

Check that the voltage and frequency shown on the alternator rating plate meet the requirements of the generator set application. Refer to detailed instructions in the AVR manual for adjustments.

6.11 AVR Settings

The AVR is factory set for initial running tests. Check that the AVR settings are compatible with your required output. Refer to detailed instructions in the AVR manual for on- and off-load adjustments.

6.12 Electrical Connections

⚠ WARNING

Incorrect Electrical Installation and System Protection

Incorrect electrical installation and system protection can cause serious injury or death by electric shock and burns.

To prevent injury, installers must be qualified and are responsible for meeting appropriate inspectorate and local electricity authority requirements and site safety rules.

NOTICE

The terminal box is designed to support the fitted busbars or terminals, transformers, load cables and auxiliary terminal box. Additional mass could cause excessive vibration and lead to failure of the terminal box enclosure and mounting. Refer to CGT before fixing any additional mass to the terminal box. Panels must be removed to be drilled or cut, to prevent swarf entering the terminal box or alternator.

Fault current curves and alternator reactance values are available on request from the factory so that the system designer can calculate the necessary fault protection and/or discrimination.

The installer must check that the alternator frame is bonded to the generator set bedplate, and must bond to site earth. If anti-vibration mounts are fitted between the alternator frame and its bedplate, a suitably-rated earth conductor must bridge across the anti-vibration mount.

Refer to wiring diagrams for electrical connection of the load cables. Electrical connections are made in the terminal box, constructed with removable panels to suit site-specific cable entry and glanding. After wiring, inspect the terminal box, remove all debris using a vacuum cleaner if necessary and check that no internal components are damaged or disturbed.

As standard, the alternator neutral is not bonded to the alternator frame. If required, neutral may be connected to the earth terminal in the terminal box, by a conductor of at least one half of the sectional area of a phase lead.

Load cables must be supported appropriately to avoid a tight radius at the point of entry into the terminal box, clamped at the terminal box gland, and allow at least ±25 mm movement by the generator set on its anti-vibration mountings, without causing excessive stress to the cables and alternator load terminals.

6.13 Grid Connection: Voltage Surges and Micro-Interruptions

Take precautions to prevent transient voltages generated by the connected load and/or the distribution system from causing damage to the alternator components.

To identify any possible risk, all aspects of the alternator's proposed application should be considered, especially the following:

- Loads with characteristics that result in large load step changes.
- Load control by switchgear, and power control by any method likely to generate transient voltage spikes.
- · Distribution systems susceptible to external influences, such as lightning strikes.
- Applications involving parallel operation to a mains supply, where the risk of a mains disturbance in the form of a micro-interruption could occur.

If the alternator is at risk from voltage surges or micro-interruptions, include adequate protection into the generation system, usually with surge arrestors and suppressors, to meet regulations and installation requirements.

Surge protection must reduce the peak voltage at the alternator of a transient pulse of 5 μ s rise time to less than 1.25 x $\sqrt{2}$ x (2 x rated output voltage + 1000 V). Best practise is to fit protective devices close to the output terminals. Refer to guidance from professional bodies and specialist equipment suppliers for further advice.

6.14 Varying Load

Under certain conditions, load variations can reduce alternator life.

Identify any possible risk, especially the following:

 Large capacitive loads (for example Power Factor Correction equipment) can affect alternator stability and cause pole slip. • Stepped grid voltage variation (for example Tap Changing).

If the alternator is at risk from varying load, include adequate protection into the generator set system by under-excitation protection.

6.15 Synchronization

⚠ WARNING

Ejected Debris

Debris ejected during catastrophic failure can cause serious injury or death by impact, severing or stabbing.

To prevent injury:

- · Keep away from the air inlet and air outlet when the alternator is running.
- · Do not put operator controls near the air inlet and air outlet.
- Do not cause overheating by running the alternator outside rating plate parameters.
- · Do not overload the alternator.
- Do not run an alternator with excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

6.15.1 Parallel or Synchronizing Alternators

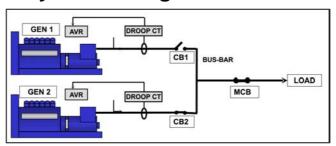


FIGURE 17. PARALLEL OR SYNCHRONIZING ALTERNATORS

The quadrature droop current transformer (Droop CT) gives a signal proportional to reactive current; the AVR adjusts excitation to reduce circulating current and allow each alternator to share reactive load. A factory-fitted droop CT is pre-set for 5% voltage drop at full-load zero power factor. Refer to the supplied AVR manual for droop adjustment.

- The synchronizing switch/breaker (CB1, CB2) must be of a type that will not cause "contact bounce" when it operates.
- The synchronizing switch/breaker must be adequately rated to withstand the continuous full load current of the alternator.
- The switch/breaker must be able to withstanding the rigorous closing cycles during synchronizing and the currents produced if the alternator is paralleled out of synchronizm.
- The closing time of the synchronizing switch/breaker must be under the control of the synchronizer settings.
- The switch/breaker must be capable of operation under fault conditions such as short circuits.
 Alternator data sheets are available.

NOTICE

The fault level may include a contribution from other alternators as well as from the grid/mains utility.

The method of synchronizing should be either automatic, or by check synchronizing. The use of manual synchronizing is not recommended. The settings on the synchronizing equipment should be such that the alternator will close smoothly. For the synchronizing equipment to achieve this, the phase sequence must match the parameters in the table below.

TABLE 6. SYNCHRONIZING EQUIPMENT PARAMETERS

Voltage Difference	+/- 0.5%
Frequency Difference	0.1 Hz/sec
Phase Angle	+/- 10°
C/B Closing Time	50 ms

The voltage difference when paralleling with the grid/mains utility is \pm .

This page is intentionally blank.

7 Service and Maintenance

7.1 Recommended Service Schedule

Refer to Safety Precautions section (Chapter 2 on page 3) of this manual before starting any service and maintenance activity.

Refer to Parts Identification section (Chapter 8 on page 53) for an exploded view of components and fastener information.

The recommended service schedule shows the recommended service activities in table rows, grouped by alternator subsystem. Columns of the table show the types of service activity, whether the alternator must be running, and the service levels. Service frequency is given in running hours or time interval, whichever is sooner. A cross (X) in the cells where a row intersects the columns shows a service activity type and when it is required. An asterisk (*) shows a service activity done only when necessary.

All service levels in the recommended service schedule can be purchased directly from Cummins Generator Technologies Customer Service Department. For details of your nearest service outlet visit www.stamford-avk.com,

- 1. Proper service and repair are vital to the reliable operation of your alternator and the safety of anyone coming into contact with the alternator.
- 2. These service activities are intended to maximize the life of the alternator but shall not vary, extend or change the terms of the manufacturer's standard warranty or your obligations in that warranty.
- 3. Each service interval is a guide only, and developed on the basis that the alternator was installed and is operated in accordance with the manufacturer's guidelines. If the alternator is located and/or operated in adverse or unusual environmental conditions, the service intervals may need to be more frequent. The alternator should be continually monitored between services to identify any potential failure modes, signs of misuse, or excessive wear and tear.

7. Service and Maintenance 07-2019

TABLE 7. ALTERNATOR SERVICE SCHEDULE

	SERVICE ACTIVITY		TYPE				SERVICE LEVEL												
System	X = required * = if necessary	Alternator running	Inspect	Test	Clean	Replace	Commission	Post Commission	250 hrs / 0.5 year	Level 1	1000 hrs / 1 year	Level 2	10,000 hrs / 2 years	Level 3	30,000 hrs / 5 years				
	Alternator rating		Х				Х												
	Bedplate arrangement		X				Х												
	Coupling arrangement		X				Х						*		X				
	Environmental conditions and cleanliness		x				х	x x x		х х		х х		х					
٥	Ambient temperature (inside & outside)			Х			Х		х		х		х		x x		K		x
Alternator	Complete machine - damage, loose parts & earth bonds		X				X	x		х		х		х		2	x		
	Guards, screens, warning and safety labels		X				X	2	X	2	X	2	X	2	x				
	Maintenance access		Χ				Х												
	Electrical nominal operating conditions & excitation	X		X			х)	x x		x x x		X	2	x				
	Vibration*	Х		Х			Х	2	х х		2	X	2	X					
	Condition of windings		Χ				X	Х			X	2	X		X				
sbı	Insulation resistance of all windings (PI test for MV/HV)			X			х		*	,	*	2	X	2	x				
Windings	Insulation resistance of rotor, exciter and PMG			X				2	X		X								
	Temperature sensors	Χ		X			X	2	X		X		X		X				
	Customer settings for temperature sensors		X				X												

34

	SERVICE ACTIVITY		TYPE SERVICE LEVEL														
System	X = required * = if necessary	Alternator running	Inspect	Test	Clean	Replace	Commission	Post Commission	250 hrs / 0.5 year	Level 1	1000 hrs / 1 year	Level 2	10,000 hrs / 2 years	Level 3	30,000 hrs / 5 years		
	Condition of bearings		Х				Х							2	X		
	Grease exhaust & trap				Х)	(2	X	,	X	2	X		
8	Grease in re-greasable bearing(s)	X				X		eve	ry 40	00 to	4500) hou	ırs / 6	6 mo	nths		
Bearings	Sealed bearing(s)		Χ						eve	ery 4	000 t	o 450	0 ho	urs			
Be	Re-greasable & sealed bearing(s)					X						:	*	2	X		
	Temperature sensors	Χ		X			Х)	(X		X		X		
	Customer settings for temperature sensors		х				Х										
Terminal Box	All alternator/customer connections and cabling		X				X)	‹	х		х		2	X		
	Initial AVR & PFC set up	X		X			Х										
ies	AVR & PFC settings	X		X)	(X		X		X		
& Auxiliaries	Customer connection of auxiliaries			Х			х			х х		X	2	X			
_	Function of auxiliaries			X			X)	(X	2	X		X		
Controls	Synchronization settings		Х				Х										
0	Synchronization	Χ		X			X)	(X	2	X		X		
	Anti condensation heater					X						*			X		
Rectifier	Diodes and varistors		X				Х)	(X		X				
Rect	Diodes and varistors					Х									X		
	Air inlet temperature	X		X			Х)	(X		X		X		
ing	Air flow (rate & direction)	Х	Х				Х										
Cooling	Condition of fan		X				Х)	(X		X		X		
	Condition of air filter (where fitted)			Х			Х)	(X		X		X		
	Air filters (where fitted)				Χ	X					*		*		*		
* Fo	r stand-alone alternator or	nly.															

7.2 Bearings

7.2.1 Introduction

NOTICE

Do not overfill a bearing with grease; the bearing may be damaged.

Do not mix lubricant types. Change gloves to handle different lubricant

Assemble bearings in static- and dust-free conditions while wearing lint free gloves.

Store removed parts and tools in static- and dust-free conditions, to prevent damage or contamination.

A bearing is damaged by the axial force needed to remove it from the rotor shaft. Do not reuse a bearing.

A bearing is damaged if the insertion force is applied through the bearing balls. Do not press fit the outer race by force on the inner race, or vice versa.

Do not try to turn the rotor by levering against the cooling fan vanes. The fan will be damaged.

The alternator rotor is supported by a bearing at the non-drive end (NDE) and by either a bearing or a coupling to the prime mover at the drive end (DE).

- Lubricate each re-greasable bearing according to the recommended service schedule with the correct quantity and type of grease, also shown on a label fitted at the grease nipple.
- Inspect each sealed bearing according to the recommended service schedule. Seek advice from CGT if grease has leaked out of the bearing, notifying the bearing type and quantity leaked.

7.2.2 Safety

▲ DANGER

Rotating Mechanical Parts

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping.

To prevent injury and before removing covers over rotating parts, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

⚠ WARNING

Hot Surfaces

Skin contact with hot surfaces can cause serious injury by burns.

To prevent injury, wear appropriate personal protection equipment (PPE).

CAUTION

Grease

Skin contact with grease can cause minor or moderate injury by contact dermatitis.

To prevent injury, wear appropriate personal protection equipment (PPE).

NOTICE

Do not overfill a bearing with grease; the bearing may be damaged.

Do not mix lubricant types. Change gloves to handle different lubricant

Assemble bearings in static- and dust-free conditions while wearing lint free gloves.

Store removed parts and tools in static- and dust-free conditions, to prevent damage or contamination.

A bearing is damaged by the axial force needed to remove it from the rotor shaft. Do not reuse a bearing.

A bearing is damaged if the insertion force is applied through the bearing balls. Do not press fit the outer race by force on the inner race, or vice versa.

Do not try to turn the rotor by levering against the cooling fan vanes. The fan will be damaged.

7.2.3 Re-Grease Bearings

7.2.3.1 Requirements

TABLE 8. RE-GREASING: EQUIPMENT REQUIREMENTS

Requirement	Description
Personal Protective Equipment (PPE)	Wear mandatory site PPE
Consumables	Lint-free cleaning clothsThin disposable gloves
Parts	CGT recommended grease
Tools	Grease gun (calibrated for volume or mass)

7.2.3.2 Re-Grease Method

- 1. For each bearing, identify the grease nipple, re-greasing label and bearing type.
- 2. Make sure the new grease is not contaminated. It must be a uniform whitish-beige color and of stiff consistency throughout.
- 3. Clean the grease gun nozzle and grease nipple.
- 4. Clean the grease exhaust.
- 5. Fit the grease gun to the grease nipple and add the correct quantity of grease.
- 6. Run the alternator for at least 60 minutes, off- or on-load.
- 7. Clean the grease exhaust.
- 8. Inspect the color and consistency of the grease expelled from the exhaust and compare with the new grease, which should be whitish-beige and of stiff consistency.
- 9. Replace the bearing if the expelled grease is severely discolored or absent.

TABLE 9. RE-GREASING: GREASE QUANTITY

	Quantity of Recommended Grease					
Bearing Type	Volume (cm³)	Mass (g)				
Drive End (HC5)	46	41				
Non-drive End (HC5)	33	29				
Drive End (HC6)	75	66				
Non-drive End (HC6)	60	53				

7.3 Controls

7.3.1 Introduction

An operating alternator is a harsh environment for control components. Heat and vibration can cause electrical connections to loosen and cables to fail. Routine inspection and test can identify an issue before it becomes a failure that incurs unplanned downtime.

7.3.2 Safety

A DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns.

To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

⚠ WARNING

Hot Surfaces

Skin contact with hot surfaces can cause serious injury by burns.

To prevent injury, wear appropriate personal protection equipment (PPE).

7.3.3 Connection Test Requirements

TABLE 10. CONNECTION TEST REQUIREMENTS

Requirements	Description
Personal Protective Equipment (PPE)	Wear mandatory site PPE
Consumables	None
Parts	None
Tools	Insulation test meterMultimeter
	Torque wrench

7.3.4 Inspect and Test

1. Remove the terminal box lid

- 2. Check the tightness of fasteners securing the load cables.
- Check that cables are firmly clamped at the terminal box gland, and allow ±25 mm movement by an alternator on anti-vibration mounts.
- 4. Check that all cables are anchored and unstressed within the terminal box.
- 5. Check all cables for signs of damage.
- 6. Check that AVR accessories and current transformers are correctly fitted, and cables pass centrally through current transformers (if fitted).
- 7. If an anti-condensation heater is fitted:
 - a. Isolate the supply and measure the electrical resistance of the heater element(s). Replace the heater element if open circuit.
 - b. Connect together both ends of the heater leads.
 - c. Apply the test voltage between the winding and earth.
 - d. Measure the insulation resistance after 1 minute (IR 1min).
 - e. Discharge the test voltage.
 - f. If the measured insulation resistance is less than the minimum acceptable level, replace the heater element. See **Table 11 on page 39** for values.
- Test the supply voltage to the anti-condensation heater at the heater connection box. 120 VAC or 240 VAC. (depending on cartridge option and shown on a label) should be present when the alternator is stopped.
- 9. Check that the AVR and AVR accessories fitted in the terminal box are clean, securely fitted on anti-vibration mounts, and the cable connectors are firmly attached to the terminals.
- 10. For parallel operation, check that the synchronization control cables are securely connected.
- 11. Refit and secure the terminal box lid.

TABLE 11. TEST VOLTAGE AND MINIMUM ACCEPTABLE INSULATION RESISTANCE FOR NEW AND IN-SERVICE ANTI-CONDENSATION HEATERS

Component	Test Voltage (V)	Minimum Insulation Resistance at 1 minute (MΩ)					
		New	In-service				
Anti-condensation heater	500	10	1				

7.4 Cooling System

7.4.1 Introduction

The alternators are designed to meet standards supporting EU Safety Directives, and are rated for the effect of operating temperature on winding insulation.

BS EN 60085 (≡ IEC 60085) Electrical insulation – Thermal Evaluation and Designation classifies insulation by the maximum operating temperature for a reasonable service life. Although chemical contamination and electrical and mechanical stresses also contribute, temperature is the dominant aging factor. Fan cooling maintains a stable operating temperature below the insulation class limit.

If the operating environment differs from the values shown on the rating plate, rated output must be reduced by

 3% for class H utilization for every 5 °C that the temperature of the ambient air entering the cooling fan exceeds 40 °C, up to a maximum of 60 °C

- 3.5% for class F utilization for every 5 °C that the temperature of the ambient air entering the cooling fan exceeds 40 °C, up to a maximum of 60 °C
- 4.5% for class B utilization for every 5 °C that the temperature of the ambient air entering the cooling fan exceeds 40 °C, up to a maximum of 60 °C
- 3% for every 500 m increase in altitude above 1000 m, up to 4000m, due to the reduced thermal capacity of lower density air, and
- 5% if air filters are fitted, due to restricted air flow.

Note: The values above are cumulative dependant on environmental conditions.

Efficient cooling depends on maintaining the condition of the cooling fan, air filters and gaskets.

7.4.2 Safety

▲ DANGER

Rotating Mechanical Parts

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping.

To prevent injury and before removing covers over rotating parts, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

⚠ WARNING

Hot Surfaces

Skin contact with hot surfaces can cause serious injury by burns.

To prevent injury, wear appropriate personal protection equipment (PPE).

⚠ CAUTION

Dust

Inhaling dust can cause minor or moderate injury by irritating the lungs. Dust can cause minor or moderate injury by irritating the eyes.

To prevent injury, wear appropriate personal protection equipment (PPE). Ventilate the area to disperse dust.

NOTICE

Do not attempt to rotate the alternator rotor by levering against the vanes of the cooling fan. The fan is not designed to withstand such forces and will be damaged.

NOTICE

Filters are designed to remove dust, not moisture. Wet filter elements can cause reduced air flow and overheating. Do not allow filter elements to get wet.

7.4.3 Cooling System Test Requirements

TABLE 12. COOLING SYSTEM TEST REQUIREMENTS

Requirements	Description				
Personal Protective Equipment (PPE)	Wear mandatory site PPE				
	Wear eye protection				
	Wear respiratory protection				
Consumables	Lint-free cleaning cloths				
	Thin disposable gloves				
Parts	Air filters (if fitted)				
	Air filter sealing gaskets (if fitted)				
Tools	None				

7.4.4 Inspect and Clean

NOTICE

A sensor detects the differential pressure caused by blocked filters. If the sensor trips, inspect and clean the air filters more frequently.

- 1. Remove the fan screen.
- 2. Inspect the fan for damaged vanes and cracks.
- 3. Remove air filters (at the fan and terminal box, if fitted) from their frames.
- 4. Wash and dry the air filters and gaskets to remove contaminant particles.
- 5. Inspect the filters and gaskets for damage and replace, as necessary.
- 6. Install the filters and gaskets.
- 7. Re-install the fan screen.
- 8. Reinstate the generator set for running.
- 9. Make sure the air inlets and outlets are not blocked.

7.5 Coupling

7.5.1 Introduction

Efficient operation and long component life rely on minimizing mechanical stresses on the alternator. When coupled in a generator set, misalignment and vibration interactions with the prime mover engine can cause mechanical stress.

The rotational axes of alternator rotor and engine output shaft must be coaxial (radial and angular alignment).

Torsional vibration can cause damage to internal combustion engine shaft-driven systems, if not controlled. The generator set manufacturer is responsible for assessing the effect of torsional vibration on the alternator: Rotor dimensions and inertia, and coupling details are available on request.

7.5.2 Safety

NOTICE

Do not attempt to rotate the alternator rotor by levering against the vanes of the cooling fan. The fan is not designed to withstand such forces and will be damaged.

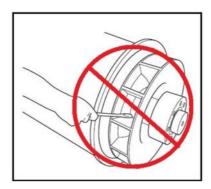


FIGURE 18. DO NOT ROTATE THE ALTERNATOR ROTOR WITH A LEVER

7.5.3 Coupling Test Requirements

TABLE 13. COUPLING TEST REQUIREMENTS

Requirements	Description
Personal Protective Equipment (PPE)	Wear mandatory site PPE
Consumables	None
Parts	None
Tools	Dial gaugeTorque wrench

7.5.4 Inspect Mounting Points

- 1. Check the generator set bedplate and mounting pads are in good condition, not cracked
- 2. Check that rubber in anti-vibration mounts has not perished
- 3. Check vibration monitoring historical records for a trend of increasing vibration

7.5.4.1 Single Bearing Coupling

- 1. Remove the DE adapter screen and cover to access the coupling.
- 2. Check that the coupling discs are not damaged, cracked or distorted, and the coupling disc holes are not elongated. If any are damaged, replace the complete set of discs.
- Check tightness of bolts fixing the coupling discs to the engine flywheel. Tighten in the sequence shown for alternator coupling in the Installation chapter, to the torque recommended by the engine manufacturer.
- 4. Replace the DE adapter screen and drip proof cover.

7.6 Rectifier System

7.6.1 Introduction

The rectifier converts alternating current (AC) induced in the exciter rotor windings into direct current (DC) to magnetize the main rotor poles. The rectifier comprises two semicircular annular positive and negative plates, each with three diodes. In addition to connecting to the main rotor, the DC output of the rectifier also connects to a varistor. The varistor protects the rectifier from voltage spikes and surge voltages that may be present on the rotor under various loading conditions of the alternator.

Diodes provide a low resistance to current in one direction only: Positive current will flow from anode to cathode, or another way of viewing it is that negative current will flow from cathode to anode.

The exciter rotor windings are connected to 3 diode anodes to form the positive plate and to 3 diode cathodes to form the negative plate to give full wave rectification from AC to DC. The rectifier is mounted on, and rotates with, the exciter rotor at the non-drive end (NDE).

7.6.2 Safety

▲ DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

A DANGER

Rotating Mechanical Parts

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping.

To prevent injury and before removing covers over rotating parts, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

7.6.3 Test and Replace Rectifier System Component Requirements

TABLE 14. RECIFIER SYSTEM TEST AND REPLACE REQUIREMENTS

Requirements	Description
Personal Protective Equipment (PPE)	Wear appropriate PPE
Consumables	 Loctite 241 thread locking adhesive Dow Corning silicone heat sink compound type 340 or similar
Parts	Full set of three anode lead diodes and three cathode lead diodes (all from the same manufacturer) One metal-oxide varistor
Tools	Insulation testerMultimeterTorque wrench

7.6.4 Test and Replace Varistor

- 1. Inspect the varistor, (if fitted).
- 2. Record varistor as faulty if there are signs of overheating (discoloration, blisters, melting) or disintegration.
- 3. Disconnect one varistor lead. Store fastener and washers.
- Measure the resistance across the varistor. Good varistors have a resistance greater than 100 MO.
- Record the varistor as faulty if the resistance is short circuit or open circuit in either direction. (Some multimeters will read O.L. at high resistance levels. Please be aware of the limits of your tools.)
- 6. If the varistor is faulty, replace it and replace all diodes.
- 7. Reconnect and check that all leads are secure, washers fitted and fasteners tight.

7.6.5 Test and Replace Diodes

NOTICE	
NOTICE .	
Do not tighten a diode above the stated torque. The diode will be damaged.	
3	

- 1. Disconnect the lead of one diode where it joins the windings at the insulated terminal post. Store fastener and washers.
- 2. Measure the voltage drop across the diode in the forward direction, using the diode test function of a multimeter.
- 3. Measure the resistance across the diode in the reverse direction, using the 1000 VDC test voltage of an insulation tester.
- 4. Diode is faulty if the voltage drop in the forward direction is outside the range 0.3 to 0.9 VDC, or the resistance is below 20 M Ω in the reverse direction.
- 5. Repeat the tests for the five remaining diodes.

07-2019 7. Service and Maintenance

- 6. If any diode is faulty, replace the full set of six diodes (same type, same manufacturer):
 - a. Remove diode(s).
 - Apply a small amount of heat sink compound only to the base of the replacement diode(s), not the threads.
 - c. Check polarity of diode(s).
 - d. Screw each replacement diode into a threaded hole in the rectifier plate.
 - e. Apply 2.6 to 3.1 Nm (23 to 27.4 in-lb) torque to give good mechanical, electrical and thermal contact.
 - f. Replace the varistor.
- 7. Reconnect and check that all leads are secure, washers fitted and fasteners tight.

7.7 Temperature Sensors

7.7.1 Introduction

The alternators are designed to meet standards supporting EU Safety Directives, and recommended operating temperatures. Temperature sensors (where fitted) detect abnormal overheating of the main stator windings and bearing(s). Sensors are of two types: Resistance Temperature Detector (RTD) sensors, with three wires, and Positive Temperature Coefficient (PTC) thermistors, with two wires, which are connected to a terminal block in the auxiliary or main terminal box. The resistance of Platinum (PT100) RTD sensors increases linearly with temperature.

TABLE 15. RESISTANCE (Ω) OF PT100 SENSOR BETWEEN 40 TO 180 °C

Temperature (°C)		+1 °C	+2 °C	+3 °C	+4 °C	+5 °C	+6 °C	+7 °C	+8 °C	+9 °C
40.00	115.54	115.93	116.31	116.70	117.08	117.47	117.86	118.24	118.63	119.01
50.00	119.40	119.78	120.17	120.55	120.94	121.32	121.71	122.09	122.47	122.86
60.00	123.24	123.63	124.01	124.39	124.78	125.16	125.54	125.93	126.31	126.69
70.00	127.08	127.46	127.84	128.22	128.61	128.99	129.37	129.75	130.13	130.52
80.00	130.90	131.28	131.66	132.04	132.42	132.80	133.18	133.57	133.95	134.33
90.00	134.71	135.09	135.47	135.85	136.23	136.61	136.99	137.37	137.75	138.13
100.00	138.51	138.88	139.26	139.64	140.02	140.40	140.78	141.16	141.54	141.91
110.00	142.29	142.67	143.05	143.43	143.80	144.18	144.56	144.94	145.31	145.69
120.00	146.07	146.44	146.82	147.20	147.57	147.95	148.33	148.70	149.08	149.46
130.00	149.83	150.21	150.58	150.96	151.33	151.71	152.08	152.46	152.83	153.21
140.00	153.58	153.96	154.33	154.71	155.08	155.46	155.83	156.20	156.58	156.95
150.00	157.33	157.70	158.07	158.45	158.82	159.19	159.56	159.94	160.31	160.68
160.00	161.05	161.43	161.80	162.17	162.54	162.91	163.29	163.66	164.03	164.40
170.00	164.77	165.14	165.51	165.89	166.26	166.63	167.00	167.37	167.74	168.11
180.00	168.48									

PTC thermistors are characterised by a sudden increase in resistance at a reference "switching" temperature. Customer-supplied external equipment may be connected to monitor the sensors and generate signals to raise an alarm and to shutdown the generator set.

BS EN 60085 (≡ IEC 60085) Electrical insulation – Thermal Evaluation and Designation classifies insulation of windings by the maximum operating temperature for a reasonable service life. To avoid damage to windings, signals should be set, appropriate to the insulation class shown on the alternator rating plate.

TABLE 16. ALARM AND SHUTDOWN TEMPERATURE SETTINGS FOR WINDINGS

Windings Insulation	Max. Continuous Temperature (°C)	Alarm Temperature (°C)	Shutdown Temperature (°C)	
Class B	130	120	140	
Class F	155	145	165	
Class H	180	170	190	

To detect overheating of bearings, control signals should be set according to the following table.

TABLE 17. ALARM AND SHUTDOWN TEMPERATURE SETTINGS FOR BEARINGS

Bearings	Alarm Temperature (°C)	Shutdown Temperature (°C)	
Drive End Bearing	45 + maximum ambient	50 + maximum ambient	
Non-drive End Bearing	40 + maximum ambient	45 + maximum ambient	

7.7.2 Safety

▲ DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

WARNING

Hot Surfaces

Skin contact with hot surfaces can cause serious injury by burns.

To prevent injury, wear appropriate personal protection equipment (PPE).

7.7.3 Test RTD Temperature Sensors

- 1. Remove the auxiliary terminal box lid.
- 2. Identify the sensor leads at the terminal block and where each sensor is fitted
- 3. Measure the resistance between the white and each red wire of one sensor
- 4. Calculate the sensor temperature from the measured resistance
- 5. Compare calculated temperature with temperature indicated by external monitoring equipment (if available)
- 6. Compare alarm and shutdown signal settings (if available) with recommended settings
- 7. Repeat steps 3 to 7 for each sensor
- 8. Refit the auxiliary terminal box lid.
- Contact Cummins Customer Service Help Desk to replace faulty sensors. Main stator RTD are not replaceable. Bearing RTD are replaceable.

7.7.4 Test PTC Temperature Sensors

- 1. Remove the auxiliary terminal box lid.
- 2. Identify the sensor leads at the terminal block and where each sensor is fitted.
- 3. Measure the resistance between the two wires.
- 4. Sensor is faulty if resistance shows open circuit (infinity Ω) or short circuit (zero Ω).
- 5. Repeat steps 3 to 5 for each sensor.
- 6. Stop the alternator and inspect the change in resistance as the stator winding cools.
- 7. Sensor is faulty if resistance does not change or change is not smooth.
- 8. Repeat steps 6 and 7 for each sensor.
- 9. Refit the auxiliary terminal box lid.
- 10. Contact Cummins Customer Service Help Desk to replace faulty sensors.

7.8 Windings

7.8.1 High Voltage Test

NOTICE

Windings have been tested at high voltage during manufacture. Repeated high voltage tests may degrade the insulation and reduce operating life. If a further test is required at installation for customer acceptance, it must be done at a reduced voltage, $V = 0.8 \times (2 \times 10^{-5})$ Rated Voltage + 1000). Once in service, any further tests for maintenance purposes must be done after passing visual checks and insulation resistance tests, and at a reduced voltage, $V = (1.5 \times 10^{-5})$ Rated Voltage).

7.8.2 Introduction

NOTICE

Disconnect all control wiring and customer load leads from alternator winding connections before conducting these tests.

NOTICE

The Automatic Voltage Regulator (AVR) contains electronic components which would be damaged by high voltage applied during insulation resistance tests. The AVR must be disconnected before doing any insulation resistance test. Temperature sensors must be grounded to earth before doing any insulation resistance test.

Damp or dirty windings have a lower electrical resistance and could be damaged by insulation resistance tests at high voltage. If in doubt, test the resistance at low voltage (500 V) first.

Alternator performance depends on good electrical insulation of the windings. Electrical, mechanical and thermal stresses, and chemical and environmental contamination, cause the insulation to degrade. Various diagnostic tests indicate the condition of insulation by charging or discharging a test voltage on isolated windings, measuring current flow, and calculating the electrical resistance by Ohm's law.

When a DC test voltage is first applied, three currents can flow:

• Capacitive Current: To charge the winding to the test voltage (decays to zero in seconds),

- **Polarizing Current:** To align the insulation molecules to the applied electric field (decays to near-zero in ten minutes), and
- Leakage Current: Discharge to earth where the insulation resistance is lowered by moisture and contamination (increases to a constant in seconds).

For an insulation resistance test, a single measurement is made one minute after a DC test voltage is applied, when capacitive current has ended. For the polarization index test, a second measurement is made after ten minutes. An acceptable result is where the second insulation resistance measurement is at least double the first, because the polarization current has decayed. In poor insulation, where leakage current dominates, the two values are similar. A dedicated Insulation Tester takes accurate, reliable measurements and may automate some tests.

7.8.3 Safety

DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before removing covers over electrical conductors, isolate the generator set from all energy sources, remove stored energy and use lock out/tag out safety procedures.

⚠ WARNING

Live Electrical Conductors

Live electrical conductors at the winding terminals after an insulation resistance test can cause serious injury or death by electric shock or burns.

To prevent injury, discharge the windings by shorting to earth through an earthing rod for at least 5 minutes.

7.8.4 Requirements

TABLE 18. WINDING TEST REQUIREMENTS

Requirement	Description		
Personal Protective Equipment (PPE)	Wear mandatory site PPE.		
Consumables	None		
Parts	None		
Tools	 Insulation test meter Multimeter Milliohm meter or microohm meter Clamp ammeter Infrared thermometer Earth rod 		

7.8.5 Test the Electrical Resistance of Windings

- 1. Stop the alternator.
- 2. Verify the electrical resistance of the exciter field (stator) winding:
 - a. Disconnect the exciter field leads F1 and F2 from the AVR.
 - b. Measure and record the electrical resistance between F1 and F2 leads with a multimeter.

- Reconnect the exciter field leads F1 and F2.
- d. Make sure the fasteners are secure.
- 3. Verify the electrical resistance of the exciter armature (rotor) winding:
 - a. Mark the leads attached to diodes on one of the two rectifier plates.
 - b. Disconnect all exciter rotor leads from all diodes at the rectifier.
 - c. Measure and record the electrical resistance between pairs of marked leads (between phase windings). A specialist micro ohmmeter must be used.
 - d. Reconnect all exciter rotor leads to the diodes.
 - e. Make sure the fasteners are secure.
- 4. Verify the electrical resistance of the main field (rotor) winding:
 - a. Disconnect the two main rotor DC leads from the rectifier plates.
 - Measure and record the electrical resistance between the main rotor leads. A specialist micro ohmmeter must be used.
 - c. Reconnect the two main rotor DC leads to the rectifier plates.
 - d. Make sure the fasteners are secure.
- 5. Verify the electrical resistance of the main armature (stator) winding:
 - a. Disconnect the leads of the main stator from the output terminals.
 - b. Measure and record the electrical resistance between U1 and U2 leads and between U5 and U6 (if present). A specialist micro ohmmeter must be used.
 - c. Measure and record the electrical resistance between V1 and V2 leads and between V5 and V6 (if present). A specialist micro ohmmeter must be used.
 - d. Measure and record the electrical resistance between W1 and W2 leads and between W5 and W6 (if present). A specialist micro ohmmeter must be used.
 - e. Reconnect the leads to the output terminals, as before.
 - f. Make sure the fasteners are secure.
- 6. Verify the electrical resistance of the PMG armature (stator) winding, if fitted:
 - a. Disconnect the three PMG output leads P2, P3 and P4 from the AVR.
 - Measure and record the electrical resistance between pairs of the PMG output leads, with a multimeter.
 - c. Reconnect the three PMG output leads P2, P3 and P4 to the AVR.
 - d. Make sure the fasteners are secure.
- 7. Refer to the Technical Data (Chapter 9 on page 61) to verify the measured resistances of all windings agree with the reference values.

7.8.6 Test the Insulation Resistance of Windings

NOTICE

The alternator must not be put into service until the minimum insulation resistance is achieved.

TABLE 19. TEST VOLTAGE AND MINIMUM ACCEPTABLE INSULATION RESISTANCE FOR NEW AND IN-SERVICE ALTERNATORS

Part	Test Voltage	Minimum Insulation Resistance at 1 Minute ($M\Omega$)		
	(V)	New	In-Service	
Main Stator	500	10	5	
PMG Stator	500	5	3	
Exciter Stator	500	10	5	
Exciter Rotor, Rectifier & Main Rotor Combined	500	10	5	

- 1. Inspect the windings for mechanical damage or discoloration from overheating. Clean the insulation if there is hygroscopic dust and dirt contamination.
- 2. For main stators:
 - a. Disconnect the neutral to earth conductor (if fitted).
 - b. Connect together the three leads of all phase windings (if possible).
 - c. Apply the test voltage from the table between any phase lead and earth.
 - d. Measure the insulation resistance after 1 minute (IR_{1min}).
 - e. Discharge the test voltage with an earth rod for five minutes.
 - f. If the measured insulation resistance is less than the minimum acceptable value, dry the insulation, then repeat the method.
 - g. Reconnect neutral to earth conductor (if fitted).
- 3. For PMG and exciter stators, and combined exciter and main rotors:
 - a. Connect together both ends of the winding (if possible).
 - b. Apply the test voltage from the table between the winding and earth.
 - c. Measure the insulation resistance after 1 minute (IR_{1min}).
 - d. Discharge the test voltage with an earth rod for five minutes.
 - e. If the measured insulation resistance is less than the minimum acceptable value, dry the insulation, then repeat the method.
 - f. Repeat the method for each winding.
 - g. Remove the connections made for testing.

7.8.7 Dry the Insulation

Use the methods below to dry the insulation of the main stator windings. To prevent damage as water vapor is expelled from the insulation, make sure the winding temperature does not increase faster than $5\,^{\circ}\text{C}$ per hour or exceed $90\,^{\circ}\text{C}$.

Plot the insulation resistance graph to show when drying is complete.

7.8.7.1 Dry with Ambient Air

In many cases, the alternator can be dried sufficiently using its own cooling system. Disconnect the cables from the X+ (F1) and XX- (F2) terminals of the AVR so there is no excitation voltage supply to the exciter stator. Run the generator set in this de-excited state. Air must flow freely through the alternator to remove the moisture. Operate the anti-condensation heater (if fitted) to assist the drying effect of the air flow.

07-2019 7. Service and Maintenance

After drying is complete, re-connect the cables between the exciter stator and AVR. If the generator set is not put into service immediately, turn on the anti-condensation heater (if fitted) and retest the insulation resistance before use.

7.8.7.2 Dry with Hot Air

Direct the hot air from one or two 1 to 3 kW electrical fan heaters into the alternator air inlet. Make sure each heat source at least 300 mm away from the windings to avoid scorching or over-heating damage to the insulation. Air must flow freely through the alternator to remove the moisture.

After drying, remove the fan heaters and re-commission as appropriate.

If the generator set is not put into service immediately, turn on the anti-condensation heaters (where fitted) and retest the insulation resistance before use.

7.8.7.3 Plot IR Graph

Whichever method is used to dry out the alternator, measure the insulation resistance and temperature (if sensors fitted) of the main stator windings every 15 to 30 minutes. Plot a graph of insulation resistance, IR (y axis) against time, t (x axis).

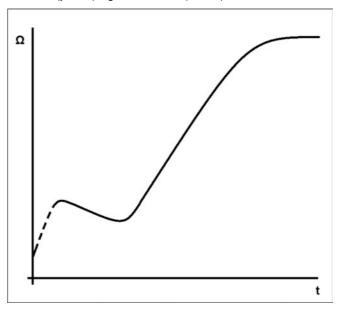


FIGURE 19. INSULATION RESISTANCE GRAPH

A typical curve shows an initial increase in resistance, a fall and then a gradual rise to a steady state; if the windings are only slightly damp the dotted portion of the curve may not appear. Continue drying for another hour after steady state is reached.

NOTICE

The alternator must not be put into service until the minimum insulation resistance is achieved.

7. Service and Maintenance 07-2019

This page is intentionally blank.

8 Parts Identification

8.1 HC4 Single Bearing Alternator

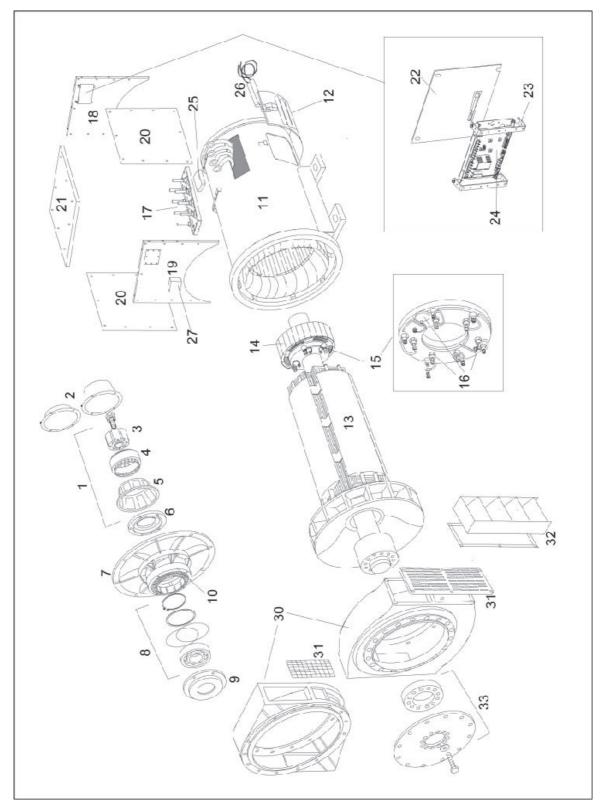


FIGURE 20. HC4 SINGLE BEARING ALTERNATOR

53

8. Parts Identification 07-2019

8.2 HC4 Two Bearing Alternator

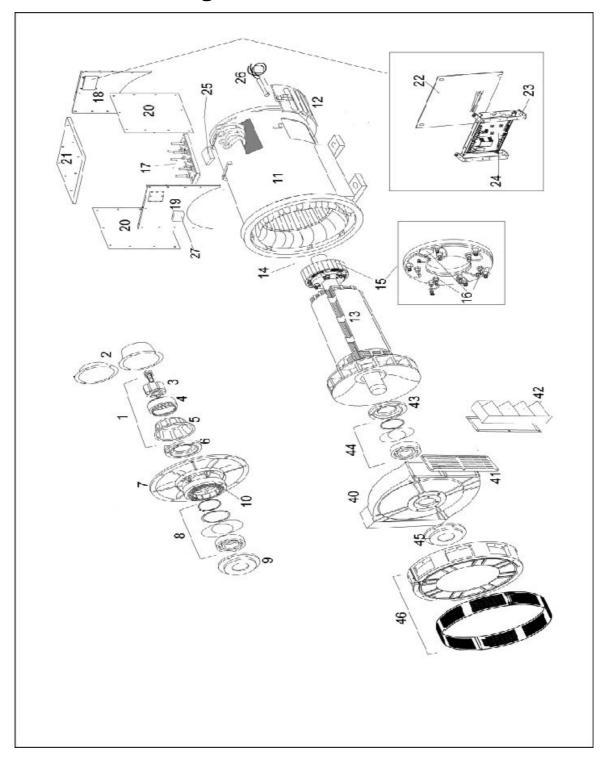


FIGURE 21. HC4 TWO BEARING ALTERNATOR

07-2019 8. Parts Identification

8.3 HC5 Single Bearing Alternator

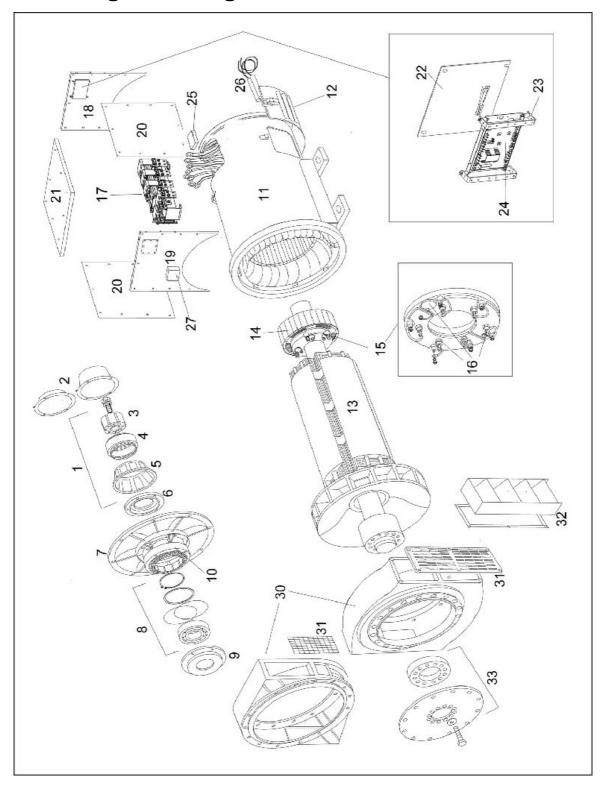


FIGURE 22. HC5 SINGLE BEARING ALTERNATOR

8. Parts Identification 07-2019

8.4 HC5 Two Bearing Alternator

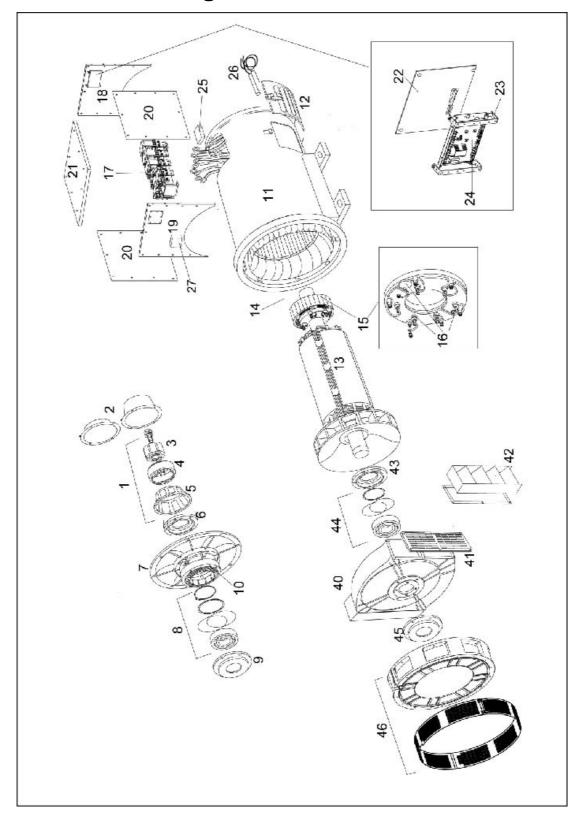


FIGURE 23. HC5 TWO BEARING ALTERNATOR

07-2019 8. Parts Identification

8.5 HC6 Single Bearing Alternator

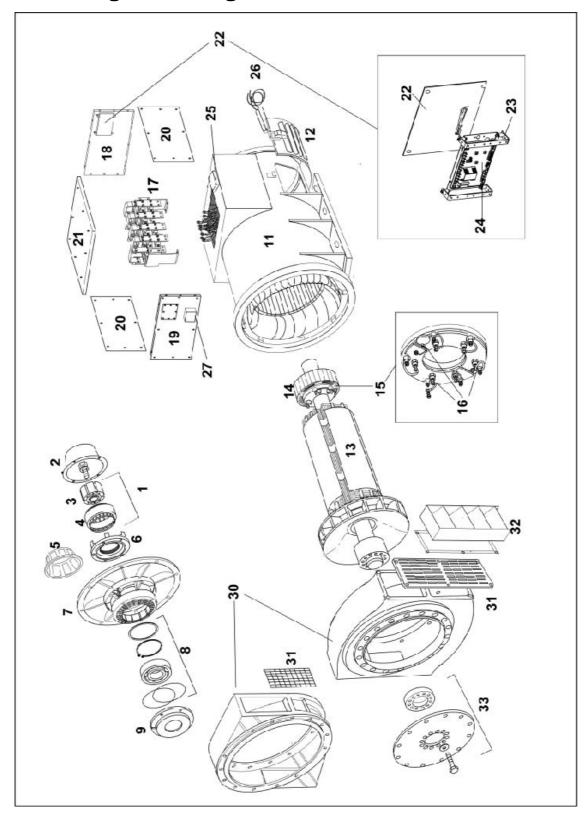


FIGURE 24. HC6 SINGLE BEARING ALTERNATOR

8. Parts Identification 07-2019

8.6 HC6 Two Bearing Alternator

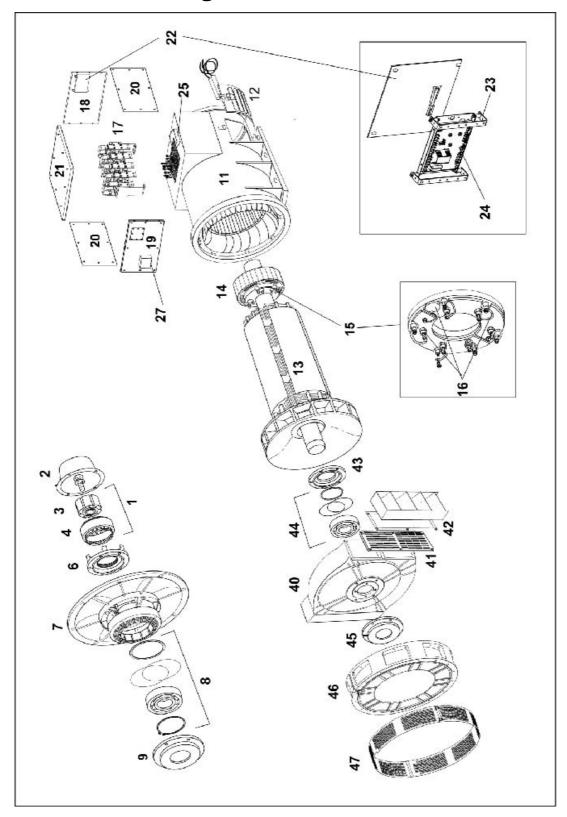


FIGURE 25. HC6 TWO BEARING ALTERNATOR

07-2019 8. Parts Identification

8.7 HC Parts and Fasteners

TABLE 20. HC PARTS AND FASTENERS

Reference	Component	Fastener	Quantity	Torque (Nm)
1	Complete PMG parts	-	-	-
2	PMG Cover/non-PMG Cover	M6 x 16	4	10
3	PMG Rotor	M10 x 100	1	50
4	PMG Stator	M6 x 45	4	10
5	PMG Crown (if fitted)	-	-	-
6	NDE Bearing Cap	M10 x 30	4	50
7	NDE Bracket	M12 x 40	8	50
8	Complete NDE Bearing parts	-	-	-
9	NDE Bearing Cartridge	M10 x 50	4	50
10	Exciter Stator	M8	6	26
11	Main Frame	-	-	-
12	Air Inlet Cover	Split pin	-	-
13	Main Rotor	-	-	-
14	Exciter Rotor	-	-	-
15	Rectifier Assembly	M6 x 65	4	10
16	Diode/Varistor	-	-	2.6 - 3.1
17	Main Terminals	M12 x 40	8	50
18	Terminal Box End Panel NDE	M10 x 35	4	50
19	Terminal Box End Panel DE	M10 x 25	2	50
20	Terminal Box Side Panel	M6 x 12	20	6
21	Terminal Box Lid	M6 x 12	8	6
22	AVR Cover Plate	M5 x 12	4	5
23	AVR Mounting Bracket	M5 x 12	6	5
24	AVR	M5 x 30	4	5
25	Auxilliary Terminal Board	M6 x 25	8	10
26	Anti-condensation Heater	M6	2	n/c
27	Heater terminal Box	M4 x 12	2	5
30	DE Adapter (1 bearing)	M12 x 40	8	95
31	DE Air Outlet Screen (1 bearing)	M5 x 12	12	5
32	DE Louvres (1 bearing)	M5 x 16	12	5
33	DE Coupling Hub and Coupling Discs (1 bearing)	M20 x 55	8	479
40	DE Bracket (2 bearing)	M12 x 40	8	95

8. Parts Identification 07-2019

Reference	Component	Fastener	Quantity	Torque (Nm)
41	DE Air Outlet Screen (2 bearing)	M5 x 12	12	5
42	DE Louvres (2 bearing)	M5 x 16	12	5
43	DE Bearing Cartridge (2 bearing)	M10 x 50	4	50
44	Complete DE Bearing parts (2 bearing)	-	ı	ı
45	DE Bearing Cap (2 bearing)	M10 x 30	4	50
46	DE Adapter (2 bearing)	M12 x 40	8	95
47	DE Adapter Screen (2 bearing)	M5 x 12	12	5

9 Technical Data

NOTICE

Compare measurements with the technical data sheet and the test certificate supplied with the alternator

9.1 HC Winding Resistances

TABLE 21. HC WINDING RESISTANCES

	Resistance of Windings at 22 °C (Measured Values Should Be within 10%)								
	N	lain Stato	r (lead - le	ad) (Ohms	s)		ms)		s)
Alternator	311 (U1-U2) (V1-V2) (W1-W2) (U5-U6) (V5-V6) (W5-W6)	17 (U1-U2) (V1-V2) (W1-W2) (U5-U6) (V5-V6) (W5-W6)	14 (U1-U2) (V1-V2) (W1-W2) (U5-U6) (V5-V6) (W5-W6)	25 (U1-U2) (V1-V2) (W1-W2) (U5-U6) (V5-V6) (W5-W6)	27 (U1-U2) (V1-V2) (W1-W2) (U5-U6) (V5-V6) (W5-W6)	Exciter Stator (Ohms)	Exciter Rotor, L-L (Ohms)	Main Rotor (Ohms)	PMG Stator, L-L (Ohms)
HC434C	0.0083	0.0115	0.0055	0.0020	0.0154	18	0.136	0.92	3.8
HC434D	0.0062	0.0100	0.0045	0.0160	0.0130	18	0.136	1.05	3.8
HC434E	0.0045	0.0075	n/a	0.0140	0.0100	18	0.136	1.19	3.8
HC434F	0.0037	0.0055	n/a	0.0105	0.0075	18	0.136	1.37	3.8
HC444C	0.0083	0.0115	0.0055	0.0020	0.0154	18	0.136	0.92	n/a
HC444D	0.0062	0.0100	0.0045	0.0160	0.0130	18	0.136	1.05	n/a
HC444E	0.0045	0.0075	n/a	0.0140	0.0100	18	0.136	1.19	n/a
HC444F	0.0037	0.0055	n/a	0.0105	0.0075	18	0.136	1.37	n/a
HC534C	0.0033	0.0053	0.0026	0.0100	0.0065	17	0.184	1.55	3.8
HC534D	0.0025	0.0040	0.0021	0.0075	0.0005	17	0.184	1.77	3.8
HC534E	0.0022	0.0034	0.0013	n/a	0.0044	17	0.184	1.96	3.8
HC534F	0.0019	0.0025	0.0013	0.0050	0.0041	17	0.184	2.46	3.8
HC544C	0.0033	0.0053	0.0026	0.0100	0.0065	17	0.184	1.55	n/a
HC544D	0.0025	0.0040	0.0021	0.0075	0.0005	17	0.184	1.77	n/a
HC544E	0.0022	0.0034	0.0013	n/a	0.0044	17	0.184	1.96	n/a
HC544F	0.0019	0.0025	0.0013	0.0050	0.0041	17	0.184	2.46	n/a
HC634G	0.0017	n/a	n/a	n/a	n/a	17	0.158	1.75	3.8
HC634H	0.0013	n/a	n/a	n/a	n/a	17	0.158	1.88	3.8
HC634J	0.0011	n/a	n/a	n/a	n/a	17	0.158	2.09	3.8
HC634K	0.0009	n/a	n/a	n/a	n/a	17	0.158	2.36	3.8

9. Technical Data 07-2019

Resistance of Windings at 22 °C (Measured Values Should Be within 10%)									
	IV	lain Stato	r (lead - le	ad) (Ohms	s)	ms)			(\$
Alternator	312 (U1-U2) (V1-V2) (W1-W2)	07 (U1-U2) (V1-V2) (W1-W2)	13 (U1-U2) (V1-V2) (W1-W2)	26 (U1-U2) (V1-V2) (W1-W2)	28 (U1-U2) (V1-V2) (W1-W2)	Exciter Stator (Ohms)	Exciter Rotor, L-L (Ohms)	Main Rotor (Ohms)	PMG Stator, L-L (Ohms)
HC434F	n/a	n/a	0.0060	n/a	n/a	18	0.136	1.37	3.8
HC444F	n/a	n/a	0.0060	n/a	n/a	18	0.136	1.37	n/a
HC534E	n/a	n/a	n/a	0.0130	n/a	17	0.184	1.96	3.8
HC544E	n/a	n/a	n/a	0.0130	n/a	17	0.184	1.96	n/a
HC634G	0.0034	0.0055	0.0002	0.0090	0.0075	17	0.158	1.75	3.8
HC634H	0.0025	0.0036	0.0019	0.0080	n/a	17	0.158	1.88	3.8
HC634J	0.0022	0.0030	0.0015	0.0060	n/a	17	0.158	2.09	3.8
HC634K	0.0017	0.0026	0.0010	0.0045	0.0030	17	0.158	2.36	3.8
HC636G	0.0090	0.0102	n/a	n/a	n/a	17	0.200	1.12	8.22
HC636H	0.0063	0.0102	n/a	n/a	n/a	17	0.200	1.33	8.22
HC636J	0.0049	0.0070	n/a	n/a	n/a	17	0.200	1.50	8.22
HC636K	0.0039	0.0060	n/a	n/a	n/a	17	0.200	1.75	8.22

10 Service Parts

We recommend the use of genuine STAMFORD service parts supplied from an authorized service outlet. For details of your nearest service outlet visit www.stamford-avk.com.

10.1 Parts Orders

When ordering parts the machine serial number or machine identity number and type should be quoted, together with the part description. The machine serial number can be found on the name plate or frame.

10.2 Customer Service

Cummins Generator Technologies' service engineers are experienced professionals, trained extensively to deliver the best support possible. Our global service offers:

- · On-site a.c. alternator commissioning
- · On-site bearing maintenance & bearing condition monitoring
- · On-site insulation integrity checks
- On-site AVR & accessories set-up

For details of your nearest service outlet visit www.stamford-avk.com.

10.3 Recommended Service Parts

In critical applications a set of these service spares should be held with the alternator.

TABLE 22. HC4 SERVICE PARTS

Part	Number
Rectifier Service Kit (3 forward & 3 reverse diodes with varistors)	RSK-5001
MX321 AVR (if fitted)	E000-23212/1P
MX341 AVR (if fitted)	E000-23412/1P
AS440 AVR (if fitted)	E000-24403/1P
DM110 AVR (if fitted)	E000-23800
Sealed Bearing DE Kit	45-0319
Sealed Bearing NDE Kit	45-0320

10. Service Parts 07-2019

TABLE 23. HC5 SERVICE PARTS

Part	Number	
Rectifier Service Kit	RSK-5001	
(3 forward & 3 reverse diodes with varistors)		
MX321 AVR (if fitted)	E000-23212/1P	
MX341 AVR (if fitted)	E000-23412/1P	
AS440 AVR (if fitted)	E000-24403/1P	
DM110 AVR (if fitted)	E000-23800	
HC5 1	Bearing	
Sealed Bearing NDE Kit	45-0320	
Re-greasable Bearing NDE Kit	45-1099	
HC5 2	Bearing	
Sealed Bearing DE Kit	45-0321	
Sealed Bearing NDE Kit	45-0320	
Re-greasable Bearing DE Kit	45-1100	
Re-greasable Bearing NDE Kit	45-1099	

TABLE 24. HC6 SERVICE PARTS

Part	Number	
Rectifier Service Kit (3 forward & 3 reverse diodes with varistors)	RSK-6001	
MX321 AVR (if fitted)	E000-23212/1P	
MX341 AVR (if fitted)	E000-23412/1P	
AS440 AVR (if fitted)	E000-24403/1P	
DM110 AVR (if fitted)	E000-23800	
HC6 1	Bearing	
Sealed Bearing NDE Kit	45-0340	
Re-greasable Bearing NDE Kit	45-1099	
HC6 2	Bearing	
Sealed Bearing DE Kit	45-0339	
Sealed Bearing NDE Kit	45-0340	
Re-greasable Bearing DE Kit	45-0342	
Re-greasable Bearing NDE Kit	45-0343	

10.4 Klüber Asonic GHY72 Grease

All bearings trials and calculated life expectancy are based on the use of Klüber Asonic GHY72.

11 End of Life Disposal

Companies specializing in reclaiming material from scrap products can reclaim most of the iron, steel and copper from the alternator. For more details, please contact Customer Service.

11.1 Recyclable material

Mechanically separate the base materials, iron, copper and steel, removing paint, polyester resin, and insulation tape and/or plastics residues from all components. Dispose of this 'waste material'

The iron, steel and copper can now be recycled.

11.2 Items requiring specialist treatment

Remove electrical cable, electronic accessories and plastic materials from the alternator. These components need special treatment to remove the waste from the reclaimable material.

Forward the reclaimed materials for recycling.

11.3 Waste material

Dispose of waste material from both of the above processes via a specialist disposal company.

11. End of Life Disposal

This page is intentionally blank.

