


## A7 Low Voltage Alternators OWNER MANUAL

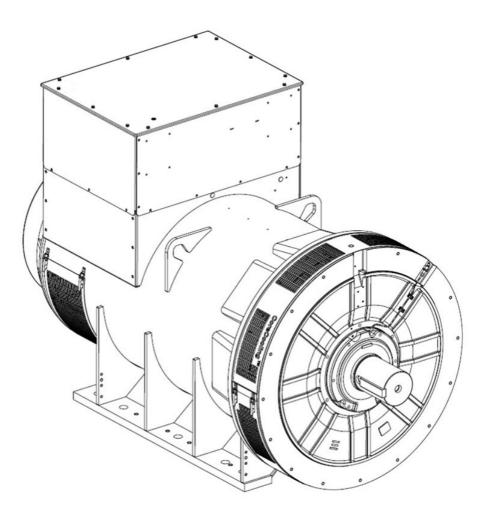

# **Table of Contents**

1.	FOREWORD	1
2.	SAFETY PRECAUTIONS	3
3.	SAFETY DIRECTIVES AND STANDARDS	13
4.	INTRODUCTION	23
5.	LIFTING, STORAGE AND TRANSPORTATION	27
6.	APPLICATION OF THE ALTERNATOR	31
7.	INSTALLATION INTO THE GENERATOR SET	39
8.	SERVICE AND MAINTENANCE	47
9.	PARTS IDENTIFICATION	69
10.	TECHNICAL DATA	73
11.	SERVICE PARTS	75
12.	END OF LIFE DISPOSAL	77

This page is intentionally blank.

## 1.1 General

This document is an important guide to the intended use and operation of the product(s) detailed on the front cover. Read the information and procedures in this document. The information and procedures must be obeyed at all times, failure to obey the information and procedures can be considered misuse and can lead to injury, loss or damage to personnel or equipment.

Company and European Authorized Representative Addresses							
Cummins Generator Technologies	Cummins Generator Technologies						
Fountain Court	Bvd. Decebal 116A						
Lynch Wood	Craiova,						
Peterborough	Dolj						
PE2 6FZ	200746						
United Kingdom	Romania						

### TABLE 1. COMPANY ADDRESSES

## 1.2 Legal

The alternator is the intellectual property of Cummins Generator Technologies LTD (also referred to as 'CGT' or 'the manufacturer' or by the brand names 'STAMFORD<sup>®'</sup> or 'AvK<sup>®'</sup> within this manual).

STAMFORD<sup>®</sup>, AvK<sup>®</sup> and STAMFORD VITA<sup>™</sup>, MX321<sup>™</sup> and MX322<sup>™</sup> are registered trademarks of Cummins Generator Technologies LTD. All rights to the alternator, the principle of the machine, the related drawings etc. lie with Cummins Generator Technologies LTD and are subject to copyright law. Copying is only permitted with prior written approval. Copyright Cummins Generator Technologies. All Rights reserved. Cummins and the Cummins logo are registered trademarks of Cummins Inc.

## 1.3 The Manual

This manual contains guidance and instructions for the installation and operation of the equipment specified on the manual front cover. This manual does not include instructions for servicing and maintaining the alternator. Contact Cummins Generator Technologies (CGT) Customer Service for servicing information.

Before operating, the equipment, read this manual. Make sure that all personnel who work on the equipment have access to the manual and all related documentation supplied with it. Misuse, failure to obey the instructions or use of non-approved parts, may invalidate the product warranty and lead to loss injury or damage.

This manual is an essential part of the equipment. Make sure that the manual is available to all applicable personnel throughout the life of the equipment.

The manual is written for skilled electrical and mechanical technicians and engineers, who have prior knowledge and experience of equipment of this type. If in doubt, contact your local CGT subsidiary.

#### NOTICE

Information in this manual was correct when published. It may be superseded due to our policy of continuous improvement. Visit <u>www.stamford-avk.com</u> for latest documentation.

## 1.4 Manual Languages

The manuals for this product are available in the languages shown below, which can be found on the STAMFORD | AvK<sup>™</sup> website: <u>www.stamford-avk.com</u>.

Language, Manual Type and Document Part Number							
Arabic (ar-sa)	Owner	A077V456					
German (de-de)	Owner	A077V457					
English (en-us)	Owner	A077V455					
Spanish (es-es)	Owner	A077V458					
French (fr-fr)	Owner	A077V459					
Italian (it-it)	Owner	A077V460					
Japanese (ja-jp)	Owner	A077V461					
Polish (pl-pl)	Owner	A077V462					
Portuguese (pt-pt)	Owner	A077V464					
Russian (ru-ru)	Owner	A077V465					
Swedish (sv-se)	Owner	A077V466					
Chinese (zh-cn)	Owner	A077V473					

#### TABLE 2. A7 LOW VOLTAGE MANUAL LANGUAGES

# 2 Safety Precautions

## 2.1 Safety Information and Notices used in this Manual

Danger, Warning and Caution panels used in this manual describe the sources of hazards, their consequences and how to avoid injury. Notice panels emphasize important or critical instructions.

#### 

Danger indicates a hazardous situation which, if not avoided, WILL result in death or serious injury.

#### <u> WARNING</u>

Warning indicates a hazardous situation which, if not avoided, COULD result in death or serious injury.

#### 

Caution indicates a hazardous situation which, if not avoided, COULD result in minor or moderate injury.

#### NOTICE

Notice refers to a method or practice which can result in product damage, or to draw attention to additional information or explanations.

## 2.2 General Guidance

• These safety precautions are for general guidance. The information is intended to supplement your own safety procedures and applicable rules, laws and regulations.

## 2.3 Training and Skill Requirements for Personnel

Operation, installation, service and maintenance tasks and/or procedures can only be done by personnel, who:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s) and know the related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

### 2.4 Risk Assessment

- The installer / operator / service / maintenance company must do a risk assessment to establish all related hazards and risks.
- During operation, access to the alternator must be restricted to personnel who are trained and who know all relevant hazards and risks. Refer to: **Section 2.3 on page 3**.

## 2.5 **Personal Protective Equipment (PPE)**

Personnel who install, operate, service or maintain the alternator must:

- Have access to the minimum recommended protective equipment (refer to the figure below). The protective equipment must be approved for the task or procedure.
- Know how to correctly use protective equipment, refer to: Section 2.3 on page 3
- Use protective equipment as directed by the risk assessment, refer to: Section 2.4 on page 3.



FIGURE 1. MINIMUM RECOMMENDED PERSONAL PROTECTIVE EQUIPMENT (PPE)

## 2.6 **Tools and Equipment**

All personnel must know how to use tools and equipment safely, refer to: Section 2.3 on page 3.

All tools and equipment used, must be:

- Suitable for the task and procedure.
- Electrically insulated (not below the alternator output voltage), refer to: Section 2.4 on page 3.
- In a serviceable condition for safe use.
- Included within the risk assessment, refer to: Section 2.4 on page 3.

## 2.7 Safety Information Signs

Safety information signs are provided on the equipment to indicate hazards and emphasize instructions. Before operating the equipment:

• Personnel must know and understand alternator safety information signs and the associated hazards / risks.





Safety information signs vary depending on alternator specification.

## 2.8 Alternator Danger Notices

#### ▲ DANGER

#### Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### ▲ DANGER

#### **Testing Live Electrical Conductors**

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before testing on or near live electrical conductors:

- Take applicable precautions to prevent contact with live conductors, refer to: Safety Precautions Chapter.
- Test on or near live conductors, only if absolutely necessary.
- Only trained personnel may test on or near live electrical conductors.
- Do not test on or near live electrical conductors alone: Another competent person must be present, trained to isolate energy sources and take action in an emergency.

#### ▲ DANGER

**Rotating Mechanical Parts** 

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping. To prevent injury:

- Before operating the alternator: The rotating coupling between the alternator and prime mover must be covered by a guard or cover.
- Before attempting service or maintenance tasks or removing covers from rotating parts: Shut down and isolate the generator set from all energy sources, isolate stored energy and use lock out/tag out safety procedures.

#### ▲ DANGER

Testing on Rotating Mechanical Parts

Rotating mechanical parts can cause serious injury or death by crushing, severing and trapping. To prevent injury and before removing safety covers for testing:

- Take applicable precautions to prevent contact with uncovered rotating mechanical parts, refer to Safety Precautions Chapter.
- Test on or near uncovered rotating mechanical parts, only if absolutely necessary.
- Do not test on or near uncovered rotating mechanical parts alone: Additional personnel must be present, who know how to isolate energy sources and take action in an emergency.

#### 

#### Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping. To prevent injury or death and before lifting:

- Check the capacity, condition and attachment of lifting equipment.
- Check the capacity, condition and attachment of accessories for lifting.
- Check the capacity, condition and attachment of lifting point(s) on the load.
- Check the mass, integrity and stability of the load.
- If available: Install drive end and non-drive end transit fittings to prevent movement and damage to bearings.
- Keep the alternator horizontal when lifting.
- Do not use alternator lifting points for lifting a complete generator set.
- Do not use cooler lifting points for lifting the alternator or a complete generator set.
- Do not remove the lifting label attached to one of the lifting points.

## 2.9 Alternator Warning Notices

#### 

#### Enclosures

Alternators may be installed within an enclosure for environmental protection, noise reduction or transportation reasons. Before entering the enclosure to prevent injury or death, personnel must:

- Know the related hazards / risks.
- Have a safe access route in to and out of the enclosure, have sufficient ventilation and obey the alternator hazard zones.
- Wear the appropriate protective equipment.

Additionally when working with Medium or High Voltage alternators:

- Enter the enclosure when the alternator is operating, only if absolutely necessary.
- To minimize risks to personnel use remote diagnostic, monitoring and measuring systems.

### 🔥 WARNING

#### **Terminal Box**

Do not modify the terminal box panels or terminal box internal components. Modification(s) can lead to short-circuits or arc-flash events and cause injury or death by electric shock or burns. To prevent injury:

- Refer to: Arc-Flash warning in the Safety Precaution Chapter.
- Contact STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services (<u>www.stamford-avk.com</u>) for guidance before making modifications to the terminal box panels or internal components.

#### 

#### Arc-flash

An arc-flash event within the terminal box, on the alternator windings or at the cables exiting the terminal box can cause serious injury or death by: Noise, burns, impact from flying/molten debris and/or hot gases. To prevent injury or death from arc-flash:

- Do not approach the alternator during operation unless wearing appropriate personal protective equipment, refer to: Personal Protective Equipment Paragraph.
- Personnel working close an operating alternator must be trained in arc-flash hazard awareness, refer to Training Paragraph.

An arc-flash is a phenomenon where a flashover of electric current leaves its intended path and travels through the air from one conductor to another, or to ground. Arc-flash can be caused by many things, such as: material failure, corrosion, or incorrect installation.

It is the responsibility of the installer/operating company to do a risk assessment of arc-flash hazard as part of the complete installation, including connection to other energy sources.

Arc-flash hazards can include: Intense noise, hot and rapidly expanding gases, expanding pressure wave, flying debris (including molten copper) and exposure to intense UV light.

When the alternator is connected to other energy sources, the arc-flash can exceed an arc-flash produced by an individual alternator. These additional energy sources can be electrical loads that store energy (e.g. Transformers, capacitors etc.), alternators in parallel or coupled to a mains network.

While arc-flash in an alternator is rare, it is important that the installer/operating company takes applicable measures to ensure the safety of personnel. In accordance with local electrical safe working practices, personnel working around the running alternator must be trained in and aware of arc-flash hazards. Personal protective equipment must be worn when working within the vicinity of the alternator, refer to: Safety Precautions Chapter Section 2.5 on page 4.

#### Medium Voltage and High Voltage Alternators

Medium voltage and high voltage alternators can be fitted with additional warning and information stickers. Pressure relief vent(s) can be installed in the terminal box. The pressure relief vent(s) can vary from the one shown in the figure below).

If installed, make sure the pressure relief vent(s) are secure and serviceable. Do not remove, obstruct or apply a load to the pressure relief vent(s).



FIGURE 3. ARC-FLASH IMAGES

### 🕂 WARNING

#### **Condensed Water**

Operating an alternator with condensed water in the windings can cause serious injury by electric shock, burns or exposure to flying debris and particles. To prevent injury and before operating the alternator:

- Use anti-condensation heaters (if fitted) to prevent condensation accumulating.
- Check for condensed water.
- If condensed water is present, drain/remove the water, dry and inspect the alternator, refer to: Maintenance and Servicing Chapter.

#### 

#### **Coupling an Alternator**

Moving mechanical parts during coupling can cause serious injury by crushing, severing or trapping. When coupling the alternator to a prime-mover or when installing large components, to prevent injury:

• Personnel must keep limbs and body parts away from coupling surfaces during coupling and/or installing operations.

#### **▲ WARNING**

Hazardous Operating Environments (Explosive Atmospheres)

The use of the alternators in an explosive atmosphere can cause serious injury or death by burns and / or flying debris, particles and fumes. To prevent injury or death:

• Do not install or operate the alternator where the surrounding atmosphere is potentially explosive.

#### 

Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

### 🔥 WARNING

#### Noise

Noise from a running alternator can cause serious and permanent hearing damage. To prevent injury:

• Always wear appropriate personal protection equipment. Refer to Personal Protective Equipment paragraph.

### **∧** WARNING

Incorrect Electrical Installation and System Protection

Incorrect electrical installation and / or system protection can cause serious injury or death by electric shock and burns. To prevent injury or death and before starting work, personnel:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s).
- Know related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

#### 

#### Live Electrical Conductors

Live electrical conductors at the winding terminals can cause serious injury or death by electric shock or burns. After an insulation resistance test, to prevent injury or death:

- Discharge the windings immediately after the test has concluded by shorting to a suitable earth. The windings must discharge for the greater of:
  - 1. A length of time equal to the duration of the test.
    - or
  - 2. 5 minutes.

#### 

#### Grounding

Incorrectly grounded alternators can cause serious injury or death or serious equipment damage by electric shock or electrical malfunction. To avoid equipment damage, injury or death:

• The alternator must be permanently grounded, unless the application or applicable laws and regulations do not permit alternator grounding.

#### 🕂 WARNING

Reconnected Energy Source

Accidental reconnection of energy sources during service and maintenance work can cause serious injury or death by electric shock, burns, crushing, severing or trapping. To prevent injury and before starting any service and maintenance work:

- Isolate the alternator from energy sources.
- Prevent alternator use with lock out/tag out safety procedures.
- Do not defeat or bypass the lock out/tag out safety procedures.

#### 

#### Strong Magnetic Field

The strong magnetic field from a Permanent Magnet Generator (PMG) or Excitation Boost System (EBS), can cause serious injury or death by interference with implanted medical devices. To prevent injury or death:

• Do not work near a Permanent Magnet Generator (PMG) or Excitation Boost System (EBS) if you have an implanted medical device.

	A WARNING
Inco	rrect or Improper Use
	rrect or improper use of the alternator may result in equipment damage, serious injury or h. To prevent or equipment damage injury or death:
٠	Always select the correct specification alternator for the intended use and application.
•	Make sure the alternator and prime mover are compatible and suitable for the intended application.
•	Always install the alternator in accordance with the original manual(s) and technical drawing(s) supplied with the alternator.
•	Obey locally applicable rules and regulations.
•	Make sure the alternator is operated in accordance with the manual(s) and within the limits of the alternator rating plate.
•	Do not use a damaged or defective alternator.
lf a c	defect(s) is discovered:
•	Shut down and isolate the alternator from all energy sources.
•	Remove or isolate stored energy.
•	Use lock out / tag out safety procedures.
•	Prevent further use of the alternator until it is repaired and returned to a serviceable condition.

### **∧** WARNING

**Removing Safety Covers** 

A hazard exists when alternator safety covers are removed. Ejected debris and particles can cause serious injury or death by impact, severing or puncturing. Exposure to mechanically driven release of debris and particles exists in all directions (horizontally and vertically) where covers are removed. To prevent injury or death:

- Fit the safety labels at the locations shown on the back of the label sheet supplied.
- Observe the safety labels.
- Refer to the service manual before removing covers.



FIGURE 4. SAFETY LABEL

### **MARNING**

#### Exposure to Ejected Debris and Particles

*Ejected debris and particles can cause serious injury or death by impact, severing or puncturing. Exposure to mechanically driven release of debris and particles exists in all directions (horizontally and vertically) in the areas surrounding the alternator air outlet(s), air inlets(s) and the open shaft end (also commonly known as the Drive End (DE)). To prevent injury or death:* 

- Keep away from the air inlet(s) and air outlet(s) when the alternator is operating.
- Do not position operator controls near the air inlet(s) or air outlet(s).
- Do not cause overheating by running the alternator outside rating plate parameters.
- Do not overload the alternator.
- Do not operate an alternator displaying excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

### <u> WARNING</u>

Exposure to Particles and Fumes from an Alternator.

Particles and fumes can be released in all directions (horizontally and vertically) from where alternator ventilation is installed. To avoid or injury:


- Avoid the areas around ventilation openings, air intake(s) and air outlet(s) when the alternator is operating.
- Use the correct personal protective equipment when working around an alternator.

### **MARNING**

Exposure to Particles and Fumes from Alternator Terminal Boxes.

Particles and fumes can be released in all directions (horizontally and vertically) from where terminal box pressure release flaps are installed. Terminal box pressure release flap(s) can be located at different positions and orientations. To avoid or injury:

• Personnel must keep away from terminal box pressure release flap(s) during alternator operation.

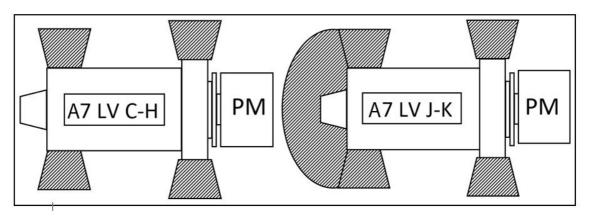



PM = Prime Mover / Engine / Drive System

## 2.10 Alternator Caution Notices

#### 

#### Hazardous Substances

Hazardous substances can cause minor or moderate injury. Prolonged or repetitive exposure to hazardous substances can cause serious medical conditions. To prevent injury:

- Always read and obey the instructions provided by the product manufacturer.
- Use, handle and store substances as specified by the product manufacturer.
- Always wear appropriate personal protective equipment, refer to Safety Precautions Chapter.

#### 

Missing Walkways and Handrails

Walkways and handrails temporarily removed for service and maintenance access can cause minor or moderate injury by slips, trips and falls. To prevent injury and before starting work:

• Assess the hazards and risks, take applicable precautions for safe working, place warnings and prevent access by unauthorized persons.

#### 

Dust & Airborne Particles/Fumes

Dust and other airborne particles and fumes can cause minor or moderate injury by irritating the lungs and eyes. Prolonged or repetitive exposure can cause serious medical conditions. To prevent injury:

- Use mechanical vacuum extraction to remove dust and airborne particles or fumes.
- Ventilate the area fully.
- Always wear the appropriate personal protective equipment. Refer to Safety Precautions Chapter.

# **3 Safety Directives and Standards**

## 3.1 General

STAMFORD<sup>®</sup> and AvK<sup>®</sup> alternators meet applicable national and international directives and standards relevant to alternators. The alternator must be operated within the limits specified in the relevant standards and within the parameters on the alternator rating plate. The alternator must comply with the regulatory requirements of the area/territory it is installed and used within.

Marine alternators meet the requirements of all the major marine classification societies.

This chapter includes EU/UK declaration template examples, where and if applicable.

Where necessary, STAMFORD<sup>®</sup> and AvK<sup>®</sup> alternators are supplied with a declaration certificate that displays the product description and unique serial number.

# 3.2 Example: Declarations of Conformity and Incorporation

CGT issue a Declaration of Conformity under the Low Voltage Directive 2014/35/EU. This Declaration is used for all complete products <1000 VAC that do not require the customer to provide any additional components to ensure the product meets the health and safety requirements of the Directive.

CGT issue a Declaration of Incorporation under the Machinery Directive 2006/42/EC. This Declaration is used for all products <1000 VAC that are **not** complete and will require the customer to provide additional components to ensure the product meets the health and safety requirements of the Directive.

Where necessary alternators are supplied with a certificate that displays the product description and unique serial number.

Below are examples of both types of EU and UK 'Declarations of Conformity' and 'Declarations of Incorporation' that STAMFORD<sup>®</sup> and AvK<sup>®</sup> alternators can be supplied with.

#### NOTICE

If the certificate is lost, missing or damaged, contact STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services www.stamford-avk.com.

014/35/EU	th the installation instruction Low Voltage Directive	provisions of the following EU Directive(s) when ons contained in the product documentation:			
014/30/EU		Compatibility (EMC) Directive			
011/65/EU		rdous Substances in Electrical and Electronic			
015/863	Delegated Directive an	mending Annex II of 2011/65/EU			
019/178		mending Annex II of 2011/65/EU			
019/1845	Delegated Directive an	mending Annex II of 2011/65/EU			
nd that the standards an	d/or technical specification	ns referenced below have been applied:			
N IEC 61000-6-2:2019	Electromagnetic com Immunity for industria	patibility (EMC). Generic standards – Part 6-2: al environments			
N IEC 61000-6-4:2019	Electromagnetic compatibility (EMC). Generic standards – Part 6-4: Emission standard for industrial environments				
N ISO 12100:2010	Safety of machinery – General principles for design – Risk assessment and risk reduction				
EC 60034-1:2017		achines - Part 1: Rating and performance			
SO 8528-3:2020	Reciprocating internal combustion engine driven alternating current generating sets - Part 3: Alternating current generators for generating sets				
3S 5000-3:2006	Rotating electrical ma applications - Part 3:	achines of particular types or for particular Generators to be driven by reciprocating internal - Requirements for resistance to vibration			
N IEC 63000:2018	Technical documenta electronic products w	ation for the assessment of electrical and ith respect to the restriction of hazardous			
		ponsibility of the manufacturer. The object of this harmonization Legislation.			
	npany Secretary, Cummin	e, authorised to compile the relevant technical is Generator Technologies Romania, B-dul			
Signed:		Name, Title and Address:			
S TA	Queen	Alastair McQueen Global Technical Director Cummins Generator Technologies Romania B-dul Decebal Nr. 116A 200746, Craiova			
	I				
Date: 4th August 2021		Dolj, ROMANIA			

FIGURE 6. EXAMPLE EU DECLARATION OF CONFORMITY - SHEET 1

EU DECLA	RATION OF CONFORMITY	C Technologies
The A.C. Gene 2011/65/EU	ator utilizes hazardous material exemptions as	detailed in Annex III of EU Directive
2011/65/EU, int	g the following descriptions are considered to l inded to be installed in Large Scale Fixed Insta icated location, installed and de-installed by pr	allations and for installation into a pre-
LVI80*		
LVSI80*		
S9L1D*		
DSG 99* DSG 114*		
DSG 125*		
DSG 144*		
Where "*" repre	ents any combination of letters and characters	completing the specific description of
		441273

FIGURE 7. EXAMPLE EU DECLARATION OF CONFORMITY - SHEET 2

	KANO	N OF CONFO	Consister Technologies			
electricity generating	ng-set an	nd fulfils all the re	. generator is designed for incorporation into an levant provisions of the following UK Statutory the installation instructions contained in the product			
S.I. 2016/1101 S.I. 2016/1091 S.I. 2012/3032	The El		atibility Regulations of Certain Hazardous Substances in Electrical and			
S.I. 2019/492	The Re		lations of Certain Hazardous Substances in Electrical and ndment) Regulations			
S.I. 2008/1597	The St	upply of Machinery (S	Safety) Regulations			
and that the standar	rds and/o	r technical specificati	ons referenced below have been applied:			
BS EN IEC 61000-6	6-2:2019		mpatibility (EMC). Generic standards – Part 6-2: for industrial environments			
BS EN IEC 61000-6	6-4:2019	Electromagnetic compatibility (EMC). Generic standards – Part 6-4: Emission standard for industrial environments Safety of machinery – General principles for design – Risk assessment				
BS EN ISO 12100:2	2010					
EC 60034-1:2017 3S ISO 8528-3:202	0	Reciprocating intern	machines: Rating and performance nal combustion engine driven alternating current art 3: Alternating current generators for generating			
BS EN IEC 63000:2	018	Technical document	ntation for the assessment of electrical and with respect to the restriction of hazardous			
		ued under the sole re ith the relevant UK L	esponsibility of the manufacturer. The object of this egislation.			
documentation, is the Wood, Peterboroug	ne Compa	any Secretary, Cumm	ve, authorised to compile the relevant technical ins Generator Technologies, Fountain Court, Lynch			
Signed:			Name, Title and Address:			
& The Queen			Alastair McQueen Global Technical Director Cummins Generator Technologies Fountain Court, Lynch Wood Peterborough, UK PE2 6FZ			
Date: 4th Augus	t 2021					
Description:			Serial Number:			
		Registered in England un	der Registration No. 441273.			

FIGURE 8. EXAMPLE UK DECLARATION OF CONFORMITY - SHEET 1

UK DECLARATION OF CONFORMITY
The A.C. Generator utilizes hazardous material exemptions as detailed in Annex III of S.I. 2012/2032
Products carrying the following descriptions are considered to be out of scope of S.I. 2012/2032,
intended to be installed in Large Scale Fixed Installations and for installation into a pre-defined and
dedicated location, installed and de-installed by professionals:
LVI80*
LVSI80*
S9L1D*
DSG 99* DSG 114*
DSG 114" DSG 125*
DSG 125 DSG 144*
Where "*" represents any combination of letters and characters completing the specific description of
the product.
×
Paristand is England under Paristation No. 441272
Registered in England under Registration No. 441273. Cummins Generator Technologies Ltd. Registered Office: Fountain Court, Lynch Wood, Peterborough, PE2 6FZ UK

FIGURE 9. EXAMPLE UK DECLARATION OF CONFORMITY - SHEET 2

<ul> <li>Is designed into a mach</li> </ul>	ed machinery supplied wit and constructed solely as ine requiring completion. to comply with the provision d will allow: Low Voltage Direct	th this declaration: s a non-functional component to be incorporated ons of the following EU Directive(s) so far as their
<ul> <li>Is designed into a mach</li> <li>Is designed level of build 2014/35/EU 2014/30/EU</li> </ul>	and constructed solely as ine requiring completion. to comply with the provision d will allow: Low Voltage Direct	s a non-functional component to be incorporated
into a mach Is designed level of built 2014/35/EU 2014/30/EU	ine requiring completion. to comply with the provision will allow: Low Voltage Direct	· · · · · · · · · · · · · · · · · · ·
level of build 2014/35/EU 2014/30/EU	d will allow: Low Voltage Direct	ons of the following EU Directive(s) so far as their
2014/35/EU 2014/30/EU	Low Voltage Direct	
2014/30/EU		otivo
		etic Compatibility (EMC) Directive
	Restriction on Ha	azardous Substances in Electrical and Electronic
2015/863	Equipment (RoHS	S) Directive ive amending Annex II of 2011/65/EU
2019/178		e amending Annex II of 2011/65/EU
2019/1845		e amending Annex II of 2011/65/EU
o Must not be	e put into service within	the European Community ("EC") until the final
machinery i	nto which it is to be incorp	porated has been declared in conformity with the
	Directive and all other appl	
		with the essential health and safety requirements C listed on sheet 2 of this Declaration.
uthority to its auth	orised representative. The	a reasoned request by the appropriate national e name and address of authorised representative,
uthority to its auth uthorised to com	porised representative. The ppile the relevant technic	
uthority to its auth uthorised to con cummins Generat comania.	porised representative. The ppile the relevant technic	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj,
uthority to its auth uthorised to con cummins Generat comania.	orised representative. The npile the relevant technic or Technologies Romania	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj,
uthority to its auth uthorised to con cummins Generat comania. he undersigned ro Signed:	orised representative. The npile the relevant technic or Technologies Romania epresenting the manufactu	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen
uthority to its auth uthorised to con cummins Generat comania. he undersigned ro Signed:	orised representative. The npile the relevant technic or Technologies Romania epresenting the manufactu	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen Global Technical Director
uthority to its auth uthorised to con cummins Generat comania. he undersigned ro Signed:	orised representative. The npile the relevant technic or Technologies Romania	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Romania B-dul Decebal Nr. 116A
uthority to its auth uthorised to con cummins Generat comania. he undersigned ro Signed:	orised representative. The npile the relevant technic or Technologies Romania epresenting the manufactu	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Romania
uthority to its auth uthorised to com cummins Generat comania. he undersigned ro Signed:	norised representative. The hpile the relevant technic or Technologies Romania epresenting the manufactu	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Romania B-dul Decebal Nr. 116A 200746 Craiova
uthority to its auth uthorised to con cummins Generat comania. he undersigned ro Signed:	norised representative. The hpile the relevant technic or Technologies Romania epresenting the manufactu	e name and address of authorised representative, cal documentation, is the Company Secretary, a, B-dul Decebal Nr. 116A 200746 Craiova Dolj, urer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Romania B-dul Decebal Nr. 116A 200746 Craiova

FIGURE 10. EXAMPLE EU DECLARATION OF INCORPORATION - SHEET 1

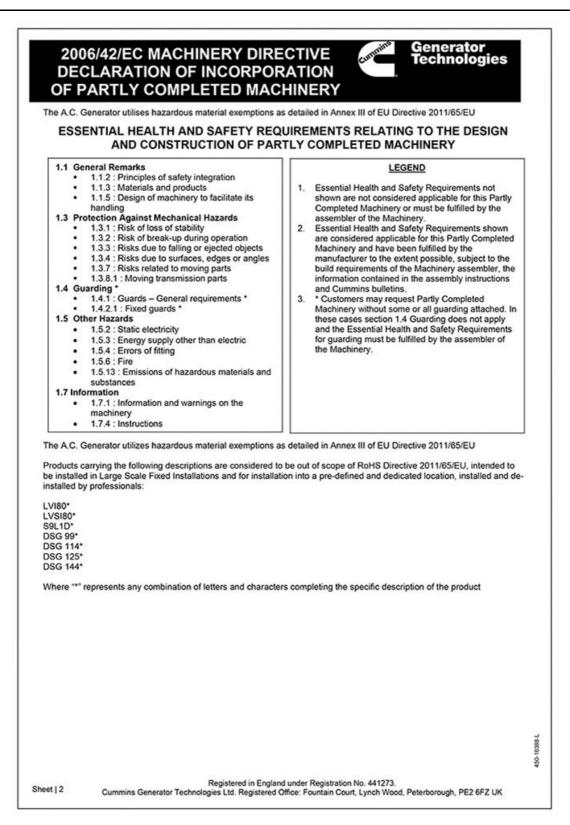


FIGURE 11. EXAMPLE EU DECLARATION OF INCORPORATION - SHEET 2

	adh, completed machines, cumplied with				
	artly completed machinery supplied with	this declaration.			
0		a non-functional component to be incorporated			
	into a machine requiring completion.				
0		ns of the following UK Statutory Instrument(s) so			
	far as their level of build will allow:				
		ment (Safety) Regulations			
		c Compatibility Regulations e Use of Certain Hazardous Substances in			
		onic Equipment Regulations			
		e Use of Certain Hazardous Substances in			
		onic Equipment (Amendment) Regulations			
S.I. 2008/1597 The Supply of Machinery (Safety) Regulations					
	Must not be put into service within the	UK until the final machinery into which it is to be			
0		nformity with the Supply of Machinery (Safety)			
	Regulations 2008 and all other applical				
0		with the essential health and safety requirements			
	of the Supply of Machinery (Safety)	Regulations 2008 listed on sheet 2 of this			
	Declaration.				
of An	elevant technical documentation is comp nex VII of the Machinery Directive. All re	piled in accordance with the provisions of part B elevant information about the partly completed			
of An nach autho epre	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies,	elevant information about the partly completed asoned request by the appropriate national			
of An nach autho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ indersigned representing the manufactur	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ indersigned representing the manufactur	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company , Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- tary, Cummins Generator Technologies, FZ undersigned representing the manufactured:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- tary, Cummins Generator Technologies, FZ undersigned representing the manufactured:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company , Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ indersigned representing the manufactur	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company , Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- tary, Cummins Generator Technologies, FZ undersigned representing the manufactured:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK. rer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Fountain Court, Lynch Wood Peterborough, UK			
of An nach iutho epre Secre PE2 6 The L Signe	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- tary, Cummins Generator Technologies, FZ undersigned representing the manufactured:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ andersigned representing the manufactur ed:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
of An nach iutho epre Secre PE2 6 The L Signe	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- tary, Cummins Generator Technologies, FZ undersigned representing the manufactured:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK. rer: Name, Title and Address: Alastair McQueen Global Technical Director Cummins Generator Technologies Fountain Court, Lynch Wood Peterborough, UK			
f An nach utho epre Secre 22 6 The L Signa	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ andersigned representing the manufactur ed:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
f An hach utho epre E2 6 The U Signa	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ andersigned representing the manufactur ed:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			
f An hach utho epre E2 6 The U Signa	elevant technical documentation is comp nex VII of the Machinery Directive. All re- inery will be provided, in writing, on a rea- rity to its authorised representative. The sentative, authorised to compile the relev- etary, Cummins Generator Technologies, FZ andersigned representing the manufactur ed:	elevant information about the partly completed asoned request by the appropriate national name and address of authorised vant technical documentation, is the Company Fountain Court, Lynch Wood, Peterborough, UK.			

FIGURE 12. EXAMPLE UK DECLARATION OF INCORPORATION - SHEET 1

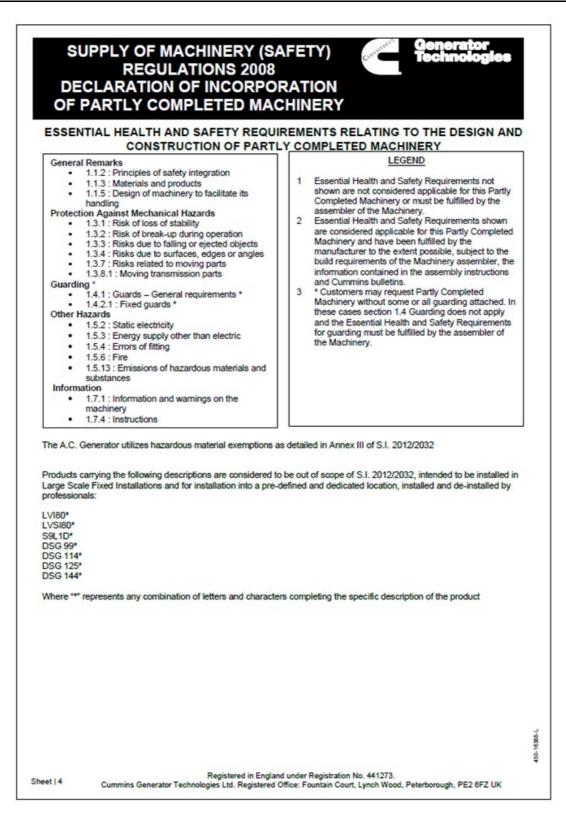


FIGURE 13. EXAMPLE UK DECLARATION OF INCORPORATION - SHEET 2

## 3.3 Additional Information for Electromagnetic Compatibility Compliance (EMC)

Where necessary STAMFORD<sup>®</sup> and AvK<sup>®</sup> alternators are designed to meet electromagnetic compatibility compliance emissions and immunity standards for industrial environments. Additional equipment may be required when the alternator is installed in residential, commercial, and light industrial environments.

The installation 'earth/ground' arrangements require the connection of the alternator frame to the site protective earth conductor using a minimum lead length.

#### NOTICE

Cummins Generator Technology is not liable for electromagnetic compatibility compliance if non-genuine STAMFORD<sup>®</sup> or AvK<sup>®</sup> brand parts are used for maintenance, servicing or repairs.

## 3.4 Additional Information for Canadian Standards Association (CSA)

To comply with Canadian Standards Association (CSA) regulations, all external wiring and components must be rated to: At least the alternator rated voltage shown on the alternator rating plate.

# 4 Introduction

## 4.1 General Description

A7 alternators are of brushless rotating field design, available up to 690 V, 50 Hz (1000 RPM, 6 pole) or 60 Hz (1200 RPM, 6 pole), and built to meet BS5000 Part 3 and international standards.

## 4.2 Water Cooled and Sleeve Bearing Alternators

AvK<sup>®</sup> A7 low voltage alternators can be supplied with an optional factory fitted water cooler and/or sleeve bearings.

Before lifting or transporting an alternator with water cooler and sleeve bearings, read the addendum manual.

The manual is available in the languages listed in the table below:

Language	Manual Type	Part Number
Arabic (ar-sa)	Addendum	A072Y751
German (de-de)	Addendum	A072Y715
English (en-us)	Addendum	A072V518
Spanish (es-es)	Addendum	A072Y694
French (fr-fr)	Addendum	A072Y711
Italian (it-it)	Addendum	A072Y716
Japanese (ja-jp)	Addendum	A072Y753
Polish (pl-pl)	Addendum	A072Y750
Portuguese (pt-pt)	Addendum	A072Y717
Russian (ru-ru)	Addendum	A072Y747
Swedish (sv-se)	Addendum	A072Y743
Chinese (zh-cn)	Addendum	A072Y746

#### TABLE 3. WATER COOLER SLEEVE BEARING ADDENDUM MANUAL

### 4.3 Noise

### MARNING

#### Noise

Noise from a running alternator can cause serious and permanent hearing damage. To prevent injury:

• Always wear appropriate personal protection equipment. Refer to Personal Protective Equipment paragraph.

Maximum A-weighted noise emissions may reach 110 dB(A). Contact the supplier for application-specific details.

## 4.4 Alternator Name

Example:	Α	7	L	1	ooling <b>a</b>	-	С	6	2
	AvK Brand	Family Series	Voltage (L = low, M = medium, H = high)	Revision	Descriptor D = industrial, $M$ = marine, $W$ = water cooling		Core length (C, D, E,)	Number of poles	Number of bearings (1 = NDE, 2 = DE & NDE)

TARI F 4	A7 ALTERNATOR NAMING FORMAT
IADLL 4.	

## 4.5 Serial Number Location

A unique serial number is stamped into the drive end ring of the alternator frame and shown on two labels on the outside of the terminal box (if fitted).

## 4.6 Rating Plate

The fixed rating plate label states the intended operating parameters of the alternator.

TYPE	SERIAL	No
AVR	kva 🗌	Hz PHASE
PF	RPM	STATOR WDG
VOLTS	AMPS	STATOR CON
RATING	AMBIENT TEMP	°C ENCLOSURE
EXCITATION VOLTS	AMPS	INSULATION CLASS
WEIGHT NEMA MG1-32 IEC 60034-1 BS5000 UL1446	Avł	Scan for Production

FIGURE 14. GLOBAL AVK A-RANGE AC ALTERNATOR RATING PLATE

## 4.7 **Product Authentication**

The STAMFORD |  $AvK^{TM}$  high security, anti-counterfeit hologram is located on the Tracking Label. Check that the dots are visible around the logo when viewing the hologram from different angles and the word "GENUINE" appears behind the logo. Use a flashlight to see these security features in low ambient light. Check that the alternator is genuine by entering the unique 7 character hologram code at www.stamford-avk.com/verification.

 






FIGURE 16. DOTS VISIBLE IN LEFT, RIGHT, UPPER AND LOWER VIEWS OF 3D HOLOGRAM

This page is intentionally blank.

# 5 Lifting, Storage and Transportation

## 5.1 General Transport Guidance

Alternators vary in shape, size, weight, and center of gravity. For product information, refer to the general arrangement drawing, lifting label and transport information supplied with the alternator.

Before loading a vehicle, transporting a load and/or unloading a vehicle:

- Obey applicable rules and regulations relating to transport operations at all times.
- Make sure a sufficient number of applicably configured restraints are used to lash down/secure an alternator to a vehicle.
- Do not position lashing down/securing restraints on or over sensitive components that can be damaged by the restraint.
- Do not position lashing down/securing restraints on paintwork or information/warning labeling. Protect these areas if restrains must be placed over them.
- Before transportation or storage, apply an anti-corrosion agent to exposed machined surfaces.
- Before transportation or storage, cover exposed connection points with a sufficient cover, cap or packaging material.
- Before transportation or storage, if necessary, protect bearings from vibration using anti-vibration pads. Do not transport unprotected alternators over an uneven surface.
- Alternators should be supplied on a transport frame if necessary.
- Bearings should be protected from damage by using a transportation lock (if available) when necessary. If a transport lock is supplied with the bearing/alternator it must be installed before transportation.
- · Bearings must be protected from corrosion using an applicable anti-corrosion agent.
- Read and obey industry best practice guidance.
- · Consult with a transport specialist for advice if necessary.

## 5.2 Lifting the Alternator

#### A DANGER

#### Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping. To prevent injury or death and before lifting:

- Check the capacity, condition and attachment of lifting equipment.
- Check the capacity, condition and attachment of accessories for lifting.
- Check the capacity, condition and attachment of lifting point(s) on the load.
- · Check the mass, integrity and stability of the load.
- If available: Install drive end and non-drive end transit fittings to prevent movement and damage to bearings.
- Keep the alternator horizontal when lifting.
- Do not use alternator lifting points for lifting a complete generator set.
- Do not use cooler lifting points for lifting the alternator or a complete generator set.
- Do not remove the lifting label attached to one of the lifting points.

Lift the alternator by hooks or shackles attached to the lifting points (lugs or eyes) provided. A label attached to a lifting point shows the correct lifting arrangement. Use chains of sufficient length, and a spreader bar if necessary, to make sure that the chains are vertical when lifting. Make sure that the capacity of the lifting equipment is sufficient for the alternator mass shown on the label.

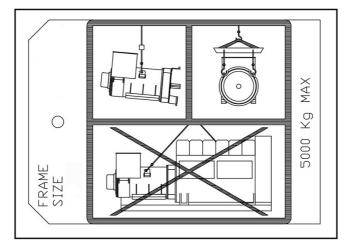


FIGURE 17. LIFTING LABEL

# 5.2.1 Lifting an Alternator Fitted With a Water Cooler or Sleeve Bearings

NOTICE

Before lifting or transporting a STAMFORD | AvK<sup>™</sup> A7 low voltage alternator with a water cooler or sleeve bearings, refer to: <u>Section 4.2 on page 23</u>.

## 5.3 Alternator Dimensions

Dimensions are included in the data sheet specific to the alternator model. Refer to the rating plate to identify the alternator model.

NOTICE
Data sheets are available from www.stamford-avk.com


## 5.4 Storage

WARNING

#### **Condensed Water**

Operating an alternator with condensed water in the windings can cause serious injury by electric shock, burns or exposure to flying debris and particles. To prevent injury and before operating the alternator:

- Use anti-condensation heaters (if fitted) to prevent condensation accumulating.
- Check for condensed water.
- If condensed water is present, drain/remove the water, dry and inspect the alternator, refer to: Maintenance and Servicing Chapter.

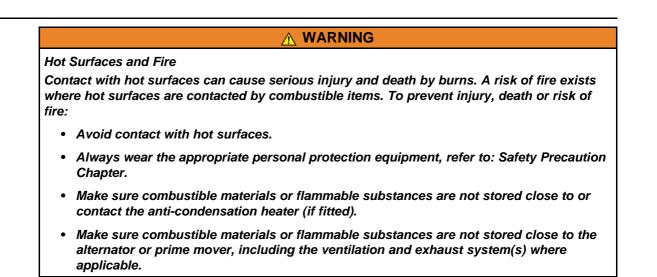

If the alternator will not be used immediately, it must be stored in a clean, dry, vibration-free environment. We recommend the use of anti-condensation heaters, when available.

If the alternator can be rotated, turn the rotor a minimum of 6 revolutions every month during storage.

## 5.5 Long-term Storage

When an alternator is stationary, in storage or otherwise, it may be subjected to environmental factors, such as vibration, humidity, temperature and airborne contaminant particles, that could degrade the bearing arrangements.

Contact STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u> for advice in advance if the alternator will be stationary for long periods.

## 5.6 After Storage

After a period of storage, do the pre-running checks to determine the condition of the windings. If the windings are damp or the insulation resistance is low, refer to alternator insulation drying procedure: **Section 8.8.6 on page 67**.

Before putting the alternator into service, refer to the following table.

Bearing Type	Not Rotated during Storage	Rotated during Storage	
Sealed Bearing(s)	If stored less than 12 months, put the alternator into service. If stored more than 12 months, replace the bearing(s) then put the alternator into service.	If stored less than 24 months, put the alternator into service. If stored more than 24 months, replace the bearing(s) then put the alternator into service.	
Re-greasable Bearing(s)	If stored less than 12 months, put the alternator into service. If stored more than 12 months, replace the bearing(s) then put the alternator into service.	If stored less than 6 months, put the alternator into service. If stored between 6 and 24 months, re-grease the bearing(s) during the first run then put the alternator into service. If stored more than 24 months, replace the bearing(s) then put the alternator into service.	

TABLE 5. BEARING STORAGE

This page is intentionally blank.

# 6 Application of the Alternator

It is the customer's responsibility to make sure that the selected alternator is suitable for the final application.

Incorrect or Improper Use
Incorrect or improper use of the alternator may result in equipment damage, serious injury or death. To prevent or equipment damage injury or death:
• Always select the correct specification alternator for the intended use and application.
<ul> <li>Make sure the alternator and prime mover are compatible and suitable for the intended application.</li> </ul>
<ul> <li>Always install the alternator in accordance with the original manual(s) and technical drawing(s) supplied with the alternator.</li> </ul>
Obey locally applicable rules and regulations.
<ul> <li>Make sure the alternator is operated in accordance with the manual(s) and within the limits of the alternator rating plate.</li> </ul>
Do not use a damaged or defective alternator.  If a defect(s) is discovered:
Shut down and isolate the alternator from all energy sources.
Remove or isolate stored energy.
Use lock out / tag out safety procedures.
<ul> <li>Prevent further use of the alternator until it is repaired and returned to a serviceable condition.</li> </ul>

## 6.1 Environment

The alternators are protected to IP23 as standard. IP23 is not adequate protection for use outdoors without additional measures.

TABLE 6.	ENVIRONMENTAL SPECIFICATION
----------	-----------------------------

Ambient Temperature	-15 °C to 40 °C (5 °F to 104 °F)	
Relative Humidity	< 70%	
Altitude	< 1000 m (3280 ft)	

The alternator has been designed for the environment shown in the table. The alternator can operate outside these conditions if it is rated accordingly, refer to the nameplate. If the operating environment is changed after purchase, speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u> for a revised alternator rating.

## 6.2 Air Flow

Alternator type	50 Hz     60 Hz     outlet p		Maximum intake to outlet pressure difference, mm (in) water gauge
A7 6P (D&H cores)	1.81	2.17	6 (0.25)
A7 6P (J&K cores)	2.07	2.48	6 (0.25)

#### TABLE 7. MINIMUM AIR FLOW AND MAXIMUM PRESSURE DIFFERENCE

Make sure that the air inlets and outlets are not obstructed when the alternator is running.

## 6.3 Airborne Contaminants

#### **Dust & Airborne Particles/Fumes**

Dust and other airborne particles and fumes can cause minor or moderate injury by irritating the lungs and eyes. Prolonged or repetitive exposure can cause serious medical conditions. To prevent injury:

- Use mechanical vacuum extraction to remove dust and airborne particles or fumes.
- Ventilate the area fully.
- Always wear the appropriate personal protective equipment. Refer to Safety Precautions Chapter.

#### NOTICE

Contaminants such as salt, oil, exhaust fumes, chemicals, dust, and sand will reduce the effectiveness of the insulation and the life of the windings. Consider using air filters and an enclosure to protect the alternator.

## 6.4 Air Filters

Air filters trap airborne particulates above 5 microns. The filters must be cleaned or replaced regularly, depending on site conditions. Check the filters frequently to establish an appropriate service interval.

Alternators with factory-fitted filters are rated to account for the reduced flow rate of cooling air. If filters are retrofitted, the alternator rating must be reduced by 5%.

Air filters do not remove water. Keep the filters dry with additional protection. Wet filters further restrict airflow, causing the alternator to overheat and leading to premature failure of the insulation.

## 6.5 Humid Conditions

The water carrying capacity of air depends on temperature. If the air temperature falls below its saturation point, dew may form on the windings, reducing the electrical resistance of the insulation. In humid conditions, additional protection may be required even if the alternator is fitted inside an enclosure. Anti-condensation heaters are supplied on request.

## 6.6 Anti-Condensation Heaters

#### ▲ DANGER

#### Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### 🔥 WARNING

#### **Condensed Water**

Operating an alternator with condensed water in the windings can cause serious injury by electric shock, burns or exposure to flying debris and particles. To prevent injury and before operating the alternator:

- Use anti-condensation heaters (if fitted) to prevent condensation accumulating.
- Check for condensed water.
- If condensed water is present, drain/remove the water, dry and inspect the alternator, refer to: Maintenance and Servicing Chapter.

#### 

#### Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

Power to the anti-condensation heater is supplied from a separate source. Anti-condensation heaters raise the air temperature around the windings to deter condensation forming in humid conditions when the alternator is not operating. Best practice is to energize the heaters automatically when the alternator is off.

## 6.7 Enclosures

#### 🔨 WARNING

#### Enclosures

Alternators may be installed within an enclosure for environmental protection, noise reduction or transportation reasons. Before entering the enclosure to prevent injury or death, personnel must:

- Know the related hazards / risks.
- Have a safe access route in to and out of the enclosure, have sufficient ventilation and obey the alternator hazard zones.
- Wear the appropriate protective equipment.

Additionally when working with Medium or High Voltage alternators:

- Enter the enclosure when the alternator is operating, only if absolutely necessary.
- To minimize risks to personnel use remote diagnostic, monitoring and measuring systems.

#### **⚠ WARNING**

Water ingress during rainy season could lead to electrical shock near alternator, and other electrical components.

- Fit an enclosure to protect the alternator from adverse environmental conditions.
- Make sure that air entering the alternator is of adequate flow rate, free from moisture and contaminants and below the maximum ambient temperature on the rating plate.
- The airflow should be modeled to identify and prevent hot air from re-circulating within the enclosure.
- Make sure there is sufficient access around the alternator for safe maintenance.

## 6.8 Vibration

The alternators are designed to withstand the vibration levels encountered on generator sets built to meet the requirements of ISO 8528-9 and BS 5000-3. (Where ISO 8528 is taken to be broad band measurements and BS5000 refers to the predominant frequency of any vibrations on the generator set).

#### NOTICE

Exceeding either of the above specifications will have a detrimental effect on the life of the bearings and other components and may invalidate the alternator warranty.

#### NOTICE

The terminal box is designed to support the fitted busbars or terminals, transformers, load cables and auxiliary terminal box. Additional mass could cause excessive vibration and lead to failure of the terminal box enclosure and mounting. Refer to the Installation Manual to connect the load cables to the terminal box. Speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services before fixing any additional mass to the terminal box.

### 6.8.1 Definition of BS5000-3

Alternators shall be capable of continuously withstanding linear vibration levels with amplitudes of 0.25 mm between 5 Hz and 8 Hz, and velocities of 9.0 mm/s RMS between 8 Hz and 200 Hz, when measured at any point directly on the carcass or main frame of the machine. These limits refer only to the predominant frequency of vibration of any complex waveform.

## 6.8.2 Definition of ISO 8528-9

ISO 8528-9 refers to a broad band of frequencies, the broad band is taken to be between 10 Hz and 1000 Hz. The table below is an extract from ISO 8528-9 (Table C.1, value 1). This simplified table lists the vibration limits by kVA and speed for acceptable operation of standard generator set designs.

## 6.8.3 Vibration Frequencies

The main vibration frequencies produced by the alternator are as follows:

- 6-pole 1000 RPM 16<sup>2</sup>/<sub>3</sub> Hz
- 6-pole 1200 RPM 20 Hz

Vibrations induced in the alternator by the engine are complex. It is the responsibility of the generator set designer to ensure that the alignment and stiffness of the bedplate and mountings do not allow vibration to exceed BS5000 part 3 and ISO 8528 part 9 limits.


## 6.8.4 Linear Vibration Limits

Linear Vibr	Linear Vibration Levels As Measured on the A7 Alternator							
Engine Speed RPM (min <sup>-1</sup> )	Power Output S (kVA)	Vibration Displacement RMS (mm)	Vibration Velocity RMS (mm/s)					
1 300 ≤nr <2 000	>250	0.32	20					
720 ≤nr <1 300	≥250 but ≤1 250	0.32	20					
	>1 250	0.29	18					
Th	e broad band is tak	en as 10 Hz - 100	00 Hz					

TABLE 8. A7 VIBRATION LEVEL MEASUREMENTS

## 6.8.5 Linear Vibration Monitoring

We recommend using vibration analyzing equipment to measure vibration at all of the 12 positions shown below. Check that vibration of the generator set is below the limits stated in the standards. If vibration is above the limits, the generator set builder should investigate the root causes and eliminate them. Best practice is for the generator set builder to take initial readings as a reference and for the user to periodically monitor vibration, according to the recommended service schedule, to detect a deteriorating trend.

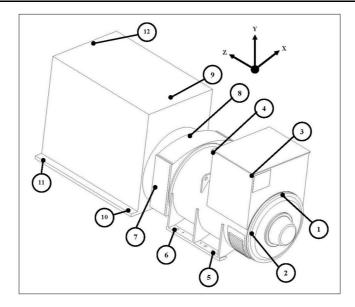



### 6.8.6 Excessive Vibration

#### 

Exposure to Ejected Debris and Particles

Ejected debris and particles can cause serious injury or death by impact, severing or puncturing. Exposure to mechanically driven release of debris and particles exists in all directions (horizontally and vertically) in the areas surrounding the alternator air outlet(s), air inlets(s) and the open shaft end (also commonly known as the Drive End (DE)). To prevent injury or death:

- Keep away from the air inlet(s) and air outlet(s) when the alternator is operating.
- Do not position operator controls near the air inlet(s) or air outlet(s).
- Do not cause overheating by running the alternator outside rating plate parameters.
- Do not overload the alternator.
- Do not operate an alternator displaying excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

If the measured vibration of the generator set is not within the limits:

- 1. Consult with the generator set manufacturer to reduce vibration to an acceptable level.
- 2. Speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u> to assess the impact on bearing and alternator life expectancy.

## 6.9 Bearings

### 6.9.1 Sealed Bearings

Inspect sealed-for-life bearings periodically, according to the recommended service schedule in this manual. Check for signs of wear, fretting or other damaging effects. Damage to seals, grease leakage or discoloration of the bearing races indicate that the bearing may need to be replaced.

Each bearing housing is connected by a grease pipe to an external grease nipple. A label gives the grease type and quantity, and frequency for re-greasing. The recommended grease is a high specification synthetic compound that must not be mixed with grease of a different specification. Refer to the Service and Maintenance chapter for detailed instructions.

## 6.9.3 Bearing Life

Factors that reduce bearing life or lead to bearing failure include:

- Adverse operating conditions and environment.
- · Stress caused by misalignment of the generator set.
- Vibration from the engine that exceeds the limits in BS 5000-3 and ISO 8528-9.
- Long periods (including transportation) when the alternator is stationary and subjected to vibration can cause false brinelling wear (flats on the balls and grooves on the races).
- Humid or wet conditions that cause corrosion and deterioration of the grease by emulsification.

## 6.9.4 Health Monitoring of the Bearings

We recommend that the user checks the bearing condition using vibration monitoring equipment. Best practice is to take initial readings as a reference and periodically monitor the bearings to detect a deteriorating trend. It will then be possible to plan a bearing change at an appropriate generator set or engine service interval.

## 6.9.5 Bearing 'Service Life' Expectancy

Bearing manufacturers recognize that the service life of bearings depends on factors that are outside their control. Rather than quote a service life, practicable replacement intervals are based on the L10 life of the bearing, the type of grease, and the recommendations of the bearing and grease manufacturers.

For general purpose applications, if the correct maintenance is carried out, vibration levels do not exceed the levels stated in ISO 8528-9 and BS5000-3, and the ambient temperature does not exceed 50 °C, plan to replace the bearings within 30,000 hours of operation.

If in doubt regarding any aspect of bearing life of a STAMFORD |  $AvK^{TM}$  alternator, contact the nearest authorized supplier of the alternator or STAMFORD<sup>®</sup> or  $AvK^{®}$  customer services <u>www.stamford-avk.com</u>.

## 6.9.6 Standby Applications

Run alternators in standby applications at no load for a minimum of 10 minutes every week. For alternators fitted with re-greasable bearings, re-grease the bearings every 6 months, regardless of the number of accumulated running hours.

This page is intentionally blank.

# 7 Installation into the Generator Set

## 7.1 Generator Set Coupling

#### 🕂 WARNING

#### Coupling an Alternator

Moving mechanical parts during coupling can cause serious injury by crushing, severing or trapping. When coupling the alternator to a prime-mover or when installing large components, to prevent injury:


• Personnel must keep limbs and body parts away from coupling surfaces during coupling and/or installing operations.

#### NOTICE

Optional transit support screws may be fitted to the non-drive end of the alternator. Ensure the transit support screws have been removed before rotating, coupling or operating the alternator.

#### NOTICE

Do not attempt to rotate the alternator rotor by levering against the vanes of the cooling fan. The fan is not designed to withstand such forces and will be damaged.

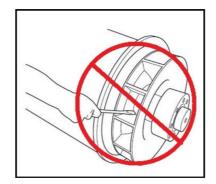

#### FIGURE 19. DO NOT ROTATE WITH A LEVER

Efficient operation and long component life depend on minimizing mechanical stresses on the alternator. When coupled in a generator set, misalignment and vibration interactions with the prime mover engine can cause mechanical stress.

Generator sets need a substantial flat continuous bedplate to suit the installation site floor loading, with engine and alternator mounting pads to make a firm base for accurate alignment. The height of all mounting pads must be within 0.25 mm for skid mounting, 3 mm for non-adjustable anti-vibration mounts (AVM) or 10 mm for adjustable height AVMs. Use shims to achieve level. The rotational axes of alternator rotor and engine output shaft must be coaxial (radial alignment) and perpendicular to the same plane (angular alignment). The axial alignment of the alternator and engine coupling must be within 0.5 mm, to allow for thermal expansion without unwanted axial force on the bearings at operating temperature.

Vibration can occur by flexing of the coupling. The alternator is designed for a maximum bending moment not exceeding 275 kgm (2000 lbs ft). Check the maximum bending moment of the engine flange with the engine manufacturer.

Close-coupling of alternator and engine can increase the rigidity of the generator set. Both one and two bearing alternators can be close-coupled. The generator set builder must supply guarding for open-coupled applications.

To prevent rust during transit and storage, the alternator frame spigot, rotor coupling plates and shaft extension have been treated with a rust preventative coating. Remove this before coupling the generator set.

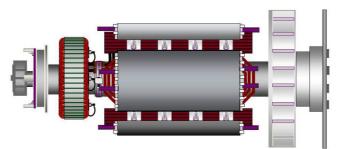


FIGURE 20. ONE BEARING ALTERNATOR ROTOR SHOWING COUPLING DISCS BOLTED TO DRIVE END COUPLING HUB (AT RIGHT)

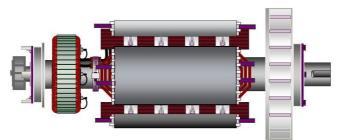


FIGURE 21. TWO BEARING ALTERNATOR ROTOR SHOWING SHAFT WITH KEYWAY FOR FLEXIBLE COUPLING (AT RIGHT)

## 7.2 One Bearing Alternators

#### 🔥 DANGER

#### Falling Mechanical Parts

Falling mechanical parts can cause serious injury or death by impact, crushing, severing or trapping. To prevent injury or death and before lifting:

- Check the capacity, condition and attachment of lifting equipment.
- Check the capacity, condition and attachment of accessories for lifting.
- Check the capacity, condition and attachment of lifting point(s) on the load.
- Check the mass, integrity and stability of the load.
- If available: Install drive end and non-drive end transit fittings to prevent movement and damage to bearings.
- Keep the alternator horizontal when lifting.
- Do not use alternator lifting points for lifting a complete generator set.
- Do not use cooler lifting points for lifting the alternator or a complete generator set.
- Do not remove the lifting label attached to one of the lifting points.
- 1. Remove the drive end transit bracket that keeps the rotor in place during transport before coupling to the engine.
- 2. Remove the air outlet covers from the drive end of the alternator to access the coupling and adaptor bolts.
- 3. Make sure the coupling discs are concentric with the adaptor.

- 4. Fit two alignment dowels into flywheel bolt holes 180 degrees apart to help align the disc and the flywheel.
- 5. Lift and offer the alternator to the engine, barring the engine over by hand to align discs and flywheel.
- 6. Engage the alignment dowels into coupling disc bolt holes and push the alternator towards the engine until the coupling discs are against the flywheel face.
- 7. Remove the rotor support bracket, if supplied.

#### NOTICE

Do not pull the alternator to the engine using bolts through the flexible discs.

- 8. Fit the adaptor bolts, using heavy gauge washers under the heads. Tighten the adapter bolts evenly around the adapter.
- 9. Check the torque of each bolt in a clockwise direction around the bolt circle to ensure all the bolts are tight. Refer to the engine manufacturer's manual for correct tightening torque.
- Remove the alignment dowels. Fit the coupling bolts, using heavy gauge washers under the heads. Tighten the bolts to fix the coupling disc to the flywheel, in the sequence shown in Figure 22 on page 41.
- 11. Check the torque of each bolt in a clockwise direction around the bolt circle to ensure all the bolts are tight.
- 12. Replace all covers.

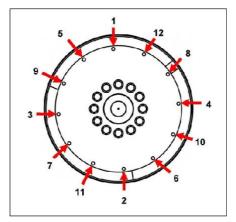


FIGURE 22. FIXING SEQUENCE

## 7.3 **Two Bearing Alternators**

A flexible coupling, designed to suit the specific engine/alternator combination, is recommended to minimize torsional vibration effects.

If a close coupling adaptor is used the alignment of machined faces must be checked by offering the alternator up to the engine. Shim the alternator feet if necessary.

## 7.4 Pre-Running Checks

Before starting the generator set, test the insulation resistance of windings and check that all connections are tight and in the correct location. Make sure the alternator air path is clear of obstructions. Replace all covers.

## 7.5 Direction of Rotation

The direction of rotation is shown by an arrow in the fan casting. If the alternator must run in the other direction, speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services www.stamford-avk.com.

## 7.6 Phase Rotation

Main stator output is connected for a phase sequence of U V W when the alternator runs clockwise, as viewed from the drive end. If the phase rotation must be reversed, the customer must re-connect the output cables in the terminal box. STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u> for a circuit diagram of 'reverse phase connections'.

## 7.7 Voltage and Frequency

Check that the voltage and frequency shown on the alternator rating plate meet the requirements of the generator set application. Refer to detailed instructions in the AVR manual for adjustments.

## 7.8 AVR Settings

The AVR is factory set for initial running tests. Check that the AVR settings are compatible with your required output. Refer to detailed instructions in the AVR manual for on- and off-load adjustments.

## 7.9 Electrical Connections

#### **MARNING**

Incorrect Electrical Installation and System Protection Incorrect electrical installation and / or system protection can cause serious injury or death by electric shock and burns. To prevent injury or death and before starting work, personnel:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s).
- Know related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

The terminal box is designed to support the fitted busbars or terminals, transformers, load cables and auxiliary terminal box. Additional mass could cause excessive vibration and lead to failure of the terminal box enclosure and mounting. Speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services www.stamford-avk.com before fixing any additional mass to the terminal box. Panels must be removed to be drilled or cut, to prevent swarf entering the terminal box or alternator.

Fault current curves and alternator reactance values are available on request from the factory so that the system designer can calculate the necessary fault protection and/or discrimination.

The installer must check that the alternator frame is bonded to the generator set bedplate, and must bond to site earth. If anti-vibration mounts are fitted between the alternator frame and its bedplate, a suitably-rated earth conductor must bridge across the anti-vibration mount.

Refer to wiring diagrams for electrical connection of the load cables. Electrical connections are made in the terminal box, constructed with removable panels to suit site-specific cable entry and glanding. Route single core cables through the insulated or non-magnetic gland plates supplied. Panels must be removed to be drilled or cut to prevent swarf entering the terminal box or alternator. After wiring, inspect the terminal box, remove all debris using a vacuum cleaner if necessary and check that no internal components are damaged or disturbed. Load cables must be supported appropriately to avoid a tight radius at the point of entry into the terminal box, clamped at the terminal box gland, and allow at least  $\pm 25$  mm movement by the alternator set on its anti-vibration mountings, without causing excessive stress to the cables and alternator load terminals.

The palm (flattened part) of load cable lugs must be clamped in direct contact with the main stator load output terminals so that the whole palm area conducts the output current. The tightening torque of M12 fasteners is 70 Nm or 90 Nm for M16 fasteners (main nut) and 45 Nm (lock nut).

## 7.10 Grid Connection: Voltage Surges and Micro-Interruptions

Consideration should be given to any transient voltages loads generated by connected loads and/or distribution system which could damage the alternator components.

According to the specifics of the application and installation the points below must be considered:

- Loads with characteristics that result in large load step changes.
- Load control by switchgear and power control by any method likely to generate transient voltage spikes.
- Distribution systems susceptible to external influences, such as lightning strikes.
- Applications involving parallel operation to a mains supply, where the risk of a mains disturbance in the form of a micro-interruption could occur.

If the alternator is at risk from voltage surges or micro-interruptions, it is recommended that the installation includes adequate protection of the generation system to meet regulations and installation requirements. It is recommended to seek guidance from specialist protection system designers and associated professional bodies.

## 7.11 Embedded Applications

These notes cover applications with the alternator running in parallel with the mains utility such as CHP (sometimes called co-generation).

A typical Thermal Class for this duty is identified by ISO 8528 as a "basic continuous rating" (BR), Class 'F' rating - continuous duty. This offers the best operating efficiency, with low thermal stress for the winding insulation system.

Establish the operating voltage range of the local mains supply and the specified kVA, kVAr, and kW. Consider the full range of the required operating duty against the alternator operating chart (capability diagram). A co-generation application is a continuous fixed duty, always within the 'BR' category, and no overload capability is expected.

See <u>Table 9 on page 44</u> for the recommended level of protection for an embedded application.

Protection	Minimum	Optional
Overcurrent	Х	
Short Circuit	Х	
Under Volts	Х	
Over Volts	Х	
Under Hz	Х	
Over Hz	Х	
Differential		Х
Earth Fault		Х
Stator Temperature Monitoring		Х
Vibration Monitoring		Х
Bearing Condition Monitor		Х
Reverse Power	Х	
Excitation Loss	Х	
Power Factor Control	Х	
Voltage Matching	Х	
Mains Interruption (Vector Shift, Frequency Deviation)	Х	

#### TABLE 9. RECOMMENDED EMBEDDED APPLICATION PROTECTION LEVELS

The alternator overload and short circuit settings on the protection should be set so that they are below the thermal damage curve for the alternator.

If the overload and short circuit protection is provided by a circuit breaker, take care with the protection settings. Circuit breakers are normally designed for operation with the utility supply, which sustains higher and longer durations of fault level than the alternator can tolerate. The overcurrent and short circuit settings must be set according to the alternator operating chart and not to the overcurrent/short circuit details supplied with the circuit breaker.

Alternator data sheets are available to help calculate these settings.

## 7.12 Varying Load

Under certain conditions, load variations can reduce alternator life.

Identify any possible risk, especially the following:

- Large capacitive loads (for example Power Factor Correction equipment) can affect alternator stability and cause pole slip.
- Stepped grid voltage variation (for example Tap Changing).

If the alternator is at risk from varying load, include adequate protection into the generator set system by under-excitation protection.

## 7.13 Synchronization

#### 🔥 WARNING

#### Exposure to Ejected Debris and Particles

Ejected debris and particles can cause serious injury or death by impact, severing or puncturing. Exposure to mechanically driven release of debris and particles exists in all directions (horizontally and vertically) in the areas surrounding the alternator air outlet(s), air inlets(s) and the open shaft end (also commonly known as the Drive End (DE)). To prevent injury or death:

- Keep away from the air inlet(s) and air outlet(s) when the alternator is operating.
- Do not position operator controls near the air inlet(s) or air outlet(s).
- Do not cause overheating by running the alternator outside rating plate parameters.
- Do not overload the alternator.
- Do not operate an alternator displaying excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

### 7.13.1 Parallel or Synchronizing Alternators

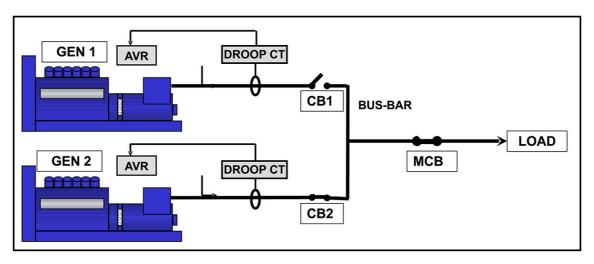


FIGURE 23. PARALLEL OR SYNCHRONIZING ALTERNATORS

The quadrature droop current transformer (Droop CT) gives a signal proportional to reactive current. The AVR adjusts excitation to reduce circulating current and allow each alternator to share reactive load. A factory-fitted droop CT is pre-set for 5% voltage drop at full-load zero power factor. Refer to the supplied AVR manual for droop adjustment.

- The synchronizing switch/breaker (CB1, CB2) must be of a type that will not cause "contact bounce" when it operates.
- The synchronizing switch/breaker must be adequately rated to withstand the continuous full load current of the alternator.
- The switch/breaker must be able to withstand the rigorous closing cycles during synchronizing and the currents produced if the alternator is paralleled out of synchronization.
- The closing time of the synchronizing switch/breaker must be under the control of the synchronizer settings.
- The switch/breaker must be capable of operation under fault conditions such as short circuits. Alternator data sheets are available.

#### NOTICE

# The fault level may include a contribution from other alternators as well as from the grid/mains utility.

The method of synchronizing should be either automatic, or by check synchronizing. The use of manual synchronizing is not recommended. The settings on the synchronizing equipment should be such that the alternator will close smoothly. For the synchronizing equipment to achieve this, the phase sequence must match the parameters in the table below.

#### TABLE 10. SYNCHRONIZING EQUIPMENT PARAMETERS

Voltage Difference	+/- 0.5%
Frequency Difference	0.1 Hz/sec
Phase Angle	+/- 10°
C/B Closing Time	50 ms

The voltage difference when paralleling with the grid/mains utility is +/- 3%.

# 8 Service and Maintenance

## 8.1 Recommended Service Schedule

Refer to: Safety Precautions in Chapter 2 on page 3 before starting any service and maintenance activity.

Refer to: Parts Identification in Chapter 9 on page 69 for an exploded view of components and fastener information.

The recommended service schedule shows the recommended service activities in table rows, grouped by alternator subsystem. Columns of the table show the types of service activity, whether the alternator must be running, and the service levels. Service frequency is given in running hours or time interval, whichever is sooner. A cross (X) in the cells where a row intersects the columns shows a service activity type and when it is required. An asterisk (\*) shows a service activity done only when necessary.

All service levels in the recommended service schedule can be purchased directly from STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u>.

- 1. Proper service and repair are vital to the reliable operation of your alternator and the safety of anyone coming into contact with the alternator.
- 2. These service activities are intended to maximize the life of the alternator but shall not vary, extend or change the terms of the manufacturer's standard warranty or your obligations in that warranty.
- 3. Each service interval is a guide only, and developed on the basis that the alternator was installed and is operated in accordance with the manufacturer's guidelines. If the alternator is located and/or operated in adverse or unusual environmental conditions, the service intervals may need to be more frequent. The alternator should be continually monitored between services to identify any potential failure modes, signs of misuse, or excessive wear and tear.

	SERVICE ACTIVITY			ТҮ	ΈE			SERVICE LEVEL							
System	X = required * = if necessary	Alternator running	Inspect	Test	Clean	Replace	Commission	Post Commission	250 hrs / 0.5 year	Level 1	1000 hrs / 1 year	Level 2	10,000 hrs / 2 years	Level 3	30,000 hrs / 5 years
	Alternator rating		Х				х								
	Bedplate arrangement		Х				Х								
	Coupling arrangement		Х				Х						*		x
	Environmental conditions and cleanliness		х				x	2	ĸ	2	x	2	ĸ	2	x
2	Ambient temperature (inside & outside)			х			x	2	x	2	x		x	2	x
Alternator	Complete machine - damage, loose parts & earth bonds		x				x	2	x	2	x	2	x	2	x
	Guards, screens, warning and safety labels		x				x	2	x	2	x		x	2	x
	Maintenance access		Х				х								
	Electrical nominal operating conditions & excitation	x		x			x	2	x	2	x	2	x	2	x
	Vibration*	Х		Х			Х	2	x	2	x		x		x
	Condition of windings		Х				Х		x	2	X		x		x
sɓu	Insulation resistance of all windings (PI test for MV/HV)			x			x		*		*		x	2	x
Windin	Insulation resistance of rotor, exciter and PMG			х					x		x				
	Temperature sensors	Х		Х			х		x		x	2	x		x
	Customer settings for temperature sensors		x				x								

#### TABLE 11. ALTERNATOR SERVICE SCHEDULE

	SERVICE ACTIVITY			ТҮ	PE					SERV		EVEL			
System	X = required * = if necessary	Alternator running	Inspect	Test	Clean	Replace	Commission	Post Commission	250 hrs / 0.5 year	Level 1	1000 hrs / 1 year	Level 2	10,000 hrs / 2 years	Level 3	30,000 hrs / 5 years
	Condition of bearings		Х				Х								x
	Grease exhaust & trap				х			2	x	2	ĸ	)	(		x
<u>s</u>	Grease in re-greasable bearing(s)	x				x		ev	very 4	000 to	o 450	0 hou	rs / 6	mont	hs
Bearings	Sealed bearing(s)		Х						e	very 4	<b>000</b> t	o 450	0 hou	rs	
Bea	Re-greasable & sealed bearing(s)					x						:	*	2	x
	Temperature sensors	х		Х			Х	2	x	)	K	)	(	2	x
	Customer settings for temperature sensors		х				х								
Terminal Box	All alternator/customer connections and cabling		x				x	2	x	2	ĸ	)	¢	2	x
	Initial AVR & PFC set up	Х		Х			Х								
ries	AVR & PFC settings	х		Х				2	x	2	ĸ	)	κ	2	x
Auxiliaries	Customer connection of auxiliaries			х			х			2	ĸ	)	ĸ	2	x
کہ ک	Function of auxiliaries			Х			Х		x	)	K	)	(		x
Control	Synchronization settings		Х				Х								
Ŝ	Synchronization	Х		Х			Х		x	)	K	)	(		x
	Anti condensation heater					Х							*		x
ifier	Diodes and varistors		Х				Х		x	)	K	)	(		
Rectifier	Diodes and varistors					х								2	x
	Air inlet temperature	х		Х			Х		x	)	ĸ	)	(		x
D	Air flow (rate & direction)	х	Х				Х								
Cooling	Condition of fan		Х				Х	2	x	)	ĸ	)	(	2	x
ပိ	Condition of air filter (where fitted)			х			х	;	x	)	ĸ	)	(	;	x
	Air filters (where fitted)				x	x					*		*		*
* For	stand-alone alternator only.														

-

# 8.2 Bearings

## 8.2.1 Introduction

NOTICE

Do not overfill a bearing with grease, the bearing can be damaged.

Do not mix lubricant types.

Change gloves to handle different lubricant

Assemble bearings in static and dust-free conditions, wearing lint free gloves.

To prevent damage or contamination, store removed parts and tools in static and dust-free conditions.

Do not reuse bearings. Bearings are damaged by the axial force needed to remove it from the rotor shaft.

Do not press fit bearing. Bearings are damaged if the insertion force is applied through the bearing balls.

Do not try to turn the rotor by levering against the cooling fan vanes. The fan will be damaged.

The alternator rotor is supported by a bearing at the non-drive end (NDE) and by either a bearing or a coupling to the prime mover at the drive end (DE).

- Lubricate each re-greasable bearing as specified by the recommended service schedule. Use the correct quantity and type of grease, shown on a label fitted at the grease nipple.
- Inspect each sealed bearing as specified by the recommended service schedule. Speak to STAMFORD<sup>®</sup> or AvK<sup>®</sup> customer services <u>www.stamford-avk.com</u> if grease has leaked out of the bearing, notifying the bearing type and quantity leaked.

### 8.2.2 Safety

#### DANGER

**Rotating Mechanical Parts** 

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping. To prevent injury:

- Before operating the alternator: The rotating coupling between the alternator and prime mover must be covered by a guard or cover.
- Before attempting service or maintenance tasks or removing covers from rotating parts: Shut down and isolate the generator set from all energy sources, isolate stored energy and use lock out/tag out safety procedures.

#### 

#### Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

#### **∧** WARNING

Exposure to Ejected Debris and Particles

*Ejected debris and particles can cause serious injury or death by impact, severing or puncturing. Exposure to mechanically driven release of debris and particles exists in all directions (horizontally and vertically) in the areas surrounding the alternator air outlet(s), air inlets(s) and the open shaft end (also commonly known as the Drive End (DE)). To prevent injury or death:* 

- Keep away from the air inlet(s) and air outlet(s) when the alternator is operating.
- Do not position operator controls near the air inlet(s) or air outlet(s).
- Do not cause overheating by running the alternator outside rating plate parameters.
- Do not overload the alternator.
- Do not operate an alternator displaying excessive vibration.
- Do not synchronize parallel alternators outside the specified parameters.

#### 

#### Hazardous Substances

Hazardous substances can cause minor or moderate injury. Prolonged or repetitive exposure to hazardous substances can cause serious medical conditions. To prevent injury:

- Always read and obey the instructions provided by the product manufacturer.
- Use, handle and store substances as specified by the product manufacturer.
- Always wear appropriate personal protective equipment, refer to Safety Precautions Chapter.

## 8.2.3 Re-Grease Bearings

### 8.2.3.1 Requirements

Requirement	Description
Personal Protective Equipment (PPE)	<ul> <li>Wear appropriate protective equipment as directed by site rules and risk assessment requirements.</li> </ul>
Consumables	Lint-free cleaning cloths
	<ul> <li>Thin disposable gloves</li> </ul>
Parts	CGT recommended grease
Tools	Grease gun (calibrated for volume or mass)

### 8.2.3.2 Re-grease Method

#### TABLE 13. RE-GREASING: GREASE QUANTITY

	Quantity of recommended gre					
Bearing Type	Volume (cm³)	Mass (g)				
Drive End (A7 Core length C to F)	93	89				
Drive End (A7 Core length G to K)	126	121				
Non-drive End (A7 Core length C to J)	78	75				
Non-drive End (A7 K Core)	157	151				

- 1. For each bearing, identify grease nipple, re-greasing label and bearing type.
- 2. Make sure the new grease is not contaminated. It must be a uniform whitish-beige color of stiff consistency throughout.
- 3. Clean the grease gun nozzle and grease nipple.
- 4. Clean the grease exhaust.
- 5. Fit the grease gun to the grease nipple and add the correct quantity of grease.
- 6. Run the alternator for at least 60 minutes, off- or on-load.
- 7. Clean the grease exhaust.
- 8. Inspect the color and consistency of grease expelled from the exhaust and compare with new grease whitish-beige of stiff consistency.
- 9. Replace the bearing if the expelled grease is severely discolored or absent.

## 8.3 Controls

### 8.3.1 Introduction

An operating alternator is a harsh environment for control components. Heat and vibration can cause electrical connections to loosen and cables to fail. Routine inspection and test can identify an issue before it becomes a failure that incurs unplanned downtime.

## 8.3.2 Safety

#### 

#### Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### <u> WARNING</u>

#### Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

#### **▲ WARNING**

Incorrect Electrical Installation and System Protection

Incorrect electrical installation and / or system protection can cause serious injury or death by electric shock and burns. To prevent injury or death and before starting work, personnel:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s).
- Know related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

## 8.3.3 Connection Test Requirements

TABLE 14.	CONNECTION TEST REQUIREMENTS
-----------	------------------------------

Requirements	Description
Personal Protective Equipment (PPE)	<ul> <li>Wear appropriate protective equipment as directed by site rules and risk assessment requirements.</li> </ul>
Consumables	None
Parts	None
Tools	Insulation test meter
	Multimeter
	Torque wrench

### 8.3.4 Inspect and Test

- 1. Remove the terminal box lid.
- 2. Check the tightness of fasteners securing the load cables.
- 3. Check that cables are firmly clamped at the terminal box gland, and allow ±25 mm movement by an alternator on anti-vibration mounts.
- 4. Check that all cables are anchored and unstressed within the terminal box.
- 5. Check all cables for signs of damage.
- 6. Check that AVR accessories and current transformers are correctly fitted, and cables pass centrally through current transformers (if fitted).
- 7. If an anti-condensation heater is fitted:
  - a. Isolate the supply and measure the electrical resistance of the heater element(s). Replace the heater element if open circuit.
  - b. Connect together both ends of the heater leads.
  - c. Apply the test voltage between the winding and earth.
  - d. Measure the insulation resistance after 1 minute (IR 1min).
  - e. Discharge the test voltage.
  - f. If the measured insulation resistance is less than the minimum acceptable level, replace the heater element. Refer to: **Table 15 on page 55** for values.
- Test the supply voltage to the anti-condensation heater at the heater connection box. 120 VAC or 240 VAC. (depending on cartridge option and shown on a label) should be present when the alternator is stopped.
- 9. Check that the AVR and AVR accessories fitted in the terminal box are clean, securely fitted on anti-vibration mounts, and the cable connectors are firmly attached to the terminals.
- 10. For parallel operation, check that the synchronization control cables are securely connected.
- 11. Refit and secure the terminal box lid.

# TABLE 15. TEST VOLTAGE AND MINIMUM ACCEPTABLE INSULATION RESISTANCE FOR NEW AND IN-SERVICE ANTI-CONDENSATION HEATERS

Component	Test Voltage (V)	Minimum Insulation Resistance at 1 minute (ΜΩ)					
		New	In-service				
Anti-condensation heater	500	10	1				

## 8.4 Cooling System

### 8.4.1 Introduction

NOTICE

The values below are cumulative dependent on environmental conditions. Efficient cooling depends on maintaining the condition of the cooling fan, air filters and gaskets.

The alternators are designed to meet standards supporting EU Directives and UK Statutory Instruments, and are rated for the effect of operating temperature on winding insulation.

**BS EN 60085 (= IEC 60085) Electrical insulation – Thermal Evaluation and Designation** classifies insulation by the maximum operating temperature for a reasonable service life. Although chemical contamination and electrical and mechanical stresses also contribute, temperature is the dominant aging factor. Fan cooling maintains a stable operating temperature below the insulation class limit.

If the operating environment differs from the values shown on the rating plate, rated output must be reduced by

- 3% for class H Insulation for every 5 °C that the temperature of the ambient air entering the cooling fan exceeds 40 °C, up to a maximum of 60 °C.
- 3% for every 500 m increase in altitude above 1000 m, up to 4000 m, due to the reduced thermal capacity of lower density air, and
- 5% if air filters are fitted, due to restricted air flow.

### 8.4.2 Safety

<u> A</u> DANGER

#### **Rotating Mechanical Parts**

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping. To prevent injury:

- Before operating the alternator: The rotating coupling between the alternator and prime mover must be covered by a guard or cover.
- Before attempting service or maintenance tasks or removing covers from rotating parts: Shut down and isolate the generator set from all energy sources, isolate stored energy and use lock out/tag out safety procedures.

#### \Lambda WARNING

#### Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

#### 

Dust & Airborne Particles/Fumes

Dust and other airborne particles and fumes can cause minor or moderate injury by irritating the lungs and eyes. Prolonged or repetitive exposure can cause serious medical conditions. To prevent injury:

- Use mechanical vacuum extraction to remove dust and airborne particles or fumes.
- Ventilate the area fully.
- Always wear the appropriate personal protective equipment. Refer to Safety Precautions Chapter.

#### NOTICE

Do not attempt to rotate the alternator rotor by levering against the vanes of the cooling fan. The fan is not designed to withstand such forces and will be damaged.

#### NOTICE

Filters are designed to remove dust, not moisture. Wet filter elements can cause reduced air flow and overheating. Do not allow filter elements to get wet.

## 8.4.3 Cooling System Test Requirements

#### TABLE 16. COOLING SYSTEM TEST REQUIREMENTS

Requirements	Description
Personal Protective Equipment (PPE)	<ul> <li>Wear appropriate protective equipment as directed by site rules and risk assessment requirements.</li> </ul>
Consumables	<ul><li>Lint-free cleaning cloths</li><li>Thin disposable gloves</li></ul>
Parts	<ul><li>Air filters (if fitted)</li><li>Air filter sealing gaskets (if fitted)</li></ul>
Tools	None

### 8.4.4 Inspect and Clean

NOTICE

#### Do not apply oil to the filter.

- 1. Inspect the fan for damaged vanes and cracks.
- 2. If air filters are fitted:
  - a. Remove air filters at the terminal box from their frames.
  - b. Wash and dry the air filters and gaskets to remove contaminant particles.
  - c. Inspect the filters and gaskets for damage and replace, as necessary.
  - d. Install the filters and gaskets.
- 3. Reinstate the generator set for running.
- 4. Make sure the air inlets and outlets are not blocked.

## 8.5 Coupling

### 8.5.1 Introduction

Efficient operation and long component life rely on minimizing mechanical stresses on the alternator. When coupled in a generator set, misalignment and vibration interactions with the prime mover engine can cause mechanical stress.

The rotational axes of alternator rotor and engine output shaft must be coaxial (radial and angular alignment).

Torsional vibration can cause damage to internal combustion engine shaft-driven systems, if not controlled. The generator set manufacturer is responsible for assessing the effect of torsional vibration on the alternator: Rotor dimensions and inertia, and coupling details are available on request.

### 8.5.2 Safety

NOTICE

Do not attempt to rotate the alternator rotor by levering against the vanes of the cooling fan. The fan is not designed to withstand such forces and will be damaged.

#### 🕂 WARNING

Coupling an Alternator

Moving mechanical parts during coupling can cause serious injury by crushing, severing or trapping. When coupling the alternator to a prime-mover or when installing large components, to prevent injury:

• Personnel must keep limbs and body parts away from coupling surfaces during coupling and/or installing operations.

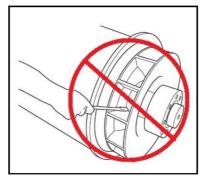


FIGURE 24. DO NOT ROTATE THE ALTERNATOR ROTOR WITH A LEVER

## 8.5.3 Coupling Test Requirements

TABLE 17.	COUPLING TEST REQUIREMENTS

Requirements	Description			
Personal Protective Equipment (PPE)	Wear appropriate protective equipment as directed by site rules and risk assessment requirements.			
Consumables	None			
Parts	None			
Tools	<ul><li>Dial gauge</li><li>Torque wrench</li></ul>			

## 8.5.4 Inspect Mounting Points

- 1. Check the generator set bedplate and mounting pads are in good condition, not cracked.
- 2. Check that rubber in anti-vibration mounts has not perished.
- 3. Check vibration monitoring historical records for a trend of increasing vibration.

### 8.5.4.1 One Bearing Coupling

- 1. Remove the DE adaptor screen and cover to access the coupling.
- 2. Check that the coupling discs are not damaged, cracked or distorted, and the coupling disc holes are not elongated. If any are damaged, replace the complete set of discs.
- 3. Check tightness of bolts fixing the coupling discs to the engine flywheel. Tighten in the sequence shown for alternator coupling in the Installation chapter, to the torque recommended by the engine manufacturer.
- 4. Replace the DE adaptor screen and drip proof cover.

### 8.6.1 Introduction

The rectifier converts alternating current (AC) induced in the exciter rotor windings into direct current (DC) to magnetize the main rotor poles. The rectifier comprises two semi-circular annular positive and negative plates, each with three diodes. In addition to connecting to the main rotor, the DC output of the rectifier also connects to a matched pair of varistors (one at each end of the plates). These additional components protect the rectifier from voltage spikes and surge voltages that may be present on the rotor under various loading conditions of the alternator.

Diodes provide a low resistance to current in one direction only: Positive current will flow from anode to cathode, or another way of viewing it is that negative current will flow from cathode to anode.

The exciter rotor windings are connected to 3 diode anodes to form the positive plate and to 3 diode cathodes to form the negative plate to give full wave rectification from AC to DC. The rectifier is mounted on, and rotates with, the exciter rotor at the non-drive end (NDE).

### 8.6.2 Safety

#### 

#### Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### 

#### **Rotating Mechanical Parts**

Rotating mechanical parts can cause serious injury or death by crushing, severing or trapping. To prevent injury:

- Before operating the alternator: The rotating coupling between the alternator and prime mover must be covered by a guard or cover.
- Before attempting service or maintenance tasks or removing covers from rotating parts: Shut down and isolate the generator set from all energy sources, isolate stored energy and use lock out/tag out safety procedures.

#### **∧** WARNING

Incorrect Electrical Installation and System Protection

Incorrect electrical installation and / or system protection can cause serious injury or death by electric shock and burns. To prevent injury or death and before starting work, personnel:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s).
- Know related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

### 8.6.3 Requirements

#### TABLE 18. RECTIFIER SYSTEM: TEST AND REPLACE COMPONENT REQUIREMENTS

Requirement	Description				
Personal Protective Equipment (PPE)	<ul> <li>Wear appropriate protective equipment as directed by site rules and risk assessment requirements.</li> </ul>				
Consumables	Dow Corning silicone heat sink compound type 340 or similar				
Parts	<ul> <li>Full set of three anode lead diodes and three cathode lead diodes (all from the same manufacturer)</li> </ul>				
	<ul> <li>Two metal-oxide varistors (same type, same manufacturer, same voltage grading: A, B, C, D, E, F)</li> </ul>				
Tools	Multimeter				
	Insulation tester				
	Torque wrench				

### 8.6.4 Test and Replace Varistors

- 1. Inspect both varistors.
- 2. Record varistor as faulty if there are signs of overheating (discoloration, blisters, melting) or disintegration. Check for loose connectors vs. varistor body.
- 3. Disconnect the varistor leads.
- A serviceable varistor will read open circuit in both directions using a multimeter (set in the Ohms (Ω) range). A faulty varistor can read short circuit in both directions and/or it may be physically damaged.
- 5. If either varistor is faulty, replace both varistors with a matched pair (same type, same manufacturer and same voltage grading: A, B, C, D, E, F) and replace all diodes.
- 6. Reconnect and check that all leads are secure, washers fitted and fasteners tight.

### 8.6.5 Test and Replace Diodes

NOTICE

Do not tighten a diode above the stated torque. The diode will be damaged.

- 1. Disconnect the lead of one diode where it joins the windings at the insulated terminal post. Store fastener and washers.
- 2. Measure the voltage drop across the diode in the forward direction, using the diode test function of a multimeter.
- 3. Measure the resistance across the diode in the reverse direction, using the 1000 VDC test voltage of an insulation tester.
- 4. Diode is faulty if the voltage drop in the forward direction is outside the range 0.3–0.9 VDC, or the resistance is below 20 M $\Omega$  in the reverse direction.
- 5. Repeat the tests for the five remaining diodes.
- 6. If any diode is faulty, replace the full set of six diodes (same type, same manufacturer):
  - a. Remove diode(s).
  - b. Apply a small amount of heat sink compound **only** to the base of the replacement diode(s), not the threads.

- c. Check polarity of diode(s).
- d. Screw each replacement diode into a threaded hole in the rectifier plate.
- e. Apply 2.6–3.1 Nm (23–27.4 in-lb) torque to give good mechanical, electrical and thermal contact.
- f. Replace both varistors with a matched pair (same type, same manufacturer and same voltage grading: A, B, C, D, E, F)
- 7. Reconnect and check that all leads are secure, washers fitted and fasteners tight.

## 8.7 Temperature Sensors

### 8.7.1 Introduction

The alternators are designed to meet standards supporting EU Safety Directives, and recommended operating temperatures. Temperature sensors (where fitted) detect abnormal overheating of the main stator windings and bearing(s). Sensors are of two types: Resistance Temperature Detector (RTD) sensors, with three wires, and Positive Temperature Coefficient (PTC) thermistors, with two wires, which are connected to a terminal block in the auxiliary or main terminal box. The resistance of Platinum (PT100) RTD sensors increases linearly with temperature.

Temperature (°C)		+1 °C	+2 °C	+3 °C	+4 °C	+5 °C	+6 °C	+7 °C	+8 °C	+9 °C
40.00	115.54	115.93	116.31	116.70	117.08	117.47	117.86	118.24	118.63	119.01
50.00	119.40	119.78	120.17	120.55	120.94	121.32	121.71	122.09	122.47	122.86
60.00	123.24	123.63	124.01	124.39	124.78	125.16	125.54	125.93	126.31	126.69
70.00	127.08	127.46	127.84	128.22	128.61	128.99	129.37	129.75	130.13	130.52
80.00	130.90	131.28	131.66	132.04	132.42	132.80	133.18	133.57	133.95	134.33
90.00	134.71	135.09	135.47	135.85	136.23	136.61	136.99	137.37	137.75	138.13
100.00	138.51	138.88	139.26	139.64	140.02	140.40	140.78	141.16	141.54	141.91
110.00	142.29	142.67	143.05	143.43	143.80	144.18	144.56	144.94	145.31	145.69
120.00	146.07	146.44	146.82	147.20	147.57	147.95	148.33	148.70	149.08	149.46
130.00	149.83	150.21	150.58	150.96	151.33	151.71	152.08	152.46	152.83	153.21
140.00	153.58	153.96	154.33	154.71	155.08	155.46	155.83	156.20	156.58	156.95
150.00	157.33	157.70	158.07	158.45	158.82	159.19	159.56	159.94	160.31	160.68
160.00	161.05	161.43	161.80	162.17	162.54	162.91	163.29	163.66	164.03	164.40
170.00	164.77	165.14	165.51	165.89	166.26	166.63	167.00	167.37	167.74	168.11
180.00	168.48									

TABLE 19. RESISTANCE (Ω) OF PT100 SENSOR BETWEEN 40 TO 180 °C

PTC thermistors are characterized by a sudden increase in resistance at a reference "switching" temperature. Customer-supplied external equipment may be connected to monitor the sensors and generate signals to raise an alarm and shutdown the generator set.

**BS EN 60085 (≡ IEC 60085) Electrical insulation – Thermal Evaluation and Designation** classifies insulation of windings by the maximum operating temperature for a reasonable service life. To avoid damage to windings, signals should be set, appropriate to the insulation class shown on the alternator rating plate.

Windings Insulation	Max. Continuous Temperature (°C)	Alarm Temperature (°C)	Shutdown Temperature (°C)
Class B	130	120	140
Class F	155	145	165
Class H	180	170	190

TABLE 20. ALARM AND SHUTDOWN TEMPERATURE SETTINGS FOR WINDINGS

To detect overheating of bearings, control signals should be set according to the following table.

TABLE 21. ALARM AND SHUTDOWN TEMPERATURE SETTINGS FOR BEARINGS

Bearings	Alarm Temperature (°C)	Shutdown Temperature (°C)	
Drive End Bearing	45 + maximum ambient	50 + maximum ambient	
Non-drive End Bearing	40 + maximum ambient	45 + maximum ambient	

### 8.7.2 Safety

#### ▲ DANGER

Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### <u> WARNING</u>

#### Hot Surfaces and Fire

Contact with hot surfaces can cause serious injury and death by burns. A risk of fire exists where hot surfaces are contacted by combustible items. To prevent injury, death or risk of fire:

- Avoid contact with hot surfaces.
- Always wear the appropriate personal protection equipment, refer to: Safety Precaution Chapter.
- Make sure combustible materials or flammable substances are not stored close to or contact the anti-condensation heater (if fitted).
- Make sure combustible materials or flammable substances are not stored close to the alternator or prime mover, including the ventilation and exhaust system(s) where applicable.

## 8.7.3 Test RTD Temperature Sensors

- 1. Remove the terminal box lid.
- 2. Identify the sensor leads at the terminal block and where each sensor is fitted
- 3. Measure the resistance between the white and each red wire of one sensor
- 4. Calculate the sensor temperature from the measured resistance

- 5. Compare calculated temperature with temperature indicated by external monitoring equipment (if available)
- 6. Compare alarm and shutdown signal settings (if available) with recommended settings
- 7. Repeat steps 3 to 7 for each sensor
- 8. Refit the terminal box lid.
- 9. Contact Cummins Customer Service Help Desk to replace faulty sensors.

### 8.7.4 Test PTC Temperature Sensors

- 1. Remove the auxiliary terminal box lid.
- 2. Identify the sensor leads at the terminal block and where each sensor is fitted.
- 3. Measure the resistance between the two wires.
- 4. Sensor is faulty if resistance shows open circuit (infinity  $\Omega$ ) or short circuit (zero  $\Omega$ ).
- 5. Repeat steps 3 to 5 for each sensor.
- 6. Stop the alternator and inspect the change in resistance as the stator winding cools.
- 7. Sensor is faulty if resistance does not change or change is not smooth.
- 8. Repeat steps 6 and 7 for each sensor.
- 9. Refit the auxiliary terminal box lid.

## 8.8 Windings

### 8.8.1 Introduction

#### NOTICE

Disconnect all control wiring and customer load leads from alternator winding connections before conducting these tests.

#### NOTICE

The Automatic Voltage Regulator (AVR) contains electronic components which would be damaged by high voltage applied during insulation resistance tests. The AVR must be disconnected before doing any insulation resistance test. Temperature sensors must be grounded to earth before doing any insulation resistance test.

Damp or dirty windings have a lower electrical resistance and could be damaged by insulation resistance tests at high voltage. If in doubt, test the resistance at low voltage (500 V) first.

Alternator performance depends on good electrical insulation of the windings. Electrical, mechanical and thermal stresses, and chemical and environmental contamination, cause the insulation to degrade. Various diagnostic tests indicate the condition of insulation by charging or discharging a test voltage on isolated windings, measuring current flow, and calculating the electrical resistance by Ohm's law.

When a DC test voltage is first applied, three currents can flow:

- Capacitive Current: To charge the winding to the test voltage (decays to zero in seconds),
- **Polarizing Current:** To align the insulation molecules to the applied electric field (decays to near-zero in ten minutes), and
- Leakage Current: Discharge to earth where the insulation resistance is lowered by moisture and contamination (increases to a constant in seconds).

For an insulation resistance test, a single measurement is made one minute after a DC test voltage is applied, when capacitive current has ended. For the polarization index test, a second measurement is made after ten minutes. An acceptable result is where the second insulation resistance measurement is at least double the first, because the polarization current has decayed. In poor insulation, where leakage current dominates, the two values are similar. A dedicated Insulation Tester takes accurate, reliable measurements and may automate some tests.

## 8.8.2 Safety

#### ▲ DANGER

#### Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before working on live conductors:

- Shut down and isolate the alternator from all energy sources.
- Remove or isolate stored energy.
- Test isolated parts for electrical isolation using a suitable voltage tester.
- Use lock out/tag out safety procedures.

#### 

#### Testing Live Electrical Conductors

Live electrical conductors can cause serious injury or death by electric shock and burns. To prevent injury and before testing on or near live electrical conductors:

- Take applicable precautions to prevent contact with live conductors, refer to: Safety Precautions Chapter.
- Test on or near live conductors, only if absolutely necessary.
- Only trained personnel may test on or near live electrical conductors.
- Do not test on or near live electrical conductors alone: Another competent person must be present, trained to isolate energy sources and take action in an emergency.

#### 

#### **Condensed Water**

Operating an alternator with condensed water in the windings can cause serious injury by electric shock, burns or exposure to flying debris and particles. To prevent injury and before operating the alternator:

- Use anti-condensation heaters (if fitted) to prevent condensation accumulating.
- Check for condensed water.
- If condensed water is present, drain/remove the water, dry and inspect the alternator, refer to: Maintenance and Servicing Chapter.

#### **∧** WARNING

Exposure to Particles and Fumes from an Alternator.

Particles and fumes can be released in all directions (horizontally and vertically) from where alternator ventilation is installed. To avoid or injury:

- Avoid the areas around ventilation openings, air intake(s) and air outlet(s) when the alternator is operating.
- Use the correct personal protective equipment when working around an alternator.

**∧** WARNING

Live Electrical Conductors

Live electrical conductors at the winding terminals can cause serious injury or death by electric shock or burns. After an insulation resistance test, to prevent injury or death:

- Discharge the windings immediately after the test has concluded by shorting to a suitable earth. The windings must discharge for the greater of:
  - 1. A length of time equal to the duration of the test.
  - 2. 5 minutes.

or

#### 🕂 WARNING

Incorrect Electrical Installation and System Protection

Incorrect electrical installation and / or system protection can cause serious injury or death by electric shock and burns. To prevent injury or death and before starting work, personnel:

- Have completed related, applicable and approved training.
- Know the equipment, understand the task(s) and procedure(s).
- Know related hazards / risks.
- Know and obey site / location specific emergency procedures and applicable laws and regulations.

### 8.8.3 Requirements

TABLE 22. V	WINDING TEST REQUIREMENTS
-------------	---------------------------

Requirement	Description			
Personal Protective Equipment (PPE)	• Wear appropriate protective equipment as directed by site rules and risk assessment requirements.			
Consumables	None			
Parts	None			
Tools	<ul> <li>Insulation test meter</li> <li>Multimeter</li> <li>Milliohm meter or micro ohmmeter</li> <li>Clamp ammeter</li> <li>Infrared thermometer</li> </ul>			
	Earth rod			

### 8.8.4 Test the Electrical Resistance of Windings

- 1. Stop the alternator.
- 2. Verify the electrical resistance of the exciter field (stator) winding:
  - a. Disconnect the exciter field leads F1 and F2 from the AVR.
  - b. Measure and record the electrical resistance between F1 and F2 leads with a multimeter.
  - c. Reconnect the exciter field leads F1 and F2.

- d. Make sure the fasteners are secure.
- 3. Verify the electrical resistance of the exciter armature (rotor) winding:
  - a. Mark the leads attached to diodes on one of the two rectifier plates.
  - b. Disconnect all exciter rotor leads from all diodes at the rectifier.
  - c. Measure and record the electrical resistance between pairs of marked leads (between phase windings). A specialist micro ohmmeter must be used.
  - d. Reconnect all exciter rotor leads to the diodes.
  - e. Make sure the fasteners are secure.
- 4. Verify the electrical resistance of the main field (rotor) winding:
  - a. Disconnect the two main rotor DC leads from the rectifier plates.
  - b. Measure and record the electrical resistance between the main rotor leads. A specialist micro ohmmeter must be used.
  - c. Reconnect the two main rotor DC leads to the rectifier plates.
  - d. Make sure the fasteners are secure.
- 5. Verify the electrical resistance of the main armature (stator) winding:
  - a. Disconnect the leads of the main stator from the output terminals.
  - b. Measure and record the electrical resistance between U1 and U2 leads and between U5 and U6 (if present). A specialist micro ohmmeter must be used.
  - c. Measure and record the electrical resistance between V1 and V2 leads and between V5 and V6 (if present). A specialist micro ohmmeter must be used.
  - d. Measure and record the electrical resistance between W1 and W2 leads and between W5 and W6 (if present). A specialist micro ohmmeter must be used.
  - e. Reconnect the leads to the output terminals, as before.
  - f. Make sure the fasteners are secure.
- 6. Verify the electrical resistance of the PMG armature (stator) winding:
  - a. Disconnect the three PMG output leads P2, P3 and P4 from the AVR.
  - b. Measure and record the electrical resistance between pairs of the PMG output leads, with a multimeter.
  - c. Reconnect the three PMG output leads P2, P3 and P4 to the AVR.
  - d. Make sure the fasteners are secure.
- 7. Refer to the winding resistance table in: <u>Chapter 10 on page 73</u> to verify the measured resistances of all windings agree with the reference values.

## 8.8.5 Test the Insulation Resistance of Windings

#### NOTICE

The alternator must not be put into service until the minimum insulation resistance is achieved.

# TABLE 23. TEST VOLTAGE AND MINIMUM ACCEPTABLE INSULATION RESISTANCE FOR<br/>NEW AND IN-SERVICE ALTERNATORS

Part	Test Voltage	Minimum Insulation Resistance at 1 Minute (MΩ)		
	(V)	New	In-Service	
Main Stator	500	10	5	
PMG Stator	500	5	3	
Exciter Stator	500	10	5	
Exciter Rotor, Rectifier & Main Rotor Combined	500	10	5	

- 1. Inspect the windings for mechanical damage or discoloration from overheating. Clean the insulation if there is hygroscopic dust and dirt contamination.
- 2. For main stators:
  - a. Disconnect the neutral to earth conductor (if fitted).
  - b. Connect together the three leads of all phase windings (if possible) or do the test at individual lead ends.
  - c. Apply the test voltage from the table between any phase lead and earth.
  - d. Measure the insulation resistance after 1 minute ( $IR_{tmin}$ ).
  - e. Discharge the test voltage with an earth rod for five minutes.
  - f. If the measured insulation resistance is less than the minimum acceptable value, dry the insulation, then repeat the method.
  - g. Reconnect neutral to earth conductor (if fitted).
- 3. For PMG and exciter stators, and combined exciter and main rotors:
  - a. Connect the ends of the winding together (if possible) or do the test at individual lead ends.
  - b. Apply the test voltage from the table between the winding and earth.
  - c. Measure the insulation resistance after 1 minute  $(IR_{1min})$ .
  - d. Discharge the test voltage with an earth rod for five minutes.
  - e. If the measured insulation resistance is less than the minimum acceptable value, dry the insulation, then repeat the method.
  - f. Repeat the method for each winding.
  - g. Remove the connections made for testing.

### 8.8.6 Dry the Insulation

Use the methods below to dry the insulation of the main stator windings. To prevent damage as water vapor is expelled from the insulation, make sure the winding temperature does not increase faster than 5 °C per hour or exceed 90 °C.

Plot the insulation resistance graph to show when drying is complete.

#### 8.8.6.1 Dry with Ambient Air

In many cases, the alternator can be dried sufficiently using its own cooling system. Disconnect the cables from the X+ (F1) and XX- (F2) terminals of the AVR so there is no excitation voltage supply to the exciter stator. Run the generator set in this de-excited state. Air must flow freely through the alternator to remove the moisture. Operate the anti-condensation heater (if fitted) to assist the drying effect of the air flow.

After drying is complete, re-connect the cables between the exciter stator and AVR. If the generator set is not put into service immediately, turn on the anti-condensation heater (if fitted) and retest the insulation resistance before use.

#### 8.8.6.2 Dry with Hot Air

Direct the hot air from one or two 1 to 3 kW electrical fan heaters into the alternator air inlet. Make sure each heat source at least 300 mm away from the windings to avoid scorching or over-heating damage to the insulation. Air must flow freely through the alternator to remove the moisture.

After drying, remove the fan heaters and re-commission as appropriate.

If the generator set is not put into service immediately, turn on the anti-condensation heaters (where fitted) and retest the insulation resistance before use.

### 8.8.6.3 Plot Insulation Resistance (IR) Graph

Whichever method is used to dry out the alternator, measure the insulation resistance and temperature (if sensors fitted) of the main stator windings every 15 to 30 minutes. Plot a graph of insulation resistance, IR (y axis) against time, t (x axis).

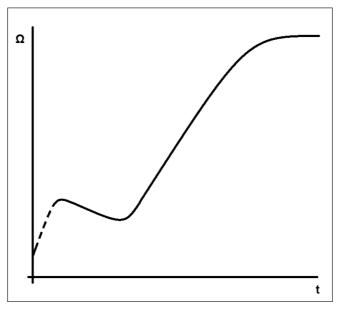


FIGURE 25. INSULATION RESISTANCE GRAPH

A typical curve shows an initial increase in resistance, a fall and then a gradual rise to a steady state. If the windings are only slightly damp the dotted portion of the curve may not appear. Continue drying for another hour after steady state is reached.

#### NOTICE

The alternator must not be put into service until the minimum insulation resistance is achieved.

## 9 Parts Identification

### 9.1 A7 Single Bearing Alternator

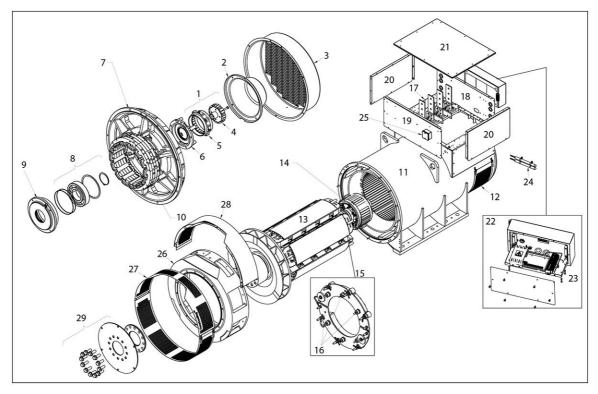


FIGURE 26. A7 SINGLE BEARING ALTERNATOR

#### 9.2 A7 Two Bearing Alternator

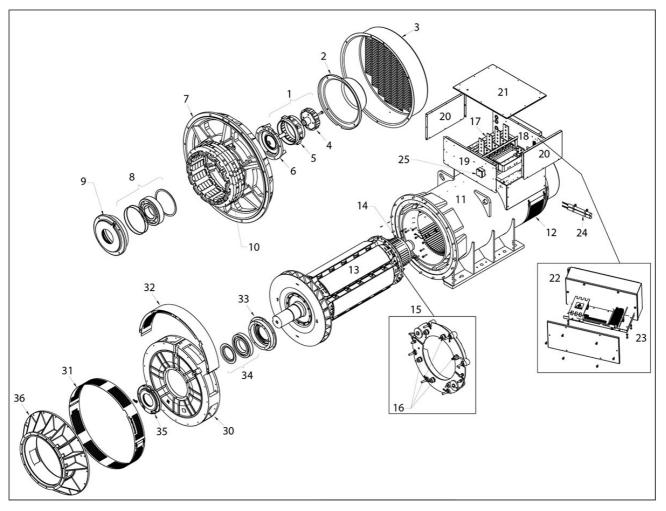


FIGURE 27. A7 TWO BEARING ALTERNATOR

### 9.3 A7 Parts and Fasteners

#### TABLE 24. A7 PARTS AND FASTENERS

Reference	Component	Fastener	Quantity	Torque (Nm)
1	Complete PMG parts	-	-	-
2	PMG Cover	M8 x 16	4	26
3	Air Inlet Cover	M8 x 16	6	26
4	PMG Rotor	M10 x 100	1	50
5	PMG Stator	M6 x 45	4	10
6	NDE Bearing Cap	M10 x 35 M10 x 75 (K core)	5 7 (K core)	50
7	NDE Bracket	M12 x 40	8	95
8	NDE Bearing	-	-	-

Reference	Component	Fastener	Quantity	Torque (Nm)	
9	NDE Bearing Cartridge	M10 x 60	4 6 (K core)	50	
10	Exciter Stator	M8 x 90 M8 x 120 (H & J cores) M8 x 160 (K core)	6	26	
11	Main Frame	-	-	-	
12	Lower Air Inlet Cover	Split Pin	4	-	
13	Main Rotor	-	-	-	
14	Exciter Rotor	-	-	-	
15	Rectifier Assembly	M6 x 100 M6 x 120 (H to K cores)	4	10	
16	Diode/Varistor	-	-	2.6 - 3.1	
17	Main Terminals	M12 x 40	12	40 - 50	
18	Terminal Box End Panel NDE	M6 x 16	10	10	
19	Terminal Box End Panel DE	M6 x 16	10	10	
20	Terminal Box Side Panel	M6 x 16	10	10	
21	Terminal Box Lid	M6 x 16	14	10	
22	AVR Auxiliary Box	M5 x 12	4	5	
23	AVR	M5 x 30	6	5	
24	Anti-condensation Heaters	M5 x 16	2	5	
25	Heater Terminal Box	M5 x 12 M5 x 16	1 1	5	
26	DE Adapter (1 bearing)	M12 x 50 M12 x 70 (foot web)	12 4	95	
27	DE Air Outlet Screen (1 bearing)	Split Pin	4	-	
28	Adaptor Top Cover - Marine (1 bearing)	Split Pin	4	-	
29	DE Coupling Hub and Coupling Discs (1 bearing)	M24 x 70 M30 x 90 (J & K cores)	30 x 90 (J		
30	DE Bracket (2 bearing)	M12 x 50 M12 x 70 (foot web)	12 4	95	
31	DE Air Outlet Screen (2 bearing)	Split Pin	4	-	
32	DE Bracket Top Cover - Marine (2 bearing)	Split Pin	4	-	
33	DE Bearing Cartridge (2 bearing)	M10 x 55	4	50	

Reference	Component	Fastener	Quantity	Torque (Nm)
34	Complete DE Bearing parts	-	-	-
35	DE Bearing Cap	M10 x 35	5	50
36	DE Adapter (2 bearing)	M12 x 45	16	95

# **10 Technical Data**

NOTICE

Compare measurements with the technical data sheet and the test certificate supplied with the alternator.

### 10.1 A7 Winding Resistances

	Resistance of windings at 22 °C (measured values should be within 10%)								10%)	
		(le		Stator d) (Ohm	s)		(sı	(Ohms)		(Ohms)
Alternator	312 U1-U2 V1-V2 W1- W2	07 U1-U2 V1-V2 W1- W2	13 U1-U2 V1-V2 W1- W2	19 U1-U2 V1-V2 W1- W2	26 U1-U2 V1-V2 W1- W2	28 U1-U2 V1-V2 W1- W2	Exciter Stator (Ohms)	Exciter Rotor, L-L (	Main Rotor (Ohms)	PMG Stator, L-L (O
A7L1D-D6	0.0017	n/a	n/a	n/a	0.0049	0.0038	20.2	0.14	2.546	4.11
A7L1D-H6	0.0009	n/a	n/a	n/a	0.0033	0.0021	20.7	0.1579	3.319	4.11
A7L1D-J6	0.0010	n/a	n/a	n/a	0.0035	0.0022	20.7	0.1579	3.390	4.11
A7L1D-K6	0.0008	n/a	n/a	n/a	0.0025	0.0017	20.7	0.1579	3.966	4.11

This page is intentionally blank.

# **11 Service Parts**

Servicing and repairing your alternator with genuine STAMFORD<sup>®</sup> or AvK<sup>®</sup> parts is critical to the life and reliability of the product. For further parts information and details of your nearest outlet visit www.stamford-avk.com.

#### 11.1 Parts Orders

When ordering parts the machine serial number or machine identity number and type should be quoted, together with the part description. The machine serial number can be found on the name plate or frame.

#### **11.2 Customer Service**

CGT service engineers are experienced professionals, trained extensively to deliver the best support possible. Our global service offers:

- On-site AC alternator commissioning
- On-site bearing maintenance & bearing condition monitoring
- On-site insulation integrity checks
- On-site AVR & accessories set-up

For details of your nearest service outlet visit www.stamford-avk.com.

#### **11.3 Recommended Service Parts**

In critical applications. If fitted, a set of these service spares should be held with the alternator.

Part	Number
Rectifier service kit	RSK-6001
(3 forward & 3 reverse diodes with varistors)	
Rotating rectifier assembly	760-11216
DM110 AVR	E000-23800
DECS-150 AVR	A060B914
Grease 400 gram tube	45-0281
PMG kit (A7 6P ball bearing only)	A075R686
PMG kit (A7 6P sleeve bearing only)	A067R585
A7 One Bearing Alternator	
Sealed NDE bearing kit (core length C to J)	45-0418
Regreasable NDE bearing kit (core length C to J)	45-0336
Regreasable NDE bearing kit (core length K)	45-0407
Regreasable NDE insulated ball bearing kit (A7 6P D/H/J core)	A076K457
Regreasable NDE insulated ball bearing kit (A7 6P K core)	A076K459

#### TABLE 26. A7 SERVICE PARTS

A7 Two Bearing Alternator					
Part	Number				
Regreasable DE bearing kit (core length C to F)	45-0335				
Regreasable DE bearing kit (core length G to J)	45-0425				
Regreasable NDE bearing kit (core length C to J)	45-0336				
Regreasable NDE bearing kit (core length K)	45-0407				
Regreasable NDE insulated ball bearing kit (A7 6P D/H/J core)	A076K457				
Regreasable NDE insulated ball bearing kit (A7 6P K core)	A076K459				

### 11.4 Klüber Asonic GHY72 Grease

- All bearings trials and calculated life expectancy are based on the use of Klüber Asonic GHY72.
- The GHY72 Grease is not included in the regreaseable bearing kits and will need to be ordered / supplied separately to the bearing kits.

# 12 End of Life Disposal

#### 12.1 General Guidance

When disposing of an alternator, component parts or packaging:

- When processing waste materials obey applicable rules and regulations.
- Process waste in an environmentally responsible manner, reuse, reclaim and/or recycle materials where applicable.
- If necessary, speak to a waste processing company for advice and/or guidance.

#### 12.2 Packaging Material

After the alternator, replacement components or service items have arrived, the packing material must be disposed of.

- Wooden packaging must be recycled. However, wood treated with preservative chemicals must be processed appropriately. **Do not burn chemically treated wood.**
- Plastic packaging must be recycled.
- · Paper and cardboard packaging must be recycled.
- Anti-corrosion agents can be removed using a cleaning agent and a cloth. The cloth must be disposed as contaminated waste, refer to <u>Section 12.4 on page 78</u>.
- Desiccants/drying agents must be disposed of as hazardous waste, refer to <u>Section 12.4 on</u> page 78

#### 12.3 Recyclable Material

Separate items containing recyclable base materials, such as: iron, copper and steel, by removing non-recyclable and/or hazardous materials from alternator components.

- Items containing: iron, steel and copper can now be recycled via specialized material recycling companies.
- Separate the removed material into hazardous waste and non-hazardous waste. Obey applicable rules and regulations.
  - Dispose of any contaminated and/or hazardous materials as hazardous waste, refer to: Section 12.4 on page 78.
  - Non-hazardous materials that cannot be reused, re-purposed or recycled can now be processed as general waste.

#### **12.4 Hazardous or Contaminated Waste**

#### 

#### Hazardous Substances

Hazardous substances can cause minor or moderate injury. Prolonged or repetitive exposure to hazardous substances can cause serious medical conditions. To prevent injury:

- Always read and obey the instructions provided by the product manufacturer.
- Use, handle and store substances as specified by the product manufacturer.
- Always wear appropriate personal protective equipment, refer to Safety Precautions Chapter.

Waste materials such as, but not limited to: oil, grease, lubricant, fuel, adhesive, desiccants (drying agents), battery acid, cleaning agent, solvent or corrosive substance, paint, polyester resin and/or plastic residues or articles contaminated with such substances are designated as 'Hazardous Waste' by international regulations.

- Obey applicable rules and regulations when handling, storing, transporting, processing and/or disposing of hazardous waste.
- If necessary, speak to a hazardous waste disposal company for assistance and/or advise in the disposal of hazardous waste or contaminated articles.

